



U.S. Department of Transportation

National Highway Traffic Safety Administration

#### Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

\*\*\* \*\*\* \*\*\*



SANIT,



**DYNAMIC SCIENCE, INC.** In-Depth Accident Investigation

Contract DTNH22-94-D-27058 Case DSI-94-AB-023



#### TECHNICAL SUMMARY

CONTRACT OR: CONTRACT NUMBER: Dynamic Science, Inc. DTNH22-94-D-27058 Case DSI-94-AB-023

CASE NUMBER:

This case occurred on 1994 at 1300 hours on a private, two-lane road in the county of California. The weather was clear, and the curved, dirt/rock road was dry.

Vehicle 1, a 1994 Toyota Corolla driven by a 27-year-old female, was travelling northbound approaching a right-hand curve. Vehicle 1 was occupied by a second occupant, a 3 month old female who was lying in a Century rearward facing child safety seat, located in the right front seating position. Vehicle 2, a 1981 Chevrolet Malibu driven by a 19-year-old male, was travelling southbound in the oncoming traffic lane at an estimated minimum speed of 69 KPH (43 MPH), based on pre-impact impending and locked skids. Vehicle 2 was occupied by a second occupant, a 30-year-old female. As Vehicle 1 entered the curve the driver saw Vehicle 2 and began steering right and braking but was unable to stop in time. The left front of this vehicle struck the left front of Vehicle 2. Both air bags in Vehicle 1 deployed at this point. Vehicle 2 was forced in a clockwise direction and came to rest nearly parallel to Vehicle 1.

The driver of Vehicle 1 sustained a fractured left wrist; the driver and right front occupant of Vehicle 2 were not injured.

The right front occupant of Vehicle 1 sustained bilateral parietal skull fractures, bilateral temporal subdural hematomas, and contusions to the parietal and temporal lobes associated with the deployment of the passenger's side air bag. The child was lying on her back in the rearward-facing child safety seat. The child was asleep; a blanket was covering the carrying handle and the top of the child seat, blocking the sun. This child safety seat is detachable; that is, the base of the seat can be strapped in place while the other part of the child seat can be used as a child carrier with a handle. It appears that the base was properly restrained prior to the collision. There is some question about whether the harness system of the child safety seat was properly attached to the child seat itself. The harness system was passed through the slots in the back of the child seat, but the restraining clips may not have been properly adjusted. The right front bucket seat was in the middle to front middle adjustment position at the time of the collision.

Prior to impact the driver of Vehicle 1 steered right and braked, and the child seat leaned forward and slightly to the right. At impact, the passenger's side module cover and the air bag both struck the upper right edge of the child safety seat, abrading and cracking the plastic in this area. The child seat, it would appear at this juncture, was propelled rearward and to the left. This motion also put the child in motion in the same direction. Initially it was felt that the child struck the overhead child seat handle, but this does not seem to be the case. It appears that her injuries came about as a result of the blunt force to the rear portion of the child safety seat during deployment of the passenger's side air bag. The child was transported from the scene by ambulance and was hospitalized for three days. Later that day she was taken to the emergency room when she exhibited sleepiness, vomiting, and episodes of tonic contracture of the right hand. She was readmitted and the following day underwent surgery to place a right subdural to peritoneal shunt to reduce the subdural hygromas. She was admitted for an additional six days before being released.

Vehicle 1 was towed from the scene due to damage. Vehicle 2 was driven from the scene.

This document is disseminated under the sponsorship of the Department of Transportation in the interest of information exchange. The United States Government assumes no responsibility for the contents or use thereof.

The opinions, findings, and conclusions expressed in this publication are those of the authors and not necessarily those of the National Highway Traffic Safety Administration.

The crash investigation process is an inexact science which requires that physical evidence such as skid marks, vehicular damage measurements, and occupant contact points be coupled with the investigator's expert knowledge and experience of vehicle dynamics and occupant kinematics in order to determine the pre-crash, crash, and post-crash movements of involved vehicles and occupants.

Because each crash is a unique sequence of events, generalized conclusions cannot be made concerning the crashworthiness performance of the involved vehicle(s) or their safety systems.

# DYNAMIC SCIENCE, INC. ACCIDENT INVESTIGATION CASE NUMBER: DSI-94-AB-023

# **TABLE OF CONTENTS**

Accident Data 1
Ambience
Roadway
Traffic Controls
Vehicles
Vehicle Damage and Velocity Estimates
Collision Sequence 5
Emergency Rescue Response
Occupant Kinematics
Supplemental Restraint System 6
Child Safety Seat 8
Safety Standards
Occupant Data
Injuries
List of Abbreviations
Accident Schematic
Collision Measurement Table
Color Copy Photo Index and Photos
Photo/Slide Index and Photos
Appendices:  A. NASS Field Forms  B. Police Accident Report  C. Medical Report for R/F Occupant of Vehicle 1

**ACCIDENT DATA:** 

Location: County, California

Area/Type: Rural

Date/Time: Fall / weekday / afternoon

Accident Type: Car/Car / Head-on

**Injury Severity:** 

Vehicle 1: - Driver, AIS-2

R/F Occupant, AIS-5

**Vehicle 2**: Driver and R/F occupant, No reported injuries.

**AMBIENCE:** 

Viewing Conditions: Viewing was restricted by the curves in

the roadway.

Cloud Cover: None.

**Precipitation:** Clear/dry

**Temperature:** 9 to 23° C (48 to 74° F)

**Road Surface:** Dry Dirt/rock. maintained by property

owner.

# **ROADWAY:**

**VEHICLE 1 VEHICLE 2** 

Dirt/rock

Two-lane, undivided Type: Two-lane, undivided

Width: 4.87 M (16-17 ft.) 5.2 M (16-17 ft.)

**Traffic Density:** Light Light

Median: None None

Edge: Dirt and brush bordering Dirt and brush bordering

main travelled portion of main travelled portion of the roadway.

the roadway. Dirt/rock

**Reported Defects:** None None

Co-efficient of Friction (est.): 0.55, per police estimate 0.55, per police estimate

-6% **Vertical Alignment:** +3%

**Horizontal Alignment:** Curve right Curve left

**Traffic Controls:** 

Surface:

**VEHICLE 1 VEHICLE 2** 

Signals: None None

Signs: None None

**Speed Limit:** NA - Private property NA - Private property

Markings: None None

### **VEHICLES:**

VEHICLE 1 VEHICLE 2

Description: 1994 Toyota Corolla, 1981 Chevrolet Malibu,

4-door sedan 4-door sedan

Odometer: Unknown - not inspected

(10,830 miles)

Engine: 4 cylinder Unknown

Vehicle Modifications:NoneNone

Tire Condition: Excellent Unknown - not inspected

Manual Restraints: Lap and shoulder Unknown - not inspected

restraint, front seating

position

Automatic Restraints: Supplemental Restraint None

Systems (driver's and passenger's side air

bags)

Reported Defects: None None

Cargo: Unknown Unknown

Windshield Damage: None Unknown - not inspected

Fleet: None None

Tow Status: Towed due to damage Driven from scene

### **VEHICLE DAMAGE:**

VEHICLE 1 VEHICLE 2

Object Struck: Vehicle 2 Vehicle 1

Event Number: 01 01

CDC: 12FLEE3 12FLEE6 (photographs)

Maximum Crush: 3.0 cm (1.1 in.) at N/A - CDC Only

bumper, contact damage down the left side of vehicle - Zone 3

### **VEHICLE VELOCITY ESTIMATES:**

## VEHICLE 1 VEHICLE 2

Impact Speed:16 - 24 KPHPre-crash minimum travel(estimated)(10-15 MPH)speed: 69 KPH (43 MPH)

Total Delta V: Not computed, the Not computed, the collision

collision condition was condition was beyond the beyond the scope of scope of the CRASH III

CRASH III PC PC

**Longitudinal Delta V:** 

Lateral Delta V:

**Energy Dissipation:** 

Calculations for Vehicle 2 pre-crash minimum travel speed based upon police generated field information using the following formula:

$$S = 5.5 \sqrt{d*f*b}$$
where  $d$  = distance,  $f$  = coefficient of friction,  $b$  = braking,  $S$  = speed(MPH)
$$S = 5.5 \sqrt{110)(.55)(1.00)}$$

$$S = 42.78$$

$$S = 43 MPH$$

#### **COLLISION SEQUENCE**:

Pre-Crash:

Vehicle 1, a 1994 Toyota Corolla driven by a 27 year old female, was travelling northbound approaching a right-hand curve. Vehicle 1 was occupied by a second occupant, a 3 month old female who was lying in a Century rearward facing child safety seat, located in the right front seating position. Vehicle 2, a 1981 Chevrolet Malibu driven by a 19-year-old male, was travelling southbound in the oncoming traffic lane at an estimated minimum speed of 69 KPH (43 MPH), based on pre-impact impending and locked skids. Vehicle 2 was occupied by a second occupant, a 30-year-old female.

Crash:

As Vehicle 1 entered the curve the driver saw Vehicle 2 and began steering right and braking but was unable to stop in time. The left front of Vehicle 1 struck the left front of Vehicle 2. Vehicle 1 revels an impact (longitudinal force) on the left front tire/wheel area. This impact deflated the tire, placed a deformation of approximately 8.0 to 10.0 cm (3.0 to 4.0 in) on the rim and reduced the wheelbase by approximately 14.0 cm (5.5 in). The estimated impact speed could have been in the range of 40 to 48 KPH (25 to 30 MPH). This impact to Vehicle 1 was of sufficient magnitude to deploy both air bags.

Post Crash:

<u>Final Rest</u>. Both vehicles came to rest on the roadway. Vehicle 1 was located on its wheels facing NW in the Northbound portion of the road. Vehicle 2 was located on its wheels facing SW in the curve partially blocking both sides of the road.

Rescue Activities. An ambulance and a fire unit responded to the scene. The right front passenger of Vehicle 1 was transported from the scene to a local hospital. The driver of Vehicle 1 (the mother of the right front passenger) accompanied the child to the hospital.

<u>Scene Clearance</u>. Vehicle 1 was towed from the scene due to damage to a local tow yard and was subsequently towed to the owner's residence. Vehicle 2 was driven from the scene.

Occupant Kinematics:

The left front occupant of Vehicle 1 was in a forward upright driving position prior to impact and was wearing the available 3-point manual lap and shoulder belt system. At impact she went forward and engaged the driver's side airbag. Her left hand possibly came in contact with the air bag module cover as she was attempting to steer the vehicle to the right to avoid Vehicle 2 and she

fractured her left wrist. The driver was treated at the scene and subsequently transported to a local hospital where she was treated and released.

The right front occupant of Vehicle 1 was lying on her back in a Century 580 series rearward-facing child safety seat. The child was asleep; a blanket was covering the carrying handle and the top of the seat, blocking the sun. This seat is detachable; that is, the base of the seat can be strapped in place while the other part of the seat can be used as a child carrier with a handle. When the handle is in the up position the seat is held in place with a single lock. The proper position for the handle is in the down position which secures the seat using a double lock. It appears that the latch portion of the seat was connected in the single lock position, because the child seat handle was not in the down position to double lock the seat to the base. However, it appears that the base was properly restrained prior to the collision. There was some question about whether the harness system of the child safety seat was properly attached to the child seat itself. The two belts were passed through the slots in the back of the child seat, but the restraining clips were not properly adjusted. A post-collision inspection by police officers indicated that "the restraint belts were not anchored through the back of the seat. They only went through the comforter, which was lining the seat." The right front bucket seat was in the middle to forward middle adjustment position. This position, combined with the length of the child seat, put the forward facing lip of the child seat somewhere between 8-13 cm (3-5 in.) distant from the predeployment position of the air bag module cover.

Prior to impact the driver braked and the child safety seat leaned forward and slightly to the right. At impact, the module cover and the air bag both struck the upper right edge of the car seat, abrading and cracking the plastic in this area. The child safety seat, it would appear at this juncture, was propelled rearward and to the left. This motion also put the child in motion in the same direction. Initially it was felt that the child struck the overhead child seat handle, but this does not seem to be the case. It appears that her injuries came about as a result of the blunt force to the rear portion of the child safety seat during deployment of the passenger's side air bag. The child was transported from the scene by ambulance and was hospitalized for three days. Later that day she was taken to the emergency room when she exhibited sleepiness, vomiting, and episodes of tonic contracture of the right hand. She was readmitted and the following day underwent surgery to place a right subdural to peritoneal shunt to reduce the subdural hygromas. She was admitted for an additional six days before being released.

# **Supplemental Restraint**

System:

The 1994 Toyota Corolla was equipped with a supplemental restraint system for both the driver and right front occupant position that deployed as a result of the vehicle's frontal impact with the front of a 1981 Chevrolet Malibu.

The driver's side air bag module cover opened along the designed tear points.

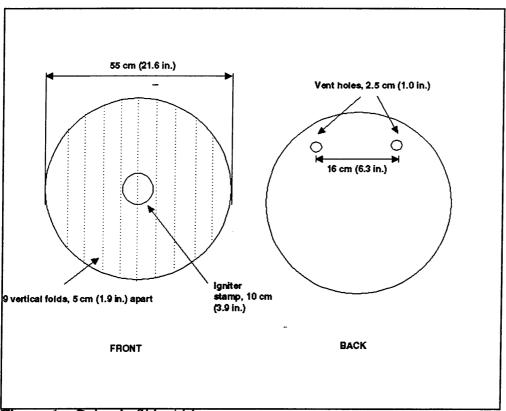


Figure 1. Driver's Side Airbag

The passenger side air bag module cover opened along the designed tear points. The cover contacted the forwardmost portion of the child safety seat in this seat position. The flap surface was abraded from this contact and cover itself was deformed, primarily on the right side. The airbag itself sustained a vertical, linear scratch in its surface. The scratch was 14.0 cm (5.5 in.) in length, 6.0 cm (2.4 in.) to the left of the right-hand seam on the top and 9.0 cm (3.5 in.) to the left of the right-hand seam on the bottom.

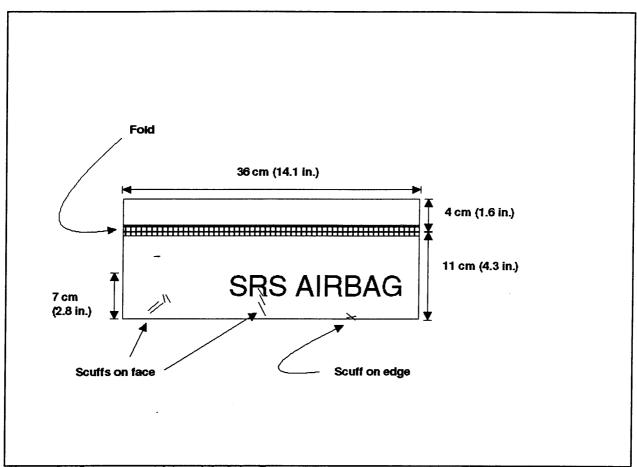


Figure 2. Passenger Airbag Module Cover

#### **Child Safety Seat:**

The right front occupant was using a Century 580 Series infant child seat. This seat/carrier is equipped with a stay-in-car base. It uses a 3-point harness system with a push-button buckle. There are two shoulder harness positions. The base was held in place by the right front 3-point manual lap and shoulder belt. The seat was given as a present to the involved family. No written instructions were provided. The seat had not been involved in any other collisions. At the time of the collision, the child was using the child seat's 3-point harness. According to interview information the shoulder straps had been passed through the seat back and secured on each side with a metal buckle. A post-crash inspection of the seat revealed that the shoulder straps were found on the inside portion of the carrier between the padding and the seat back itself. No physical evidence (scratches, scoring, etc.) was found during the inspection of the pass-through holes but given the ease with which the buckled straps can be pulled through the opening it appears likely that the buckles were indeed pulled through the opening during the rearward motion of the child.

The seat/carrier was damaged as a result of contact with the air bag and air bag module cover. The upper right corner was cracked and there were abrasions along the back edge. The clip on the left rear side (which can be used to attach the carrier to a shopping cart) was broken off. There was a longitudinal crack in the base of the seat portion of the child safety seat. There were loading marks on the squared cutouts which secured the carrier to the base.

The carrier portion of the child seat can be placed into the base in one of two ways. The proper method is described in the printed instructions on the seat: "TO SECURE CARRIER TO BASE: SET CARRIER INTO BASE, PUSH RED BUTTONS IN AND MOVE HANDLE BACK." The carrier can also be secured by simply placing the carrier into the base and pressing it into position. The squared cutouts in the carrier will slide over the slanted locking bolt until the bolt passes into the cutout. The seat is locked at this point.

The carrier portion of the child safety seat can only be removed in one way, as described in the printed instructions on the seat: "TO REMOVE CARRIER FROM BASE: PUSH RED BUTTONS IN AND MOVE HANDLE UP, LIFT CARRIER OUT OF BASE." The removal mechanism is fairly straightforward: as the handle is rotated a cam at the base of the handle forces the round red button attached to the locking bolt laterally which, in turn, draws the locking bolt outward away from the squared cutouts until the seat is released.

Information regarding how to fasten the seat to the base can be found on page 5 of the instructions for installation and usage brochure that accompanies

12.

new seats, as described in 12 through 14:

The driver stated that the carrier came away from the base (at least on one side) but this seems unlikely. There was obvious evidence that the seat/carrier had been single locked to the

- Reposition handle to its carrying position (Fig. 11).

  MAKE SURE BOTH SIDES CLICK INTO POSITION.
- Set Round Handle Hubs into curved recesses of Base (Fig. 11) until <u>both</u> sides click into position.
- 14. To Lock Seat to Base:
  - a. Push in Red Buttons on each Hub.
  - b. Rotate Handle BACKWARD until it locks just behind SEAT (Fig. 12). (This activates a "Double Lock" which secures the seat to the base.)
  - c. <u>PULL UP</u> on both Handle Hubs to be sure they are LOCKED.

base. There was no indication that either portion of the lock had failed. The seat was found by the investigating officers in the center console area. A more likely scenario would be that the seat was removed post-collision by the driver so that she could more closely observe the injured child.

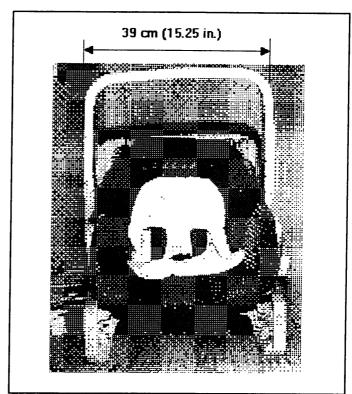


Figure 3. Front view of Child Seat

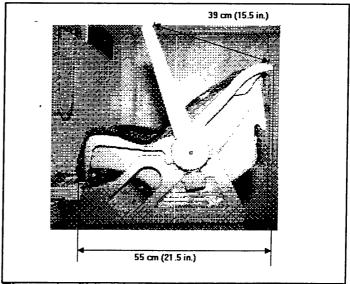


Figure 4. Side View of Child Seat


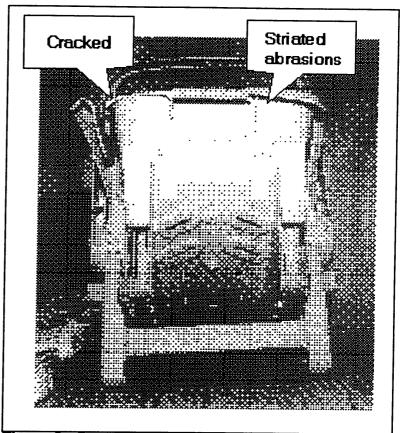


Figure 5. Damage on Child Seat



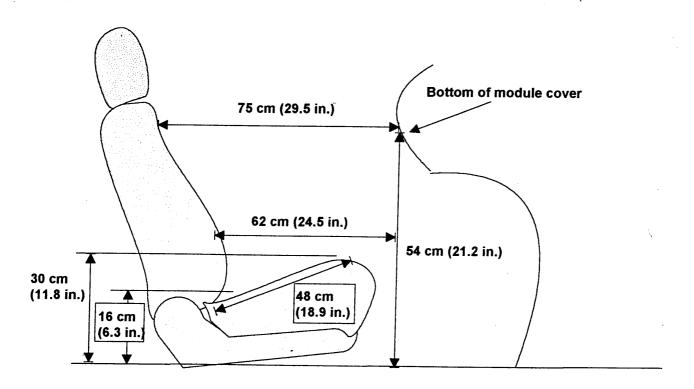

# CAUTION!

The rear center seat belts of certain model cars may not enable the snuggest installation of child car seats. As a result the car seat base may slip or slide in the center rear seat.

Before you use the Century 580 Car Seat, check for proper fit in your car.

Please follow the steps listed below:

1. Install the base in the rear center seating location according to the instructions (Fig. 20). 2. Once the seat is secured. twist and push the car seat toward both sides of the car. 3. If the Auto Lap Belt slips through the Latch Plate, go to the next step. If it does not, you do not have a problem. 4. Disconnect (unbuckle) the Latch Plate from the Buckle. 5. Readjust (tighten) the Belt in order to secure the base again. 6. Before buckling this time.


(Fig. 21). 7. Test to see if this "fix" solves the problem by again twisting and pulling on the base as you did before.

turn the Latch Plate over (or

rotate it 180 degrees, thereby putting one twist in the

webbing) and then buckle

8. If the problem remains. then the base should be moved to another seating location in the car.

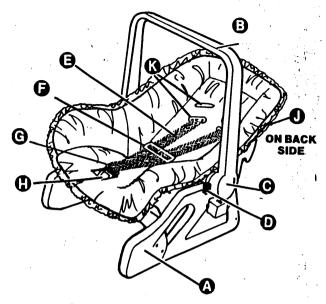

# 580 **INFANT CAR SEAT IDENTIFICATION**


- Base
- (B) Handle
- C Handle Hub
- **Locking Buttons (Red)**
- **Shoulder Strap**
- Harness Tie
- (G) Buckle
- **Buckle Tongue**
- **Metal Strap Slides**
- Infant Shoulder Strap Slots




FIG. 20

# **NEVER LEAVE CHILD UNATTENDED**

# INCTOUCTION: Installation and Usage

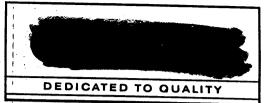

# 580 **INFANT CAR SEAT DESIGNER SERIES**

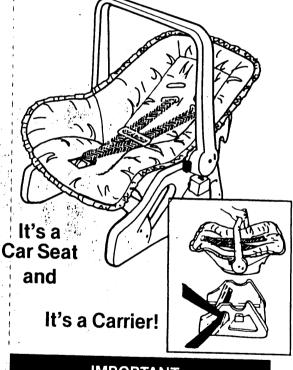

# **IMPORTANT:** Please read and SAVE these instructions.

# **WARNING:**

Failure to follow each of the following instructions can result in your child striking the vehicle's interior during a sudden stop or crash. Secure this child restraint with a vehicle belt as specified in this instruction booklet.

-13-

# All ENTION: Consumer Service Department

# 580 CAR SEAT MODELS 4582, 4586 AND 4588

NOTE: Please Allow Approximately 4 Weeks For Delivery.

DESCRIPTION	COLOR	PART NO.	QTY.	PRICE	TOTAL
Fabric Pad, Poly/Cotton	•	CS-44		\$24.95	
Base Assembly	Gray	CS-462-GY		19.95	
Base Assembly	White	CS-462-WH		19.95	
Shoulder Strap	Navy	CS-94-NA		1.00	
Shoulder Strap	Gray	CS-94-GY		1.00	
Strap Slide (1)	Chrome	CS-77		.50	
Harness Tie	Gray	CS-80-GY		1.00	
Locking Clip		CS-39		1.75	
Headrest Foam		CS-15		2.95	
Buckle (See Below)	Gray	CS-98-GY		7.25	
Buckle (See Below)	Black	CS-98-BK		7.25	
Vinyl Pad	•	CS-84		8.95	
Buttons, Push-In (14)		CS-8		.75	
Instruction Sheet		PL-4586		FREE	

Please Indicate color & pattern of pad. NOTE: If requested color is not available, a similar color will be substituted.

**Amount of Order** ‡Sales Tax (see Chart) Shipping & Handling

2.50 TOTAL

‡ARKANSAS Residents Add 5% Sales Tax CALIFORNIA Residents Add 6.5% Sales Tax OHIO Residents add 5.5% Sales Tax

SHIP TO: Customer Name	
	State Zip
Child(s) Birthdate(s)	
	unt of \$
WE MUST HAVE BELOW INFO See Label on Side of Car	PRMATION TO PROCESS YOUR ORDER: Seat Base For:
Model #	MFR./Lot #



**CAUTION:** Black & Gray Buckles are NOT interchangeable. Please check color of existing buckle before ordering a replacement. If existing Buckle is unavailable, use the chart below to determine which Buckle to order. Line up the bottom edge of this sheet with the tongue on your 580 Car Seat to determine which set of marks the tongue lines up with.

> .990" = BLACK 870"-

# MTRODUCTION

- 1. Designed for children from birth to 6 months (18 lbs.).
- 2. Crash Tested and conforms to current NHTSA Safety Standards (FMVSS 213). Approved for motor vehicles and aircraft.
- 3. Read and SAVE this Instruction Booklet for future reference.
- 4. Carefully install this seat to insure maximum protection to vour child.

# DO'S AND DON'TS AND GENERAL INFORMATION


IMPORTANT: AUTO LAP **BELTS MUST BE THREADED** AS SHOWN AND SECURELY TIGHTENED FOR PROPER RESTRAINT.









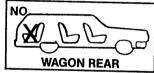





ON CAR SEATS EQUIPPED WITH CLOTH PADS, RE-**MOVE PAD AND MACHINE** WASH ON GENTLE CYCLE. MACHINE COOL AIR DRY.


- Do use only on automobile seats which face FORWARD and have SEATBELTS.
- DON'T use on vans where seats face sidewards or wagons where seats face backwards.
- The center rear seat is normally the safest location for your car seat. We suggest an adult sit next to your child when sitting rear facing in this rear-center location.
- Do secure the Century 580 car seat to your automobile by using your Auto Lap Belts as shown on pages 3 and 4 and frequently check to be sure your car seat is firmly anchored even when unoccupied.
- 5. Do use the LOCKING CLIP for seat installations where conditions exist as on page 6.
- DON'T use this seat in autos with "Passive Restraints." (A Passive Restraint is one in which the auto lap belt automatically surrounds the driver's or passenger's waist when the car door is closed.)
- Do frequently check Shoulder Straps and Metal Strap Slides for tightness and correct threading.
- 8. Do use your car seat on every trip. The SHORT TRIPS are the most dangerous!
- 9. Do clean your Century 580 car seat with mild soap and a damp cloth. Dry thoroughly. Never use solvents. Do not submerge vinyl
- 10. Your car seat should be replaced if it has been in an accident, even if it appears to be undamaged. 2


# MSTALLATION

# TO BE USED REAR FACING ONLY!


This seat is designed for infants weighing 18 lbs. or less and who are under 27 inches tall. It should be installed **REARWARD FACING ONLY!!** 

1. Position Base on auto seat and thread auto Lap Belts through side openings as shown (Fig. 1).

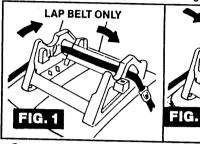

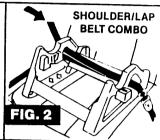

2. NOTE: If Lap Belt and Shoulder Belt are interconnected as in most auto seats, thread both belts through the Base (Fig. 2). Use the Locking Clip, if required, as shown in Fig. 2A and on Page 6. For Seats

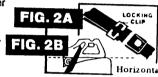


which are severely sloped, level your Car Seat Base by placing a folded or rolled towel beneath the rear of the Base. Don't allow base to be tilted forward beyond horizontal (Fig. 2B).

# PLACING INFANT INTO THE SEAT

- 3. Unthread Harness Tie from child's left Shoulder Strap (Fig. 3).
- 4. Push in Red Release Button to unbuckle Shoulder Straps (Fig. 4).

**CAUTION: Metal parts** exposed to sunlight become hot and can burn your child! Cover with a towel when continuously exposed to sunlight.

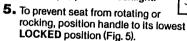

6. Place child into Seat as shown (Fig. 5, 6).

7. Fasten Shoulder Straps to Buckle Tongue (Fig. 6) and rethread Harness Tie (Fig. 9).

WARNING: Periodically inspect the Buckle Tongue for excessive wear and to ensure the Tongue has not become bent.

8. DO NOT place child into Car Seat if wrapped in a blanket or a comforter, or if dressed in an outfit without leg holes. For maximum child retention, the Shoulder Straps must pass over the shoulders and between the legs directly to the Buckle Tongue as shown in



BEND

HARNESS TIE

FIG. 3









AVAILABLE COPY

9. To adjust Shoulder Straps so that they fit SNUGLY across child's chest, adjust metal Strap Slides in back of Seat (Fig. 7 & 8). For very small infants use the Lower Back Slots. Move to the Upper Slots when the child's shoulders grow above the lower slots. (Rethread one strap at a time so that the other

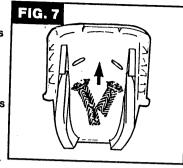

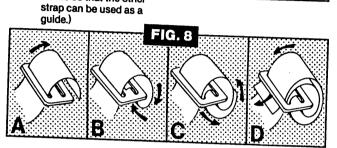

- 10. Be sure metal Strap Slides are rethreaded as shown in Fig. 8 to prevent possible slippage.
- 11. Rethread plastic Harness Tie as shown in (Fig. 9) to prevent Straps from sliding off child's shoulders, Position Harness Tie to center of child's chest.




# Harness Tie Usage


Purpose: The plastic Harness Tie is important in keeping the shoulder belts properly positioned on the child's shoulders (Fig. A).

Unthread open side of plastic Harness Tie (Fig. B).

Place child into car seat.

After securing child into car seat according to instructions, rethread Shoulder Strap through open side of Harness Tie (Fig. C).

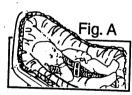

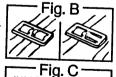





IMPORTANT: Car seat straps must be properly threaded to ensure child's maximum safety during a sudden stop or accident. Check them frequently.

- 12. Reposition handle to its carrying position (Fig. 11). MAKE SURE BOTH SIDES CLICK INTO POSITON.
- 13. Set Round Handle Hubs into curved recesses of Base (Fig. 11) until both sides click into positon.
- 14. To Lock Seat to Base: a. Push in Red Buttons on each Huh
- b. Rotate Handle BACK-**WARDS** until it locks just behind SEAT (Fig. 12). (This activates a "Double Lock" which secures the seat to the base )
- c. PULL UP on both Handle Hubs to be sure they are LOCKED.

**NOTE: This Base is** designed to accommodate only the Century 580 Car Seat. Any other carrier will be UNSAFE.

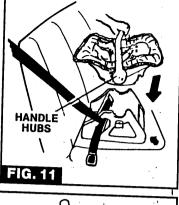


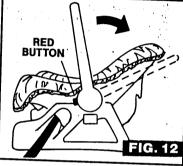

# REMOVING SEAT FROM BASE


- 15. Push in both Red Buttons and rotate handle forward until it is in the carrying position. (Fig. 13). Make sure both sides click into position.
- 16. Lift Seat out of Base.


NOTE: Once the Seat is positioned on the Base. the Handle must be "Double Locked" and then "Unlocked" before the Seat can be removed from the base.

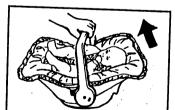



**36.18** 


No child restraint can guarantee protection from injury in every possible situation. But, proper use of a restraint system may reduce a child's risk of injury or death.

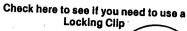

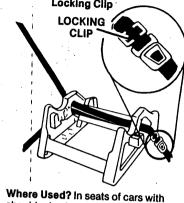

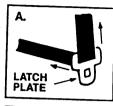

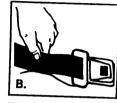

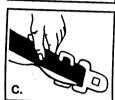

the male Latch Plate slides freely (Fig. A). 2. Purpose: To allow the car seat to be

shoulder-lap belt combination where

- installed securely by eliminating belt slippage through the Latch Plate.
- 3. Installation
- Install Car Seat according to instruc-
- With Latch Plate snapped into Buckle, pinch together the Shoulder Belt portion to the Lap Belt portion. While still pinched, disconnect the Latch Plate from Buckle (Fig. B).
- Thread Webbing (still pinched) into Locking Clip, one side at a time (Fig. C).
- Snug Locking Clip as close to Latch Plate as possible (Fig. D).
- Snap Latch Plate into Buckle. Be sure all slack is out of Lap Belt (Fig. E).
- 4. Remove Locking Clip when Car Seat is permanently removed from the automobile.
- 5. Once properly installed, this adjustment is designed to be retained until Locking Clip is removed or vehicle seat is repositioned.

CAUTION: To help lessen the chance or severity of injury in an accident, the locking clip must be removed from the seat belt webbing when the seat belt is to be used by another occupant.





1. Your Century 580 Infant Car Seat/Carrier is designed to fit on most shopping carts. IT WILL NOT FIT ON ALL SHOPPING CARTS.

WARNING: If the Infant Car Seat/Carrier does not lock onto the cart (two rear tabs locked onto a cart cross wire), DO NOT use on that shopping cart.

# 2. DEEP BASKET CART WITH CHILD SEAT AREA

CAUTION: DO NOT use the 580 on a deep basket cart which does not have a child seat area in the cart.


Gently lower 580 (rear facing) into child seat area of cart and position rear tabs to fit over middle cart cross wire (Fig. 15). Press down firmly on seat back to lock the two rear tabs onto middle cart cross wire (Fig. 16). The front of the rocker base will rest on the cart handle or the rear cart cross wire.



FIG. 17

WARNING: Lift up on 580 seat back to ensure BOTH tabs are locked onto the middle cart cross wire.

**CAUTION:** If both tabs DO **NOT LOCK onto cross** wire, DO NOT use on that shopping cart.

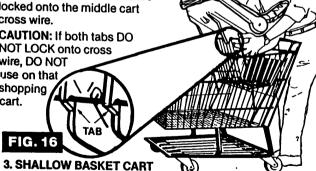

Gently set 580 into large basket area of cart and position rear tabs to fit over front cart cross wire. Press down


firmly on seat back to lock the two rear tabs onto the cart cross wire (Fig. 17).

WARNING: Lift up on 580 seat back to ensure BOTH tabs are locked onto the cart cross wire.

CAUTION: If both tabs DO NOT LOCK onto cross wire, DO NOT use on that shopping cart. 💂

# 4. TO DEMONT 530 FROM SHORONG CART


Simultaneously press in two rear tabs and lift up back of car seat/carrier to disengage lock from shopping cart cross wire (Fig. 18).

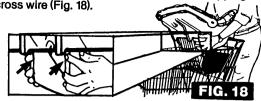

CAUTION: Use extra care when using the 580 in a shopping cart. Irregular floor, sidewalk and road surfaces, inclement weather, and traffic are all potential hazards.

BUCKLE UP! Always use the Shoulder Straps, Buckle, and Harness Tie whenever your child is in the Century 580 Infant Car Seat/Carrier.

### **CARRIER USE**

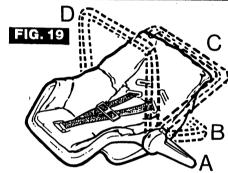


- 1. To change positions of HANDLE, press HANDLE BUTTONS simultaneously and with both hands rotate HANDLE to desired position: A. FEEDING/PLAYING, B. NAPPING. C. STORAGE, D. CARRYING (Fig. 19).
- 2. To lock 580 Infant Car Seat/Carrier into a non-rocking position, reposition the HANDLE into position "A" as shown in Fig. 19.
- WARNING: While using on a table or counter top, ALWAYS keep the 580 Infant Car Seat/Carrier at least 12" from any table or counter edge and STAY WITHIN REACH OF YOUR CHILD. Child's wiggling and rocking may cause the carrier to move and possibly fall off the table or counter.

NOTE: When ordering a Vinyl Pad, be sure to order "Push-In Buttons" as well.




**DESIGNER PAD. FABRIC** CS-44

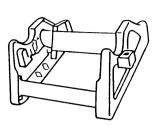


**BASE ASSEMBLY** CS-462



BUCKLE CS-98

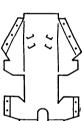

VINYL PAD CS-84

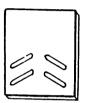

HEADREST FOAM CS-15



**SHOULDER STRAP** CS-94



**PUSH-IN BUTTON** 




**PLASTIC HARNESS TIE** CS-80-GY



**LOCKING CLIP** 



METAL STRAP SLIDES

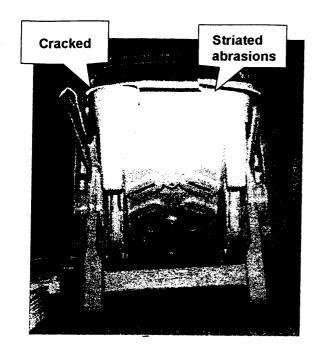

(3) (3) (3) (4)



39 cm (15.5 in.)

**Safety Standards:** 

There were no violations of Federal Motor Vehicle Safety Standards and Regulations found during the inspection of the case vehicle.

In a US DOT news release dated annual 1994, the Secretary announced a requirement that new rear-facing child safety seats be labeled by the manufacturers with a clearly visible warning against using them in seating positions equipped with an air bag. An amendment to Federal Motor Vehicle Safety Standard No. "Child Restraint Systems," also requires the safety seat manufacturers to give purchasers safety information on using the seats in vehicles with air bags.

The placement of child safety seats is addressed on page 40 of the 1994 Toyota Corolla's Owner's Manual as shown below.

(D) INSTALLATION ON FRONT SEAT ---Vehicles with front passenger airbag CAUTION:

Do not use a rear-facing child restraint system in the front seat because the force of the rapid inflation of the passenger airbag may cause severe injury to the child. When using a forward-facing child restraint system, move the seat as far back as possible.

# DRIVER AND OTHER OCCUPANTS:

# **VEHICLE 1**

DRIVER OCCUPANT 2

Age/Sex: 26/Female 3 months/Female

Seated Position: Left front Right front

Seat Type: Bucket Bucket

**Height:** 163 cm (64 in.) 51 cm (20 in.)

Weight: 59 kg (130 lbs.) 6 kg (13 lbs.)

Occupation: Unknown None

**Pre-existing Medical** Unknown None Condition:

Alcohol/Drug Involvement: None None

Driving Experience: Unknown NA

Body Posture: Upright position Lying down in a child safety

seat

Hand Position: Probably on the steering In child safety seat wheel, it was indicate that

she was attempting to turn the vehicle to the right

Foot Position: Left foot on floor and right In child safety seat

foot on brake

Restraint Usage: Available manual 3-point Available manual 3-point lap

lap and shoulder belt and the supplemental restraint system (driver's side air bag) used and shoulder belt used properly to secure rearward facing child safety seat, child safety seat and the supplemental restraint

system (right front passenger's

side air bag) used

# DRIVER AND OTHER OCCUPANTS (con't):

# **VEHICLE 2**

DRIVER RIGHT FRONT

Age/Sex: 19/Male 30/Female

Seated Position: Left front Right front

Seat Type: Unknown Unknown

**Height:** - 188 cm (74 in.) Unknown

Weight: 77 kg (170 lbs.) Unknown

Occupation: Unknown Unknown

Pre-existing Medical Unknown Unknown Condition:

Alcohol Involvement: None None

Driving Experience: Unknown NA

Body Posture: Upright position Asleep, per PAR

Hand Position: Unknown NA

Foot Position: Unknown - Unknown

Restraint Usage: Lap and shoulder used, per Lap and shoulder used, per

PAR PAR


Additional Occupants: None

# **INJURIES:**


# Vehicle 1


	<u>INJURY</u>	OIC CODE	ICD-9	SOURCE
DRIVER:	Empatrimo loft auria	752002 2 2	014.0	D
	Fracture, left wrist	752002.2,2	814.0	Driver's air bag module cover
R/F OCCUPANT	Bilateral temporal subdural hematoma(right and left)	140654.5,3	852.2	Child safety seat back
	Small contusion, right parietal lobe	140602.3,1	851.0	Child safety seat back
	Small contusion, right temporal lobe <sup>1</sup>	140602.3,1	851.0	Child safety seat back
	Parietal skull fracture, right	150402.2,1	800.20	Child safety seat back
	Parietal skull fracture, left	150402.2,2	800.20	Child safety seat back
Vehicle 2				
	<u>INJURY</u>	OIC CODE	ICD-9	SOURCE
DRIVER:	Not injured			
R/F OCCUPANT	Not injured			

<sup>&</sup>lt;sup>1</sup>If contusion and compression or contusion and hematoma are diagnosed code both. <u>1993</u> NASS Injury Coding Manual.

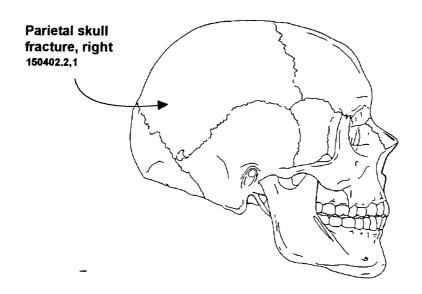

(年) (新) (新)

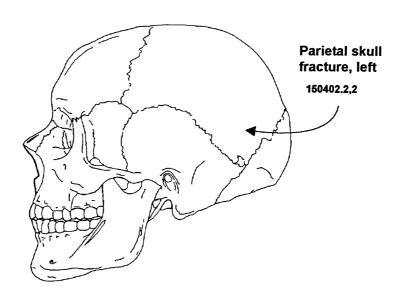

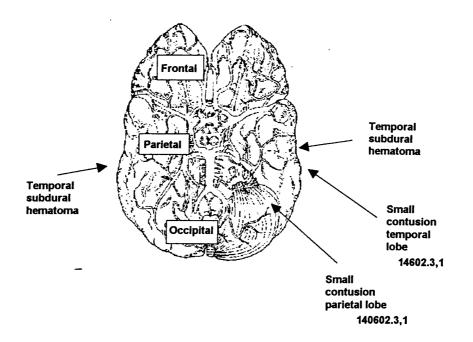

4 left and 1 right side parietal 3-8 mm foci, possibly related to contusions or shear injuries


# Abbreviations Used In Narrative, Scene And Photographic Documentation

ft Feet in Inches AIS Abbreviated Injury Scale BLF Begin Left Front BLR Begin Left Rear **BRF** Begin Right Front Begin Right Rear BRR Cab Behind Engine CBE CCW Counterclockwise CDC Collision Deformation Classification CG Center of Gravity CM Centimeter COE Cab Over Engine ĆΨ Clockwise E, EB East, Eastbound ELF End Left Front ELR End Left Rear ERF End Right Front ERR End Right Rear **FRP** Final Rest Position Ι Interstate Highway KG Kilogram KPH Kilometers Per Hour LF Left Front LR Left Rear M Meter N, NB North, Northbound NE Northeast NW Northwest Principal Direction of Force **PDOF** Point of Impact POI R Radius of Curvature RF Right Front RLReference Line RP Reference Point RR Right Rear S, SB South, Southbound SE Southeast SW Southwest Time or Elapsed Time (in seconds) T U.S. United States Highway

Vehicle Number 1

West, Westbound

V1 W, WB

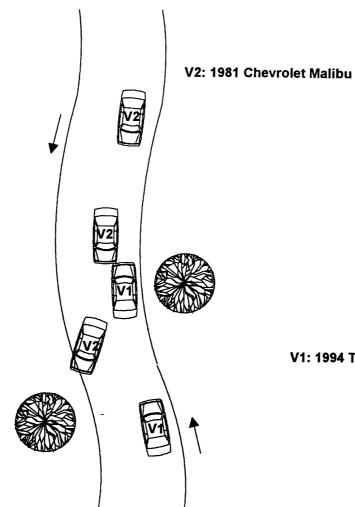

V1: 1994 Toyota Corolla

DSI-94-AB-23

Scale: 1" = 20'

North

# **Collision Measurement Table**

Case Number: DSI-94-AB-023

**Reference Point:** 

Private driveway

Reference Line:


Road edge


DATA POINT	LONGITUDINALS	LATERALS
Right-hand SB curve: MO=.75 in., chord = 25 ft.		
Right-hand NB curve: MO=.75 in., chord = 25 ft.		
Road surface: dirt -		
Approximate POI	≈50 SRP	
Road width: varies 16-17 ft.		
Grade:		
Northbound 3 in./48 in6%		
Southbound 1.5 in. /48 in. +3%		


# COLOR COPY PHOTO INDEX


Case Number: DSI-94-AB-023


PHOTO NO.	VEHICLE NO.	DIRECTION OF PICTURE	SUBJECT MATTER
1-2	2	South	Path to area of impact.
3-5	2	South	Path to area of impact.
6	1/2	South	Final rest - shows left side of Vehicle 1 and right side of Vehicle 2.
7	1	NA	Child safety seat.
8	1/2 -	South	Final rest - shows left side of Vehicle 1 and right side of Vehicle 2.
9-10	1	NA	Child safety seat.
11	2	North	Vehicle exterior - left side.
12	1	NA	Closeup of child safety seat.
13	1	North	Vehicle exterior - left side.

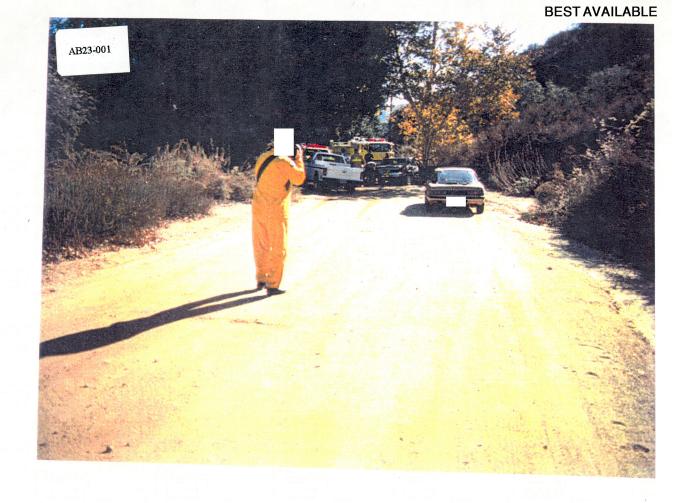


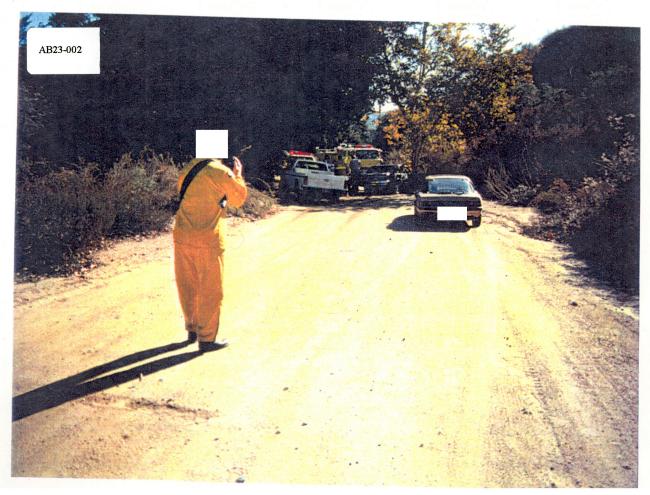


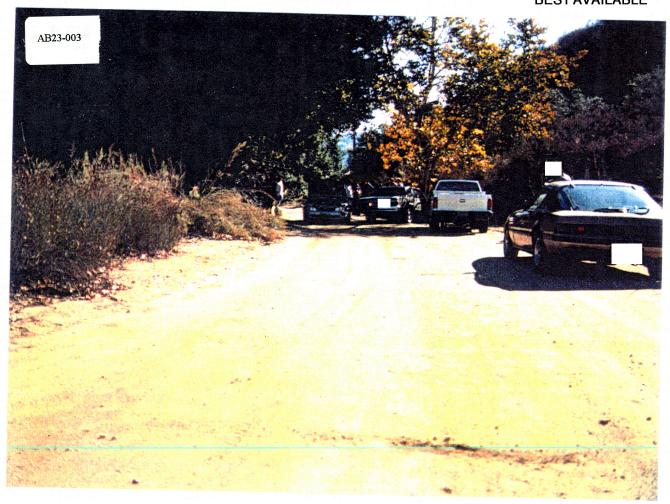


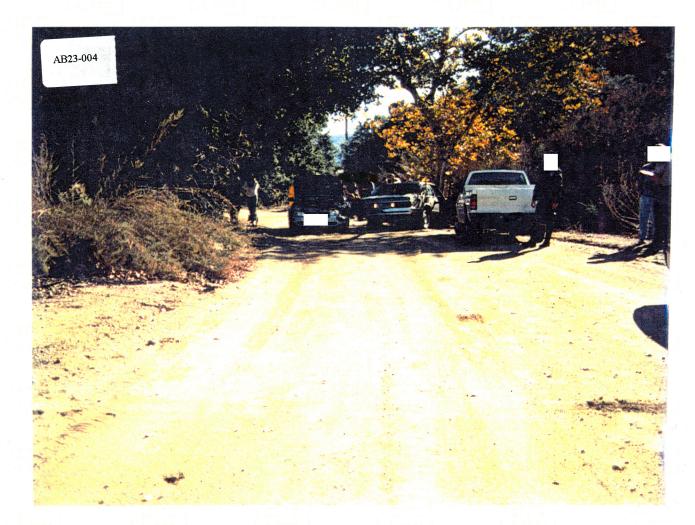


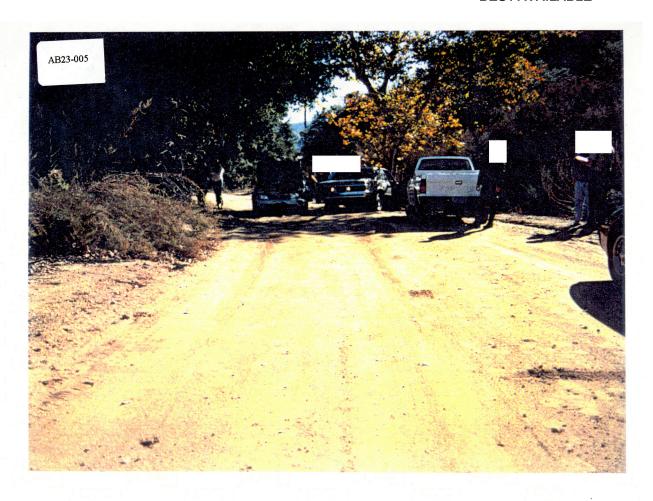

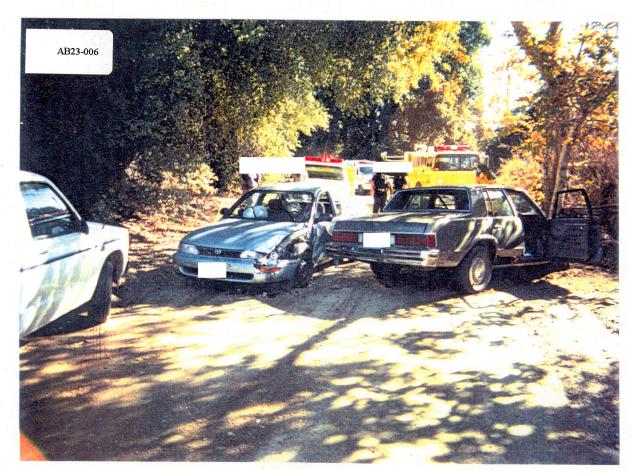


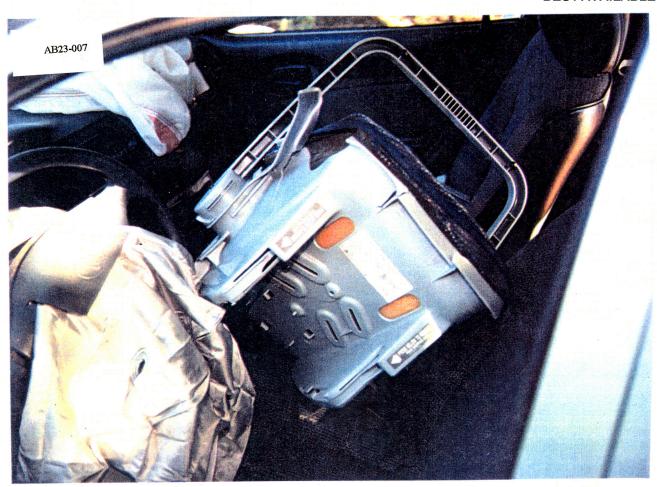

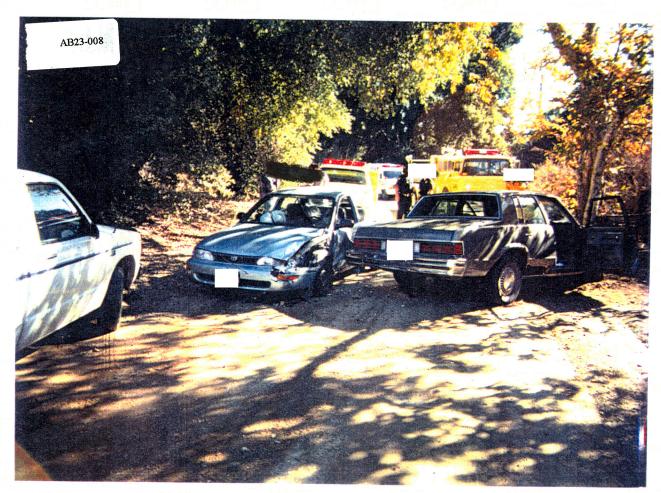

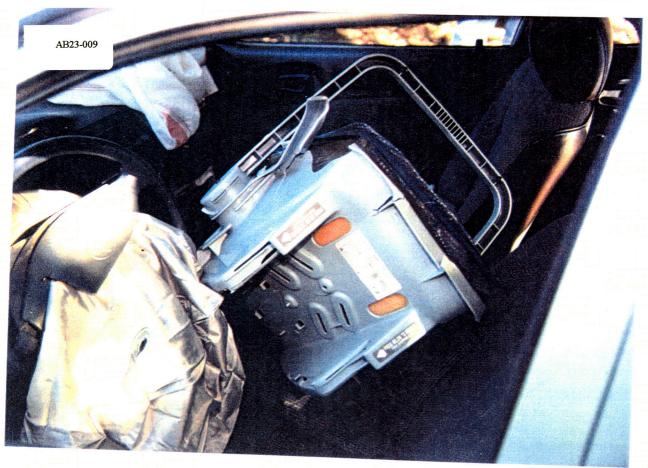



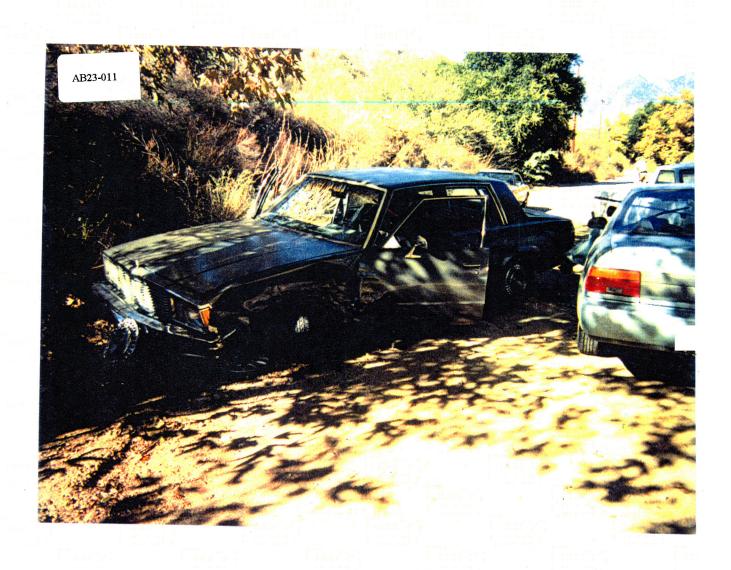







# PHOTO/SLIDE INDEX

Case Number: DSI-94-AB-023


PHOTO NO.	VEHICLE NO.	DIRECTION OF PICTURE	SUBJECT MATTER
1-2	1	North	Approach to area of impact.
3	1	North	Area of impact.
4	1	South	Looking back view along path.
5-6	2	South	Approach to area of impact.
7	2	South	Area of impact.
8	2	North	Looking back view along path.
9-22	1	CCW	Vehicle exterior.
23-50	1	NA	Vehicle interior: Slide #32 shows module cover Slide #36 shows abrasion to airbag fabric Slide #40 shows airbag/module contact to windshield. Slide #46 shows loading to right front lap/shoulder belt
51-67	1	NA	Child safety seat: Slide #55-56 show damaged portion of seat
68-73	1	NA	Police photos of exterior and of child safety seat.



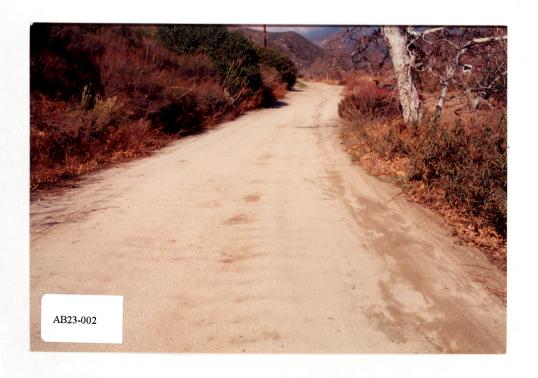

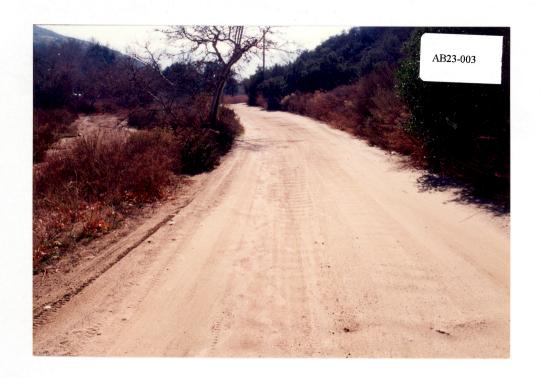




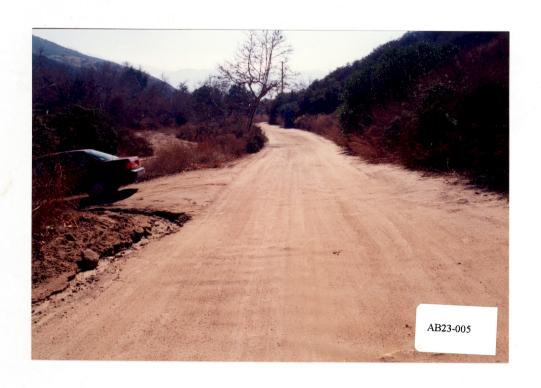








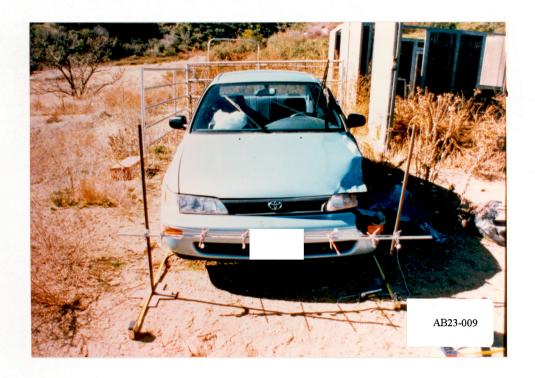




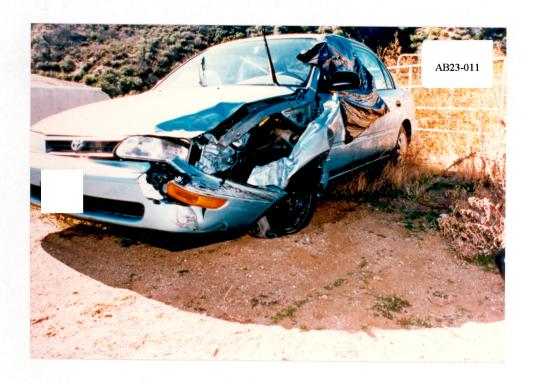







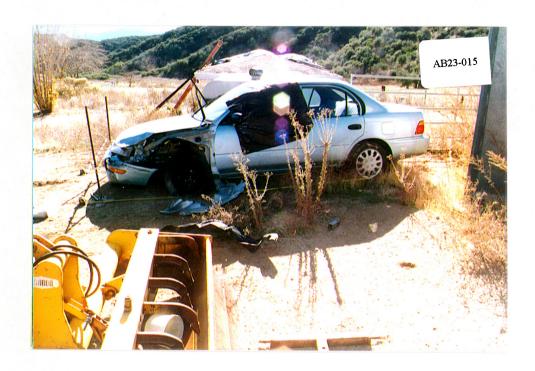














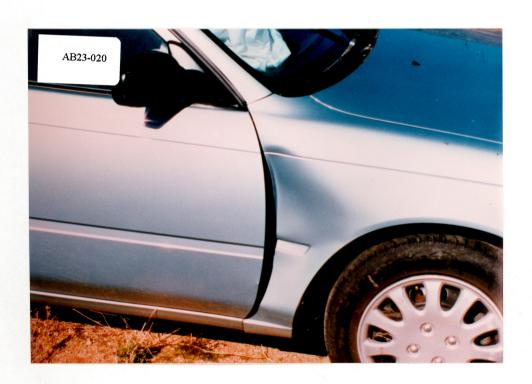

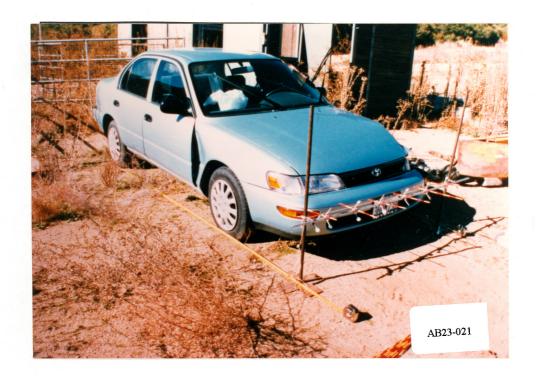


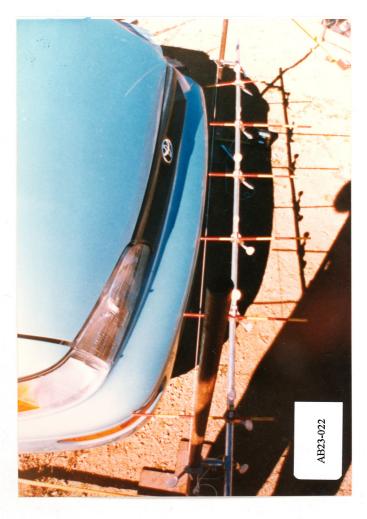

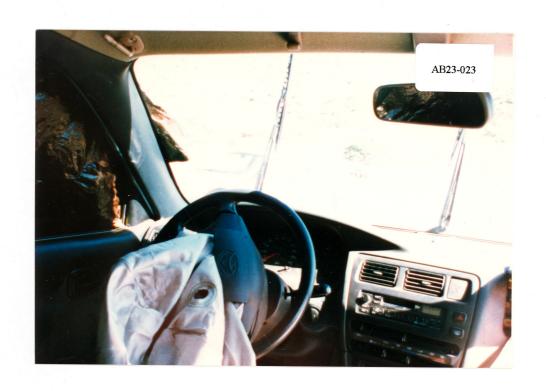

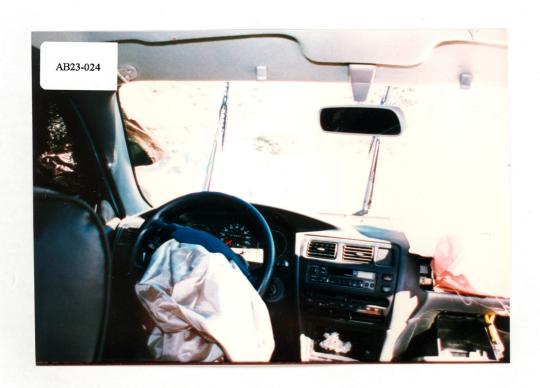



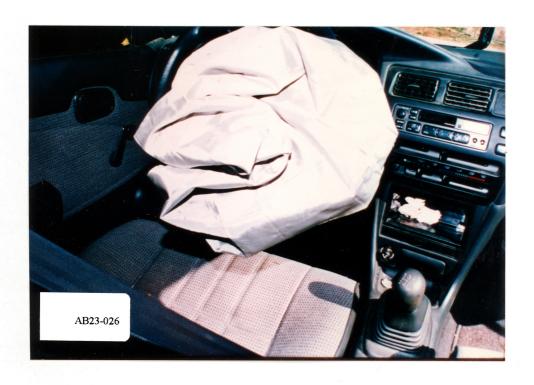







































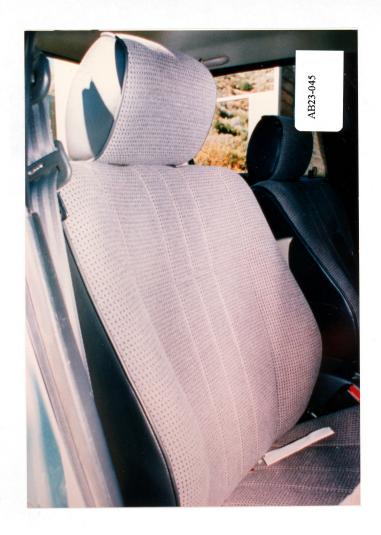








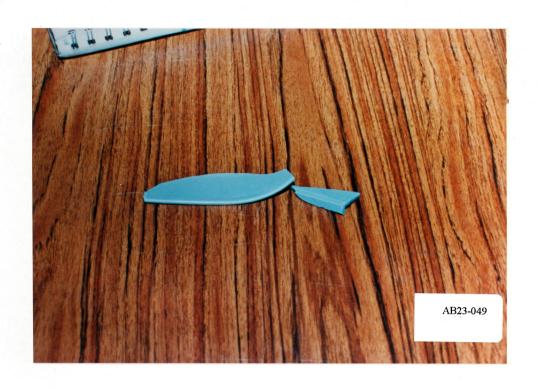






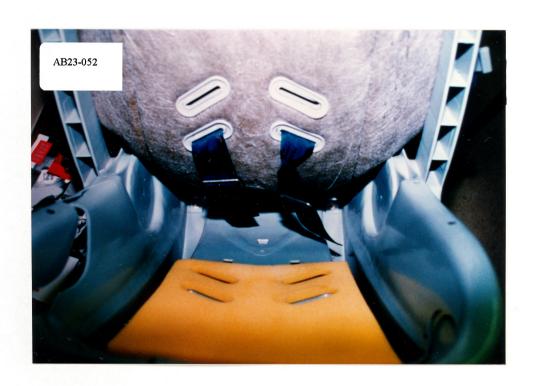






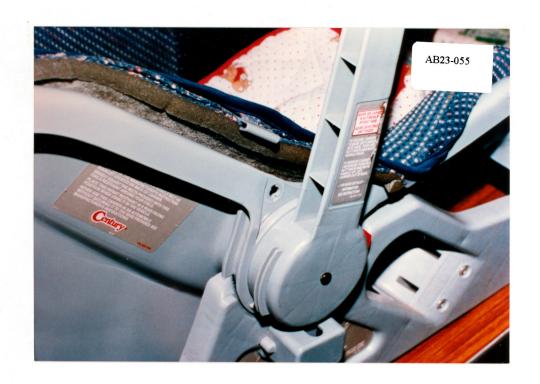







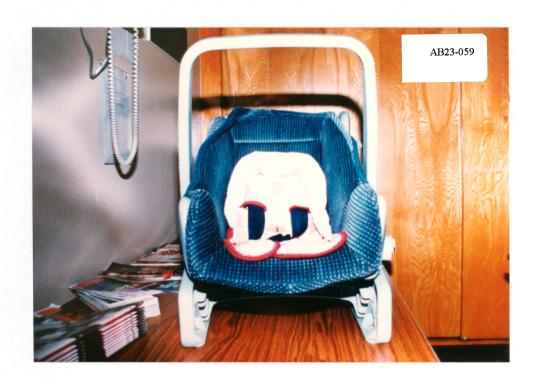























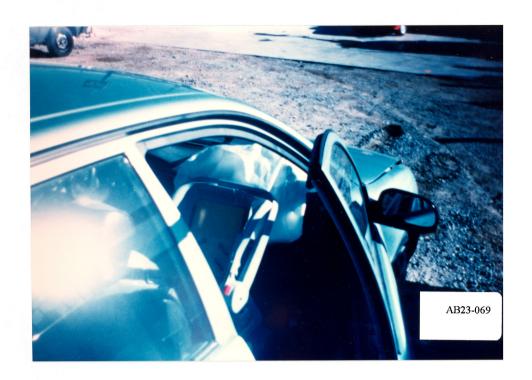

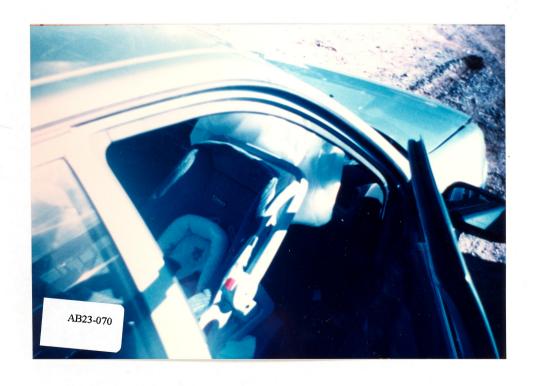

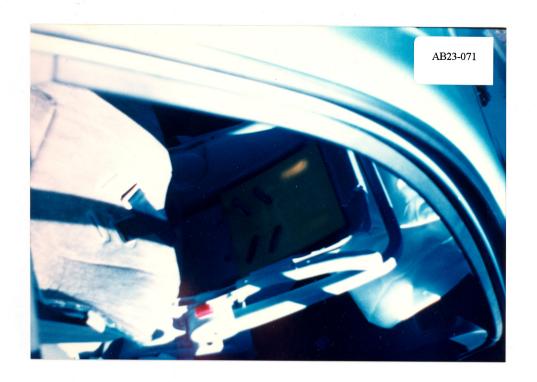

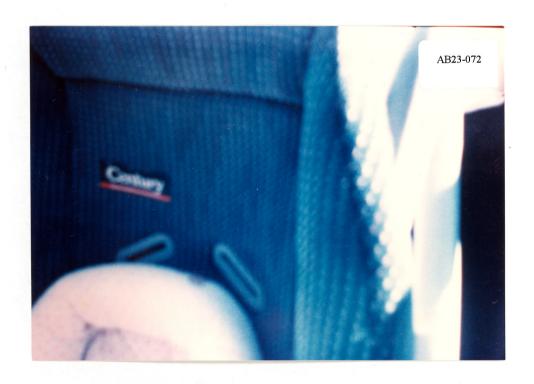





















st Available











Best Available



lest Availa



Best Availat



DS 9423 #17 Best Available



st Availa



st Availab





est Availa









423 #25



#26









#30








Available



t Availabl



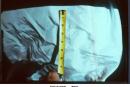

DS 9423 #36 Best Available











t Availat








est Availab







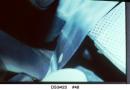



23 #4



















423 #







423 #6



















st Availabl







National Highway Traffic Safety

Administration

## **ACCIDENT FORM**

NATION/

BEST AVAILABLE COPY

1. Primary Sampling Unit Number

2. Case Number - Stratum

AB 23

**IDENTIFICATION** 

3. Number of General Vehicle Forms Submitted

<u>φ2</u>

4. Date of Accident (Month, Day, Year)

FALL INEEKDAYI 9 4

5. Time of Accident

7:35 -:-::

AFTERHOOM.

Code reported military time of accident.

NOTE: Midnight = 2400

Unknown = 9999

## SPECIAL STUDIES - INDICATORS

Check ( ) each special study (SS14-SS18 below) that has been completed; code 1 for the checked special studies and 0 for the special studies not checked.

6. \_\_\_SS15 Administrative Use

4

7. \_\_\_SS16 Pedestrian Crash Data Study

 $\phi$ 

8. \_\_\_SS17 Impact Fires

4

9. \_\_\_SS18 \_\_\_\_

4

10. \_\_\_SS19 \_\_\_\_

4

## NUMBER OF EVENTS

11. Number of Recorded Events in This Accident

*\$ 1* 

Code the number of events which occurred in this accident.

## **ACCIDENT EVENTS**

For each event that occurred in the accident, code the lowest numbered vehicle in the left columns and the other involved vehicle or object on the right.

Accident Event Sequence Number	Vehicle Number	Class Of Vehicle	General Area of Damage	Vehicle Number or Object Contacted	Class Of Vehicle	General Area of Damage
12. <u>0</u> 1	13. <u>Φ</u> <u>Ι</u>	14. <u>6  </u>	15. <u>F</u>	16. <u> </u>	17. <u>Ø</u> 3	18. <u>F</u>
19. 0 2	20	21	22	23	24	25
26. <u>0</u> <u>3</u>	27	28	29	30	31	32
33. <u>0</u> <u>4</u>	34	35	36	37	38	39
40. 0 5	41	42	43	44	45	46

IF GREATER THAN FIVE EVENTS, CONTINUE CODING ON THE ACCIDENT EVENT SUPPLEMENT

# CODES FOR CLASS OF VEHICLE

- (00) Not a motor vehicle
- (01) Subcompact/mini (wheelbase < 254 cm)
- (02) Compact (wheelbase ≥ 254 but < 265 cm)
- (03) Intermediate (wheelbase ≥ 265 but < 278 cm)
- (04) Full size (wheelbase ≥ 278 but < 291 cm)
- (05) Largest (wheelbase ≥ 291 cm)
- (09) Unknown passenger car size
- (11) Compact utility vehicle
- (12) Large utility vehicle (≤ 4,500 kgs GVWR)
- (13) Passenger van (≤ 4,500 kgs GVWR)
- (14) Other van (≤ 4,500 kgs GVWR)
- (15) Pickup truck (≤ 4,500 kgs GVWR)
- (18) Other truck (≤ 4,500 kgs GVWR)
- (19) Unknown light truck type
- (20) School bus
- (21) Other bus
- (22) Truck (> 4,500 kgs GVWR)
- (23) Tractor without trailer
- (24) Tractor-trailer(s)
- (25) Motored cycle
- (28) Other vehicle
- (99) Unknown

# CODES FOR GENERAL AREA OF DAMAGE (GAD)

### CDS APPLICABLE AND OTHER VEHICLES

# TDC APPLICABLE VEHICLES

- (0) Not a motor vehicle
- (N) Noncollision
- (F) Front
- (R) Right side
- (L) Left side
- (B) Back
- (T) Top
- (U) Undercarriage
- (9) Unknown

- (0) Not a motor vehicle
- (N) Noncollision
- (F) Front
- (R) Right side
- (L) Left side
- (B) Back of unit with cargo area (rear of trailer or straight truck)
- (D) Back (rear of tractor)
- (C) Rear of cab
- (V) Front of cargo area
- (T) Top
- (U) Undercarriage
- (9) Unknown

## CODES FOR VEHICLE NUMBER OR OBJECT CONTACTED

(01-30) - Vehicle Number

### Noncollision

- (31) Overturn rollover
- (32) Fire or explosion
- (33) Jackknife
- (34) Other intraunit damage (specify):
- (35) Noncollision injury
- (38) Other noncollision (specify):
- (39) Noncollision details unknown

## Collision With Fixed Object

- (41) Tree (≤ 10 cm in diameter)
- (42) Tree (> 10 cm in diameter)
- (43) Shrubbery or bush
- (44) Embankment
- (45) Breakaway pole or post (any diameter)

## Nonbreakaway Pole or Post

- (50) Pole or post (≤ 10 cm in diameter)
- (51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
- (52) Pole or post (> 30 cm in diameter)
- (53) Pole or post (diameter unknown)
- (54) Concrete traffic barrier
- (55) Impact attenuator
- (56) Other traffic barrier (includes guardrail) (specify):

- (57) Fence
- (58) Wall
- (59) Building
- (60) Ditch or culvert
- (61) Ground
- (62) Fire hydrant
- (63) Curb
- (64) Bridge
- (68) Other fixed object (specify):
- (69) Unknown fixed object

### Collision with Nonfixed Object

- (71) Motor vehicle not in-transport
- (72) Pedestrian
- (73) Cyclist or cycle
- (74) Other nonmotorist or conveyance
- (75) Vehicle occupant
- (76) Animal
- (77) Train
- (78) Trailer, disconnected in transport
- (79) Object fell from vehicle in-transport
- (88) Other nonfixed object (specify):
- (89) Unknown nonfixed object
- (98) Other event (specify):
- (99) Unknown event or object

\*\*\*\* SKIP TO VARIABLE GV37 IF GV07 DOES NOT EQUAL 01-49 \*\*\*\*

...

## CDS APPLICABLE VEHICLES

#### Automobiles

- (01) Convertible (excludes sun-roof, t-bar)
- (02) 2-door sedan, hardtop, coupe
- (03) 3-door/2-door hatchback
- (04) 4-door sedan, hardtop
- (05) 5-door/4-door hatchback
- (06) Station wagon (excluding van and truck based)
- (07) Hatchback, number of doors unknown
- (08) Other automobile type (specify):
- (09) Unknown automobile type

## Automobile Derivatives

- (10) Auto based pickup (includes El Camino, Caballero, Ranchero, Brat, and Rabbit pickup)
- (11) Auto based panel (cargo station wagon, auto based ambulance/hearse)
- (12) Large limousine more than four side doors or stretched chassis
- (13) Three-wheel automobile or automobile derivative

### Utility Vehicles (≤ 4,500 kgs GVWR)

- (14) Compact utility (Jeep CJ-2 CJ-7, Scrambler, Golden Eagle, Renegade, Laredo, Wrangler, Cherokee [84 and after], Dispatcher, Raider, Bronco II, Bronco [76 and before], Explorer, S-10 Blazer, Geo Tracker, Bravada, S-15 Jimmy, Thing, Pathfinder, Trooper, Trooper II, Rodeo, Amigo, Navajo, 4-Runner, Montero, Samurai, Sidekick, Rocky)
- (15) Large utility (includes Jeep Cherokee [83 and before], Ramcharger, Trailduster, Bronco-fullsize [78 and after], fullsize Blazer, fullsize Jimmy, Landcruiser, Rover, Scout)
- (16) Utility station wagon (Chevy Suburban, GMC Suburban, Travelall, Grand Wagoneer, includes suburban limousine)
- (19) Utility, unknown body type

-33

::3

## Van Based Light Trucks (≤ 4,500 kgs GVWR)

- (20) Minivan (Chrysler Town and Country, Caravan, Grand Caravan, Voyager, Grand Voyager, Mini-Ram, Dodge/Plymouth Vista, Aerostar, Villager, Lumina APV, Trans Sport, Silhouette, Astro, Safari, Toyota Van, Toyota Minivan, Previa, Nissan Minivan, Quest, Mitsubishi Minivan, Vanagon/Camper.)
- (21) Large van (B150-B350, Sportsman, Royal, Maxiwagon, Ram, Tradesman, Voyager [83 and before], E150-E350, Econoline, Clubwagon, Chateau, G10-G30, Chevy Van, Beauville, Sport Van, G15-G35, Rally Van, Vandura.)
- (22) Step van or walk-in van (≤ 4,500 kgs GVWR)
- (23) Van based motorhome (≤ 4,500 kgs GVWR)
- (24) Van based school bus (≤ 4,500 kgs GVWR)
- (25) Van based other bus (≤ 4,500 kgs GVWR)
- (28) Other van type (Hi-Cube Van, Kary) (specify):
- (29) Unknown van type

# Light Conventional Trucks (Pickup style cab, ≤ 4,500 kgs GVWR)

- (30) Compact pickup (D50, Colt P/U, Ram 50, Dakota, Arrow Pickup [foreign], Ranger, Courier, S-10, T-10, LUV, S-15, T-15, Sonoma, Datsun/Nissan Pickup, P'up, Mazda Pickup, Toyota Pickup, Mitsubishi Pickup)
- (31) Large Pickup (Jeep Pickup, Comanche, Ram Pickup, D100-D350, W100-W350, F100-F350, C10-C35, K10-K35, R10-R35, V10-V35, Silverado, Sierra, R100-R500,)

- (32) Pickup with slide-in camper
- (33) Convertible pickup
- (39) Unknown pickup style light conventional truck type

### Other Light Trucks (≤ 4,500 kgs GVWR)

- (40) Cab chassis based (includes rescue vehicles, light stake, dump, and tow truck)
- (41) Truck based panel
- (42) Light truck based motorhome (chassis mounted)
- (45) Other light conventional truck type
- (48) Unknown light truck type
- (49) Unknown light vehicle type (automobile, utility, van, or light truck)

### OTHER VEHICLES

### Buses (Excludes Van Based)

- (50) School bus (designed to carry students, not cross country or transit)
- (58) Other bus type (e.g., transit, intercity, bus based motorhome) (specify):
- (59) Unknown bus type

## Medium/Heavy Trucks (> 4,500 kgs GVWR)

- (60) Step van (> 4,500 kgs GVWR)
- (61) Single unit straight truck (4,500 kgs < GVWR ≤ 8,850 kgs)
- (62) Single unit straight truck (8,850 kgs < GVWR ≤ 12,000 kgs)
- (63) Single unit straight truck (> 12,000 kgs GVWR)
- (64) Single unit straight truck, GVWR unknown
- (65) Medium/heavy truck based motorhome
- (67) Truck-tractor with no cargo trailer
- (68) Truck-tractor pulling one trailer
- (69) Truck-tractor pulling two or more trailers
- (70) Truck-tractor (unknown if pulling trailer)
- (78) Unknown medium/heavy truck type
- (79) Unknown truck type (light/medium/heavy)

## Motored Cycles (Does Not Include All-Terrain Vehicles/Cycles)

- (80) Motorcycle
- (81) Moped (motorized bicycle)
- (82) Three-wheel motorcycle or moped
- (88) Other motored cycle (minibike, motorscooter) (specify):\_\_\_\_\_
- (89) Unknown motored cycle type

### Other Vehicles

- (90) ATV (All-Terrain Vehicle) and ATC (All-Terrain Cycle)
- (91) Snowmobile
- (92) Farm equipment other than trucks
- (93) Construction equipment other than trucks
- (97) Other vehicle type
- (99) Unknown body type

Natio	onal Accident Sampling System-Crashwort	hiness Da	ta Sy	stem: General Vehicle Form	Pag
	OCCUPANT RELATED			. Rollover	_φ
16.	Driver Presence in Vehicle (0) Driver not present (1) Driver present (9) Unknown	_1		<ul> <li>(0) No rollover (no overturning)</li> <li>Rollover (primarily about the longitudinal a</li> <li>(1) Rollover, 1 quarter turn only</li> <li>(2) Rollover, 2 quarter turns</li> </ul>	
17.	Number of Occupants This Vehicle (00-96) Code actual number of occupants for this vehicle (97) 97 or more (99) Unknown	<u>φ</u> <u>z</u>		(3) Rollover, 3 quarter turns (4) Rollover, 4 or more quarter turns (spec	cify):
18.	Number of Occupant Forms Submitted	<u>φ</u> 2		about the lateral axis) (9) Rollover (overturn), details unknown	
	VEHICLE WEIGHT ITEMS			OVERRIDE/UNDERRIDE (THIS VEHIC	CLE)
19.	Code weight to nearest	<u>45</u> 0	25.	Front Override/Underride (this Vehicle)	
	10 kilograms. (045) Less than 450 kilograms (610) 6,100 kilograms or more		26.	Rear Override/Underride (this Vehicle)	4
	(999) Unknown			(0) No override/underride, or not an end-to-end impact	
	Source: 1,4 35 k	:gs -		Override (see specific CDC) (1) 1st CDC (2) 2nd CDC	
20.	Vehicle Cargo Weight 9, 9 Code weight to nearest	_ 9_ 0		(3) Other not automated CDC (specify):	
	10 kilograms. (000) Less than 5 kilograms (450) 4,500 kilograms or more (999) Unknown		1	Underride (see specific CDC) (4) 1st CDC (5) 2nd CDC	
	, lbs X .4536 =, k	gs _		(6) Other not automated CDC (specify):	
21.	RECONSTRUCTION DATA  Towed Trailing Unit (0) No towed unit	φ		(7) Medium/heavy truck or bus override (9) Unknown	
(	1) Yes—towed trailing unit 9) Unknown	<u> </u>		HEADING ANGLE AT IMPACT FOR HIGHEST DELTA V	?
† (!	Documentation of Trajectory Data for This Vehicle 0) No 1) Yes	1		Values: (000)-(359) Code actual value (997) Noncollision (998) Impact with object (999) Unknown	
(1	Post Collision Condition of Tree or Pole For Highest Delta V) 0) Not collision (for highest delta V) with	4	27. H	Heading Angle For This Vehicle $-\frac{\varphi}{2}$	Ø
(; (; () () () ()	tree or pole  1) Not damaged  2) Cracked/sheared  3) Tilted < 45 degrees  4) Tilted ≥ 45 degrees  5) Uprooted tree  6) Separated pole from base  7) Pole replaced  8) Other (specify):		28. H	deading Angle For Other Vehicle A	<u> </u>
(5	9) Unknown				
		<u>`</u>			

: :-:

्र इ.

-54 -54 160

	Cate- gory	Configur- ation	ACCIDENT TYPES (Includes Intent	) BEST AVAILABLE COPY
.स. १५ १९५	er	A. Right Roadside Departure	DRIVE OFF CONTROL/ AVOID COLLISI	ON SPECIFIC
	I. Single Driver	B. Left Roadside Departure	DRIVE OFF CONTROL/ AVOID COLLIS	I 09 10
		C Forward Impact	PARKED VEH. STA. OBJECT PEDESTRIAN/ END DEPART	14 15 16  SPECIFICS SPECIFICS
	Trafficway Direction	1) Kear-End	20 22 24 26 28 4	30  + 29 (EACH • 32) (EACH • 33)  31 SPECIFICS SPECIFICS
	II. Same Trafficway Same Direction	f: Forward Impact	CONTROL/ CONTROL/ AVOID COLLISION AV	OTHER UNKNOWN  O ITTO (EACH • 42) (EACH • 43)  VOID COLLISION SPECIFICS SPECIFICS UNKNOWN
		r. Sideswipe Angle	44 45 45 (EACH • 45 SPECIFICS OTHER	CITATOTA
	A Jy Cthim	G Head-On	50 51 (EACH • 52) (EACH •	53) S UNKNOWN
	Same Traffieway Opposite Direction	H Forward Impact	CONTROL/ CONTROL/ AVOID COLLISION AV	60 (CEACH • 62) (EACH • 63)  OID COLLISION SPECIFICS SPECIFICS TH OBJECT OTHER UNKNOWN
	Ξ	l. Sideswipe' Angle	64 65 IEACH • 661 IEACH •	
	Trafficway Turning	J. Turn Across Path	69 71 70 73 72 INITIAL OPPOSITE INITIAL SAME DIRECTIONS	(EACH • 74) (EACH • 75)  SPECIFICS SPECIFICS
1 (1 (1 (1 (1 (1 (1 (1 (1 (1 (1 (1 (1 (1	IV. Change Vehicle	K. Turn Into Path	77 79 81 81 TURN INTO OPPOSITE DIS	(EACH • 84) (EACH • 85)  SPECIFICS SPECIFICS
	ing Path (Vehicle Damage)	L. Straight Paths	TURN INTO SAME DIRECTION  TURN INTO OPPOSITE DIR  (EACH •  88  89  SPECIFIC OTHER	90) (EACH + 91)
	VI. Miscel- laneous	M. Backing Eic.	92 93 OTHER VEH. 98 Other	or Accident Type nown Accident Type mpact

1-1-2-

.ă

National Accident Sampling System-Crashworthiness Da			Page
<ul> <li>37. Police Reported Other Drug Presence</li> <li>(0) No other drug(s) present</li> <li>(1) Yes [other drug(s) present]</li> </ul>	OTHER DRUGS TEST RES	CLASSIFIC SULTS FOR D	CATION DRIVER
(7) Not reported (8) No driver present		DEC Test	Specimen
(9) Unknown		Results	Test Results
	Narcotic Drug	40. <i>4</i>	41 <i>\phi</i>
	Depressant Drug	42. <i>4</i>	43. 4
38. Police Reported Drug Evaluation Classification $\phi$	Stimulant Drug	44. 4	45. Ø
(DEC) Test For Driver	Hallucinogen Drug	46. <u>4</u>	47. Ø
(0) No DEC process available or given	Cannabinoid Drug	48. <u>4</u>	49. 🕏
(1) DEC process given, results known	Phencyclidine (PCP) Inhalant Drug	50. <u>φ</u>	51. Ø
(2) DEC process given, results unknown	Other Drug (Excluding	52. <u>4</u>	53. <u>Ø</u>
(3) DEC process available, unknown if given	Nicotine, Aspirin, Alcohol,	54. <u> </u>	55. <u>¢</u>
(8) No driver present	Drugs Administered Post-Cras	h)	
	Codes For DEC Test Result	s	
39. Other Drug Specimen Test Type For Driver 4	(0) No DEC test given		
(0) No specimen test given	(1) Passed DEC test		
(1) Blood test	(2) Failed DEC test		
(2) Urine test	(3) DEC test given—results	unknown	
(3) Other specimen tests (specify):	(8) No driver present	- C(10 1711	
(7) Unspecified specimen test	(9) Unknown if DEC test gi	ven	
(8) No driver present (9) Unknown if specimen test given	Codes for Specimen Test R	esults	
	(0) No specimen test given		
	(1) Drug not found in speci	men	
	(2) Drug found in specimen		
	(7) Specimen test given, re	sults unknow	n or
	not obtained		
	(8) No driver present		
-	(9) Unknown if specimen to	st given	
			ł

# CODES FOR ROLLOVER INITIATION OBJECT CONTACTED

(00) No rollover (01-30) — Vehicle Number	(57) Fence
	(58) Wall
Noncollision	(59) Building
(31) Turn-over — fall-over	(60) Ditch or culvert
(33) Jackknife	(61) Ground
100/ Dackrille	(62) Fire hydrant
Collision With Fixed Object	(63) Curb
Collision With Fixed Object	(64) Bridge
(41) Tree (≤ 10 cm in diameter)	(68) Other fixed object (specify):
(42) Tree (> 10 cm in diameter)	,,,,,,,,
(43) Shrubbery or bush	(69) Unknown fixed object
(44) Embankment	
	Collision with Nonfixed Object
(45) Breakaway pole or post (any diameter)	(71) Motor vehicle not in-transport
	(76) Animal
Nonbreakaway Pole or Post	(77) Train
(50) Pole or post (≤ 10 cm in diameter)	
(51) Pole or post (> 10 cm but $\leq$ 30 cm in	(78) Trailer, disconnected in transport
diameter)	(79) Object fell from vehicle in-transport
(52) Pole or post (> 30 cm in diameter)	(88) Other nonfixed object (specify):
(53) Pole or post (diameter unknown)	(00) III
the state of poor (didinate) diskilowill	(89) Unknown nonfixed object
(54) Concrete traffic barrier	1001 0
(55) Impact attenuator	(98) Other event (specify):
(56) Other traffic barrier (includes guardrail)	
(specify):	(99) Unknown event or object

OTHER DATA	
56. Driver's Zip Code	61. Rollover Initiation Object Contacted $\phi$
(00000) Driver not present (00001) Driver not a resident of U.S. or territories Code actual 5-digit zip code (99999) Unknown	62. Location on Vehicle Where Initial Principal Tripping Force Is Applied  (0) No rollover (1) Wheels/tires (2) Side plane
57. Driver's Race/Ethnic Origin (0) Driver not present (1) White (non-Hispanic) (2) Black (non-Hispanic) (3) White (Hispanic) (4) Black (Hispanic) (5) American Indian, Eskimo or Aleut (6) Asian or Pacific Islander (8) Other (specify):	(3) End plane (4) Undercarriage (5) Other location on vehicle (specify): (8) Non-contact rollover forces (specify): (9) Unknown
(9) Unknown	63. Direction of Initial Roll
58. Vehicle Special Use (This Trip)  (0) No special use	(0) No rollover (1) Roll right - primarily about the longitudinal axis (2) Roll left - primarily about the longitudinal axis
<ul> <li>(1) Taxi</li> <li>(2) Vehicle used as school bus</li> <li>(3) Vehicle used as other bus</li> <li>(4) Military</li> <li>(5) Police</li> <li>(6) Ambulance</li> </ul>	<ul><li>(5) End-over-end (i.e., primarily about the lateral axis)</li><li>(9) Unknown roll direction</li></ul>
<ul><li>(7) Fire truck or car</li><li>(8) Other (specify):</li></ul>	PRECRASH DATA
(9) Unknown	64. Pre-Event Movement (Prior to 1 3 Recognition of Critical Event)
ROLLOVER DATA	
If GV07 (Body Type) ≠ 1-49, leave GV59-GV63 blank.  If GV24 (Rollover) = 0, then GV59-GV63 must equal 0.  If GV24 = 9, then GV59-GV63 must equal 9.	<ul> <li>(01) Going straight</li> <li>(02) Slowing or stopping in traffic lane</li> <li>(03) Starting in traffic lane</li> <li>(04) Stopped in traffic lane</li> </ul>
59. Rollover Initiation Type  (O) No rollover (1) Trip-over (2) Flip-over (3) Turn-over (4) Climb-over (5) Fall-over (6) Bounce-over (7) Collision with another vehicle (8) Other rollover initiation type specify):	(05) Passing or overtaking another vehicle (06) Disabled or parked in travel lane (07) Leaving a parking position (08) Entering a parking position (09) Turning right (10) Turning left (11) Making a U-turn (12) Backing up (other than for parking position) (13) Negotiating a curve (14) Changing lanes (15) Merging (16) Successful avoidance maneuver to a previous critical event
	(97) Other (specify):
<ul> <li>(0) No rollover</li> <li>(1) On roadway</li> <li>(2) On shoulder—paved</li> <li>(3) On shoulder—unpaved</li> <li>(4) On roadside or divided trafficway median</li> <li>(9) Unknown</li> </ul>	(98) No driver present (99) Unknown

....

PRECRASH D	ATA (Continued)
65. Critical Precrash Event <u>5</u> 3	Pedestrian or Pedalcyclist, or Other Nonmotories
This Vehicle Loss of Control Due To:	(80) Pedestrian in roadway
(01) Blow out or flat tire	(81) Pedestrian approaching roadway (82) Pedestrian—unknown location
(02) Stalled engine	(83) Pedalcyclist or other permeteries in the
(03) Disabling vehicle failure (e.g., wheel fell off)	(83) Pedalcyclist or other nonmotorist in roadway (specify):
(specify):	(84) Pedalcyclist or other nonmotorist approaching
(04) Non-disabling vehicle problem (e.g., hood flew	roadway (specify):
up) (specify):	(85) Pedalovolist or other party
(05) Poor road conditions (puddle, pot hole, ice, etc.)	location (specify):
(specify):	
(06) Traveling too fast for conditions	Object or Animal
(08) Other cause of control loss (specify):	(87) Animal in roadway
(09) Unknown cause of control loss	(88) Animal approaching roadway
1007 Chikhowh Cause of Control loss	(89) Animal—unknown location
This Vehicle Traveling	(90) Object in roadway
(10) Over the lane line on left side of travel lane	(91) Object approaching roadway (92) Object—unknown location
(11) Over the lane line on right side of travel lane	(92) Object—unknown location
(12) Off the edge of the road on the left side	(98) Other critical precrash event (specify):
(13) Off the edge of the road on the right side	(Specify):
(14) End departure	(99) Unknown
(15) Turning left at intersection	(00) 011110
(16) Turning right at intersection	
(17) Crossing over (passing through) intersection	For Corrective Actions Attempted see variable GV14
(19) Unknown travel direction	(Attemped Avoidance Manuever)
Other Meter Vehicle Letter	
Other Motor Vehicle In Lane (50) Stopped	
(51) Traveling in same direction with lower speed	66. Precrash Stability After Avoidance Maneuver
(i.e., lower steady speed or decelerating)	(0) No avoidance maneuver
(52) Traveling in same direction with higher speed	(1) Tracking
(53) Traveling in opposite direction	(2) Skidding longitudinally—rotation less than 30
(54) In crossover	degrees
(55) Backing	(3) Skidding laterally—clockwise rotation
(59) Unknown travel direction of other motor vehicle	(4) Skidding laterally—counterclockwise rotation
in lane	(7) Other vehicle loss-of-control (specify):
	The second of th
Other Motor Vehicle Encroaching Into Lane	(8) No driver present
(60) From adjacent lane (same direction)—over left	(9) Precrash stability unknown
lane line	
(61) From adjacent lane (same direction)—over right lane line	
(62) From opposite direction—over left lane line	67. Precrash Directional Consequences of
(63) From opposite direction—over right lane line	Avoidance Maneuver (Corrective Action)
(64) From parking lane	(0) No avoidance maneuver
(65) From crossing street, turning into same	(1) Vehicle stayed in travel lane where avoidance
direction	maneuver was initiated
(66) From crossing street, across path	(2) Vehicle stayed on roadway but left travel lane
(67) From crossing street, turning into opposite	where avoidance maneuver was initiated
direction	(3) Vehicle stayed on roadway, not known if left
(68) From crossing street, intended path not known	travel lane where avoidance maneuver was
(70) From driveway, turning into same direction	initiated
(71) From driveway, across path	(4) Vehicle departed roadway
(72) From driveway, turning into opposite direction	(5) Avoidance maneuver initiated off roadway
(73) From driveway, intended path not known	(8) No driver present
(74) From entrance to limited access highway	(9) Directional consequences unknown
(78) Encroachment by other vehicle—details	(5) Photonial consequences unknown
unknown	
*** IF THE CDS APPLICABLE VEHICLE W	AS NOT INSPECTED (I.E. GV25 - 0) ***
DO NOT COMPLETE THE EXTERIOR	AND INTERIOR VEHICLE FORMS

\*\*\* IF GV07 DOES NOT EQUAL 01-49, DO NOT COMPLETE \*\*\*
THE EXTERIOR VEHICLE, INTERIOR VEHICLE,
OCCUPANT ASSESSMENT, AND OCCUPANT INJURY FORMS.

1. Prim	nary Sampling Unit	Number		1	3. Vehi	icle Nun	nber				d I
	e Number - Stratun		4 B Z	7						_	
	o realization	<u></u>									
	,		VEHICLE								
VIN _	NXAE	0 4	B 5 R	己					Mode	Year _	94
Vehicle N	/lake (specify):	TOYOTA									
						e Model	specif	y): <u> </u>	ROLLA	4-[	DR_
ocate th	ne end of the dama	ac with see		LOCAT							
or an uno	ne end of the dama damaged axle for s	ge with resp ide impacts.	ect to the ve	ehicle lo	ngitudin	al cente	r line o	bumpei	r corner	for end	impac
Specific	Impact No.	Locatio	n of Direct [	Damage				Location	of Fiel	d L	
			<del></del>								
	'	LF BUMPE	e corner	د		<del>  &gt;</del>					
IOTES:	Idontify the plant	CR	USH PROF	ILE IN	CENT	IMETE	RS				
IO 1 E 3.	Identify the plane a sill, etc.) and label	at which the adjustments	C-measurer : e.g., free	ments al space)	re taken	(e.g., a	t bumpe	er, abov	e bumpe	er, at sil	l, abov
				-p							
	Measure and docu				location	n of may	vimum <i>e</i>	ar i ab			
	Measure and documents	ment on the	vehicle diag	ram the							
	Measure C1 to C6	ment on the	vehicle diag to passenge	ram the	front o	r rear im	pacts a	nd rear		in side	
	Measure C1 to C6 Free space value is the individual C loc	ment on the from driver defined as a ations. This	vehicle diag to passenge the distance	ram the r side in between	n front o	r rear im	npacts a	ind rear original		in side	
	Measure C1 to C6  Free space value is the individual C loc side taper, etc. Re	ment on the from driver defined as a ations. This cord the value	vehicle diag to passenge the distance s may includ ue for each	ram the r side in betwee e the fo C-mease	n front of en the ba ellowing: urement	r rear im aseline a bumper and ma	npacts a and the r lead, b ximum	original loumper to		in side	
:	Measure C1 to C6 Free space value is the individual C loc	ment on the from driver defined as a ations. This cord the value columns as a	vehicle diag to passenge the distance may includue for each onecessary to	ram the r side in betwee e the fo C-mease	n front of en the ba ellowing: urement	r rear im aseline a bumper and ma	npacts a and the r lead, b ximum	original loumper to		in side	
Specific Impact	Measure C1 to C6  Free space value is the individual C loc side taper, etc. Re  Use as many lines/	ment on the from driver defined as ations. This cord the value columns as a Direct Width	vehicle diag to passenge the distance may includue for each onecessary to Damage	between the force described Field	en the ballowing: urement	r rear im aseline a bumper and ma and ma damage	npacts and the relead, to ximum profile.	original loumper to crush.	body co	in side ntour ta de protr	iken at
Specific Impact	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/	ment on the from driver defined as a ations. This cord the value columns as a Direct	vehicle diag to passenge the distance may includue for each onecessary to	r side in between the formease describer Field	en the ballowing: urement	r rear im aseline a bumper and ma to damage	npacts a and the r lead, b ximum	original loumper to		in side	iken at
Specific Impact Number	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/ Plane of Impact C-Measurements	ment on the from driver defined as ations. This cord the value columns as a Direct Width (CDC)	vehicle diag to passenge the distance may includ ue for each necessary to Damage Max Crush	between the force the force described in the force of the	en the ballowing: urement be each	r rear im aseline a bumper and ma to damage	npacts and the relead, to simum profile.	original loumper to crush.	body co aper, si C <sub>5</sub>	in side ntour ta de protr	iken at
Specific Impact	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/ Plane of Impact C-Measurements	ment on the from driver defined as ations. This cord the value columns as a Direct Width	vehicle diag to passenge the distance may includ ue for each necessary to Damage Max	between the force the force described in the force of the	en the ballowing: urement C <sub>1</sub> C <sub>1</sub> S.5	r rear imaseline a bumper and ma rodamage	npacts and the relead, the relead, the relead, the relead of the relead	original loumper to crush.	C <sub>5</sub>	in side ntour ta de protr	tken at usion,
Specific Impact Number	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/ Plane of Impact C-Measurements	ment on the from driver defined as ations. This cord the value columns as a Direct Width (CDC)	vehicle diag to passenge the distance may includ ue for each necessary to Damage Max Crush	between the force the force described in the force of the	en the ballowing: urement be each C1 C2 5.5 -4.15	r rear imaseline a bumper and ma to damage	npacts and the relead, to ximum profile.  C3	original loumper to crush.	C <sub>5</sub>	in side ntour tade protr	tken at usion,
Specific Impact Number	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/ Plane of Impact C-Measurements  BUMPER  -frees/act	ment on the from driver defined as ations. This cord the value columns as a Direct Width (CDC)	vehicle diag to passenge the distance may includ ue for each necessary to Damage Max Crush	between the force the force described in the force of the	en the ballowing: urement C <sub>1</sub> C <sub>1</sub> S.5	r rear imaseline a bumper and ma rodamage	npacts and the relead, the relead, the relead, the relead of the relead	original loumper to crush.	C <sub>5</sub>	in side ntour ta de protr	ten at usion,
Specific Impact Number	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/ Plane of Impact C-Measurements  BUMPER  -frees/act	ment on the from driver defined as ations. This cord the value columns as a Direct Width (CDC)	vehicle diag to passenge the distance may includ ue for each necessary to Damage Max Crush	between the force the force described in the force of the	en the ballowing: urement be each C1 C2 5.5 -4.15	r rear imaseline a bumper and ma to damage	npacts and the relead, to ximum profile.  C3	original loumper to crush.	C <sub>5</sub>	in side ntour tade protr	ten at usion,
Specific Impact Number	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/ Plane of Impact C-Measurements  BUMPER  -frees/act	ment on the from driver defined as ations. This cord the value columns as a Direct Width (CDC)	vehicle diag to passenge the distance may includ ue for each necessary to Damage Max Crush	r side in between the formeast describer Tield	en the ballowing: urement be each C1 C1 C2 HES 5.5 -4.15	r rear imaseline a bumper and ma to damage	profile.	original loumper to crush.	C <sub>5</sub>	in side ntour tade protr	tken at usion,
Specific Impact Number	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/ Plane of Impact C-Measurements  BUMPER  -FREESPACE FINAL	ment on the from driver defined as ations. This cord the value columns as a Direct Width (CDC)	vehicle diag to passenge the distance s may includ ue for each necessary to Damage Max Crush 61.0 SIDE	r side in between the formeast describer the formeast describer the formeast describer the field L 51.2	on the ballowing: urement be each C1 C. S.S4.15 .75	r rear imaseline a bumper and ma to damage  C2  4.8  .3	profile.	original loumper to crush.	C <sub>5</sub>	in side ntour tade protr	
Specific Impact Number	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/ Plane of Impact C-Measurements  BUMPER  -frees/act	ment on the from driver defined as ations. This cord the value columns as a Direct Width (CDC)	vehicle diag to passenge the distance may includ ue for each necessary to Damage Max Crush	r side in between the formeast describer Tield	en the ballowing: urement be each C1 C1 C2 HES 5.5 -4.15	r rear imaseline a bumper and ma to damage	profile.	original loumper to crush.	C <sub>5</sub>	in side ntour tade protr	ten at usion,
Specific Impact Number	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/ Plane of Impact C-Measurements  BUMPER  -FREESPACE FINAL	ment on the from driver defined as ations. This cord the value columns as a Direct Width (CDC)	vehicle diag to passenge the distance s may includ ue for each necessary to Damage Max Crush 61.0 SIDE	r side in between the formeast describer the formeast describer the formeast describer the field L 51.2	on the ballowing: urement be each C1 C. S.S4.15 .75	r rear imaseline a bumper and ma to damage  C2  4.8  .3	profile.	original loumper to crush.	C <sub>5</sub>	in side ntour tade protr	± D
Specific Impact Number	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/ Plane of Impact C-Measurements  BUMPER  -FREESPACE FINAL	ment on the from driver defined as ations. This cord the value columns as a Direct Width (CDC)	vehicle diag to passenge the distance s may includ ue for each necessary to Damage Max Crush 61.0 SIDE	r side in between the formeast describer the formeast describer the formeast describer the field L 51.2	on the ballowing: urement be each C1 C. S.S4.15 .75	r rear imaseline a bumper and ma to damage  C2  4.8  .3	profile.	original loumper to crush.	C <sub>5</sub>	in side ntour tade protr	± D
Specific Impact Number	Measure C1 to C6 Free space value is the individual C loc side taper, etc. Re Use as many lines/ Plane of Impact C-Measurements  BUMPER  -FREESPACE FINAL	ment on the from driver defined as ations. This cord the value columns as a Direct Width (CDC)	vehicle diag to passenge the distance s may includ ue for each necessary to Damage Max Crush 61.0 SIDE	r side in between the formeast describer the formeast describer the formeast describer the field L 51.2	on the ballowing: urement be each C1 C. S.S4.15 .75	r rear imaseline a bumper and ma to damage  C2  4.8  .3	profile.	original loumper to crush.	C <sub>5</sub>	in side ntour tade protr	± D

ं क ं**ड्र** रहे

198 394 183


٠.

ORIGINAL SPECIFICATIONS					
Wheelbase (97.2)	247	cm			
Overall Length (172.4		cm			
Maximum Width (66.4	169	cm			
Curb Weight (2321)	1053	kg			
Average Track (57.3)	1 46	cm			
Front Overhang (34,3)	87	cm			
Rear Overhang (41.3)	145	cm			
Undeformed End Widt	h (55.9) 142	cm			
Engine Size: cyl./displ.	4 CYL EFF	L			

VEHICLE DAMAGE SKETCH

WHEEL STEP (For locked fro displaced rear RF ±	nt wheels or axies only)
DRIVE W	HEELS
☑ FWD □ RV	VD 🗆 4WD
Approximate Cargo Weight	NSIBLE kg

## **MEASUREMENTS IN CENTIMETERS**

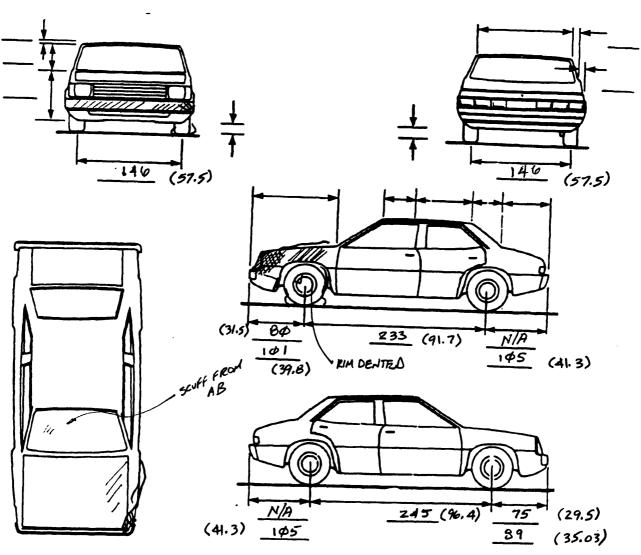

Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page.

Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.

1000 1000 1000

33

	CD C			P
	CDC V	VORKSHEE		
	CODES FOR C	BJECT CONT	ACTED	
(01-30	0) - Vehicle Number	(57)	Fence	
			Wall	
Nonco	Illision		Building	
(31)	Overturn – rollover		Ditch or culvert	
(32)	Fire or explosion		Ground	
(33)	Jackknife			
(34)	Other intraunit damage (specify):	(02)	Fire hydrant Curb	
	Tames (open)			
(35)	Noncollision injury		Bridge	
(38)	Other noncollision (specify):	(80)	Other fixed object (specify):	
,,	out in including to the city.	(00)		
(39)	Noncollision — details unknown	(69)	Unknown fixed object	
,,,,,	Transcriber a details diffillowing	0 - 111 - 1	tot At an area and	
Collisio	on With Fixed Object	Collisio	n with Nonfixed Object	
(41)	Tree (≤ 10 cm in diameter)	(71)	Motor vehicle not in-transport	
(42)	Tree (> 10 cm in diameter)		Pedestrian	
(43)	Shrubbery or bush	(73)	Cyclist or cycle	
144)	Embankment -	(74)	Other nonmotorist or conveyance	
(44)	Lindarkinent			
1451	Prophowous pole on a set 1	(75)	Vehicle occupant	
(40)	Breakaway pole or post (any diameter)		Animal	
Nonbro	akaway Data as Da	(77)	Train	
/EO/	akaway Pole or Post	(78)	Trailer, disconnected in transport	
(50)	Pole or post (≤ 10 cm in diameter)	(79)	Object fell from vehicle in-transport	
	Pole or post (> 10 cm but $\leq$ 30 cm in diameter)	(88)	Other nonfixed object (specify):	
(52)	Pole or post (> 30 cm in diameter)	(89)	Unknown nonfixed object	
(53)	Pole or post (diameter unknown)	100/	onknown nomixed object	
	Concrete traffic barrier	(98)	Other event (specify):	

DEFORMATION	CLASSIFICATION	BY EVENT NUMBER
DEI CHIMIZHOIA	CLASSIFICA HUN	BY EVENT NUMBER

(99) Unknown event or object

(55) Impact attenuator (56) Other traffic barrier (includes guardrail)

(specify):\_\_\_\_

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force (degrees)	Incremental Value of Shift	(3) Deformation Location	(4) Specific Longitudinal or Lateral Location	(5) Specific Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
<u> </u>	φ 2	φ φ 5	φ φ	<u></u>	L	E	E	<u> ø 3</u>
						<del></del>		
				<del></del>				
					-			
					<del></del>			
						-		

. . . 2.2

ंड ंड ३३३

		COLLISIO	N DEFORMA	TION CLAS	CCIEICATIC		Pag
HIGHEST	DELTA "V"	COLLIOIO.	N DEI OHIVIA	HUN GEAR	SIFICATIO	N	
Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u> </u>	5. <u> </u>	6. <u>1</u> Z_	7. <u>F</u>	8	9. <u>E</u>	10. <u>E</u>	11. <u>Ø</u> 3
Second Hig	ghest Delta "V	/ <b>"</b>			·		
12	13	14	_ 15	16	17	18	19
		CRUS	SH PROFILE	IN CENTIM	ETERS		
•	The crush prof	file for the dan	mage described below. (ALL MI	in the CDC(s) a	above should b	be documented	d
HIGHEST D	DELTA "V"						
20. 	21. 			C <sub>4</sub>	C <sub>5</sub> (		22. ±D
134	<u>φφ2</u>	441	<u> </u>	<u> </u>	<u>φ3</u> φ	<u>41</u> £	0056
Second High	hest Delta "V"	,	-				
23. 	24. 			C <sub>4</sub>	C <sub>5</sub> C	25 	5. ±D
				· <del></del>			
26. Are CDCs but Not Co Automated (O) No (1) Yes	oded on The	φ (0)	esearcher's Asses Vehicle Dispositi Not towed due vehicle damage Towed due to vehicle damage Unknown	tion 1	near	Wheelbase Code to the arest centimeter known	<u>2 4 7</u>
				97.	<u>2</u> inches X 2.54 =	_ 247 cer	ntimeters

\*\*\* STOP: IF THE CDS APPLICABLE VEHICLE WAS NOT TOWED AND WAS NOT AN AOPS \*\*\* (I.E., GV09=0 OR 9 AND GV36=0), DO NOT COMPLETE THE INTERIOR VEHICLE FORM.

National Highway Traffic Safety

**Administration** 

## INTERIOR VEHICLE FORM NATIONAL

CRA:

BEST AVAILABLE COPY

1. Primary Sampling Unit Number AB 23 2. Case Number - Stratum 3. Vehicle Number

### INTEGRITY

4. Passenger Compartment Integrity (00) No integrity loss

\$6

Yes, Integrity Was Lost Through

- (01) Windshield
- (02) Door (side)
- (03) Door/hatch (back door)
- (04) Roof
- (05) Roof glass
- (06) Side window
- (07) Rear window (backlight)
- (08) Roof and roof glass
- (09) Windshield and door (side)
- (10) Windshield and roof
- (11) Side and rear window (side window and backlight)
- (12) Windshield and side window
- (13) Door and side window
- (98) Other combination of above (specify):
- (99) Unknown

Door, Tailgate or Hatch Opening

5. LF 1 6. RF 1 7. LR 1 8. RR 1 9. TG/H \$\phi\$

- (0) No door/gate/hatch
- (1) Door/gate/hatch remained closed and operational
- (2) Door/gate/hatch came open during collision
- (3) Door/gate/hatch jammed shut
- (8) Other (specify):
- (9) Unknown

Damage/Failure Associated with Door, Tailgate or Hatch Opening in Collision. If IV05-IV09 ≠ 2, Then code Ø

10. LF <u>Φ</u> 11. RF <u>Φ</u> 12. LR <u>Φ</u> 13. RR <u>Φ</u> 14. TG/H <u>Φ</u>

(0) No door/gate/hatch or door not opened

Door, Tailgate or Hatch Came Open During Collision

- (1) Door operational (no damage)
- (2) Latch/striker failure due to damage
- (3) Hinge failure due to damage
- (4) Door structure failure due to damage
- (5) Door support (i.e., pillar, sill, roof side rail, etc.) failure due to damage
- (6) Latch/striker and hinge failure due to damage
- (8) Other failure (specify):
- (9) Unknown

### GLAZING

Glazing Damage from Impact Forces

15. WS <u>\$\Phi\$</u> 16. LF <u>\$\Phi\$</u> 17. RF <u>\$\Phi\$</u> 18. LR <u>\$\Phi\$\$</u> 19. RR \$\Phi\$

- 20. BL <u>Φ</u> 21. Roof <u>B</u> 22. Other <u>Φ</u>
  - (0) No glazing damage from impact forces
  - (2) Glazing in place and cracked from impact forces
  - (3) Glazing in place and holed from impact forces
  - (4) Glazing out-of-place (cracked or not) and not holed from impact forces
  - (5) Glazing out-of-place and holed from impact forces .
  - (6) Glazing disintegrated from impact forces
  - (7) Glazing removed prior to accident
  - (8) No glazing
  - (9) Unknown if damaged

Glazing Damage from Occupant Contact

23. WS <u>\$\phi\$</u> 24. LF <u>\$\phi\$</u> 25. RF <u>\$\phi\$</u> 26. LR <u>\$\phi\$\$</u> 27. RR <u>\$\phi\$\$</u>

28. BL φ 29. Roof φ 30. Other φ

- (0) No occupant contact to glazing or no glazing
- (1) Glazing contacted by occupant but no glazing damage
- (2) Glazing in place and cracked by occupant contact
- (3) Glazing in place and holed by occupant contact
- (4) Glazing out-of-place (cracked or not) by occupant contact and not holed by occupant contact
- (5) Glazing out-of-place by occupant contact and holed by occupant contact
- (6) Glazing disintegrated by occupant contact
- (9) Unknown if contacted by occupant

If No Glazing Damage And No Occupant Contact or No Glazing, Then Code IV31 Through IV46 As Ø

Type of Window/Windshield Glazing


- 31. WS  $\phi$  32. LF z 33. RF  $\phi$  34. LR  $\phi$  35. RR  $\phi$
- 36. BL 4 37. Roof 4 38. Other 4
  - (0) No glazing contact and no damage, or no glazing
  - (1) AS-1 Laminated
  - (2) AS-2 Tempered
  - (3) AS-3 Tempered-tinted
  - (4) AS-14 Glass/Plastic
  - (8) Other (specify):
  - (9) Unknown

Window Precrash Glazing Status

39. WS <u>\$\phi\$</u> 40. LF <u>2</u> 41. RF <u>\$\phi\$</u> 42. LR <u>\$\phi\$</u> 43. RR <u>\$\phi\$</u>

44. BL <u>φ</u> 45. Roof <u>φ</u> 46. Other φ

- (0) No glazing contact and no damage, or no glazing
- (1) Fixed
- (2) Closed
- (3) Partially opened
- (4) Fully opened
- (9) Unknown

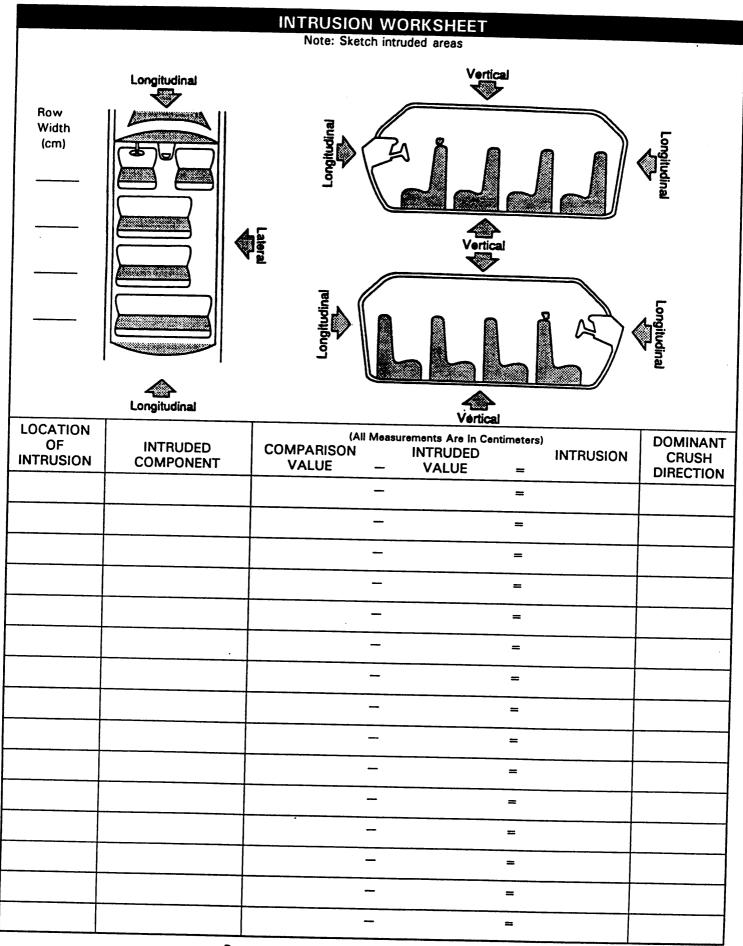

...

100000

-15:3

Document no more than the 15 most severe intrusions

					AREA INTRUSION	Pag
Not	te: If no intrusio	ons, leave va			INTRUDING COMPONENT	
		f Intruding Component		Dominant de Crush on Direction	Interior Components (01) Steering assembly	
1st	47	48	49	50	(03) Instrument panel center (04) Instrument panel right (05) Toe pan (06) A (A1/A2)-pillar	
2nd	51	_ 52	<u>/</u> 53	54	(07) B-pillar (08) C-pillar (09) D-pillar (10) Door panel (side) (12) Roof (or convertible top)	
3rd	55	56/_	57	58	(12) Roof (of convertible top) (13) Roof side rail (14) Windshield (15) Windshield header (16) Window frame	
	59	_ 60./	61	62	(17) Floor pan (includes sill) (18) Backlight header (19) Front seat back (20) Second seat back	
	63		65		(21) Third seat back (22) Fourth seat back (23) Fifth seat back (24) Seat cushion	
	67				<ul> <li>(25) Back door/panel (e.g., tailgate)</li> <li>(26) Other interior component (specify):</li> <li>(27) Side panel - forward of the A (A2)-pillar</li> </ul>	_
7th	71/	. 72	73	_ 74	(28) Side panel - rear of the A (A2)-pillar	
8th	75	76	77	_ 78	Exterior Components (30) Hood (31) Outside surface of this vehicle (specify):	
9th	79	80	81	_ 82	(32) Other exterior object in the environment (specify): (33) Unknown exterior object (97) Catastrophic	-
10th	83	84	85	_ 86	(98) Intrusion of unlisted component(s) (specify):	-
LOCAT	TION OF INTRI	USION			MAGNITUDE OF INTRUSION	
(1 (1 (1 Seco	nt Seat 11) Left 12) Middle 13) Right ond Seat 21) Left	(42) (43) (97)	Left Middle Right Catastroph	nic <sub>.</sub>	<ul> <li>(1) ≥ 3 centimeters but &lt; 8 centimeters</li> <li>(2) ≥ 8 centimeters but &lt; 15 centimeters</li> <li>(3) ≥ 15 centimeters but &lt; 30 centimeters</li> <li>(4) ≥ 30 centimeters but &lt; 46 centimeters</li> <li>(5) ≥ 46 centimeters but &lt; 61 centimeters</li> <li>(6) ≥ 61 centimeters</li> <li>(7) Catastrophic</li> </ul>	
(2	22) Middle 23) Right		Other encloarea (speci		(9) Unknown	
(3 (3:	d Seat 31) Left 32) Middle 33) Right	(99)	Unknown		DOMINANT CRUSH DIRECTION (1) Vertical (2) Longitudinal (3) Lateral (7) Catastrophic (9) Unknown	

		RIM/SPOKE DEFO		
COMPARISON VALUE	_	DAMAGE VALUE	=	DEFORMATION
	-		/ =	
A	_	d	=	h
4			=	
	_		=	
-				
,				
		-		
	•			
•				


14:

ः ुः ॐ

Page
93. Location of Steering Rim/Spoke $\varphi$ $\varphi$
Quarter Sections (01) Section A (02) Section B (03) Section C (04) Section D
Half Sections (05) Upper half of rim/spoke (06) Lower half of rim/spoke (07) Left half of rim/spoke (08) Right half of rim/spoke
(09) Complete steering wheel collapse (10) Undetermined location (99) Unknown
INSTRUMENT PANEL
94. Odometer Reading $\psi$ 1 7 ,000
kilometers—Code to the nearest 1,000 kilometers (000) No odometer (001) Less than 1,500 kilometers (500) 499,500 kilometers or more (999) Unknown
$10^{4}, 83^{4} \text{ miles } \times 1.6093 = 17, 429 \text{ kilometers}$
95. Instrument Panel Damage from Occupant Contact?
(0) No (1) Yes (9) Unknown
96. Knee Bolsters Deformed from Occupant Contact? (0) No (1) Yes (8) Not present (9) Unknown
97. Did Glove Compartment Door Open During Collision(s)? (0) No (1) Yes (8) Not present (9) Unknown


# **DRIVER AIRBAG**

. . . . . .

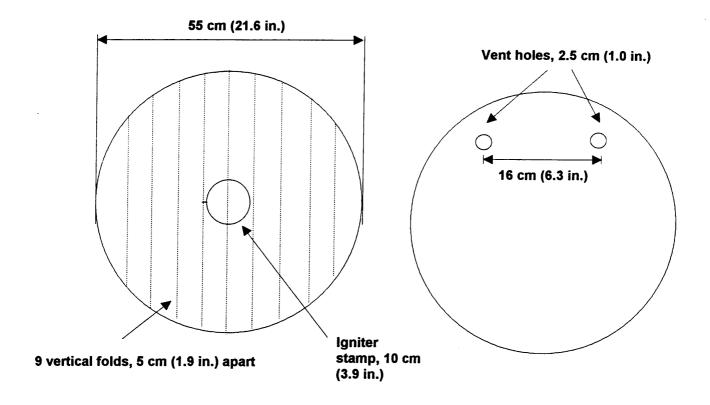


FRONT BACK

# Right side airbag module cover

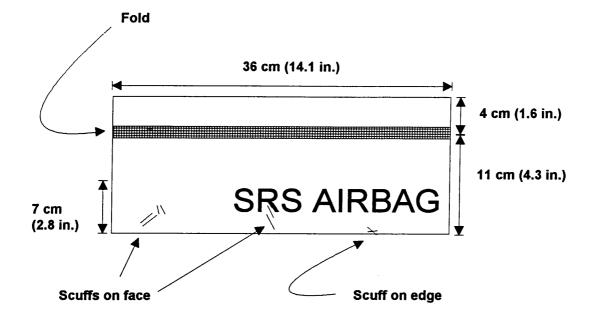

. 0. . 89 . 88

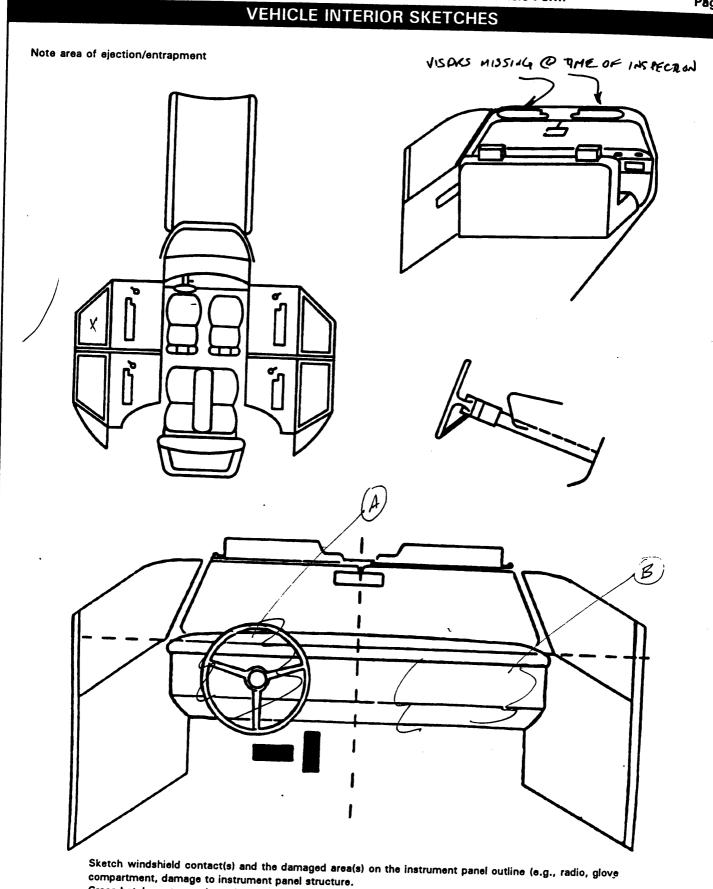

Cross hatch contact points, draw spider webs or use other annotation as may be appropriate.

Annotate the contacted area with a letter (begin with A) and list on the Points of Occupant Contact page.

\*\*\*

::3 :: ::::•

::4;-:;\*:

(21) Left side hardware or armrest

(22) Left A (A1/A2)-pillar

		POI	NTS OF OC	CUPANT CONTA	\CT		Page
Contact	Interior Component Contacted	Occupant No. If Known	Body Region If Known	Supporting F		Fyidence	Confidenc Level of Contact Point
Α	45	ı	?	DERIGED	, 5.04.	LVIdence	Z
В	45	-	-				-
С	1 7/			COMPACT W/ CHIL	DSEF		
D							
Ε							
F		<del></del>			<del></del>		
G							
Н							ļ
1							
J							
K							
<u>``</u>			<u> </u>				
M							
			ļ				
N			<u> </u>				
(05) Steer (06) Steer of coo (07) Steer select (08) Add of deck, (09) Left in (10) Cente (11) Right (12) Glove (13) Knee (14) Winds of the A (A1 mirror side o (15) Winds of the	isor ing wheel rim ing wheel hub/spok ing wheel (combina des 04 and 05) ing column, transmi tor lever, other attac on equipment (e.g., air conditioner) instrument panel and or instrument panel ar compartment door bolster shield including one following: front hee /A2)-pillar, instrume , or steering asseml	ssion chment CB, tape  I below and below d below or more ader, ent panel, oly (driver or more	(26) Left side vone or more frame, win B-pillar, or (27) Other left:  (28) Left side word with the side of the side word with the side of the side word with the side	vindow glass or frame vindow glass including re of the following: dow sill, A (A1/A2)-pillar, roof side rail. side object (specify):  vindow sill  interior surface, hardware or armrests hardware or armrest	ROOF (50) (51) (52) (53) (54) FLOOR (56) (57)	Child safety seat (sp Other interior object  Front header Rear header Roof left side rail Roof right side rail Roof or convertible to	(specify):  op  an) nted icluding
mirror (16) Driver cover (17) Passe compa (18) Winds object (19) Other	(passenger side only side air bag compa artment cover hield reinforced by (specify):	y) rtment IN exterior r):	(37) Other right (38) Right side v TERIOR (40) Seat, back (41) Belt restrair (42) Belt restrair attachment (43) Other restra	side object (specify): window sill support nt webbing/buckle nt B-pillar	(60) (61)	Backlight (rear windo Backlight storage rack Other rear object (specific CONFIDENCE LEVEL CONTACT POINT	k, door, etc. scify):
	de interior surface, ing hardware or arn		(specify): (44) Head restra			(1) Certain (2) Probable (3) Possible	

(45) Air bag (use codes "16" and "17"

compartment covers)

for injuries sustained from air bag

(3) Possible

(9) Unknown

#### **AUTOMATIC RESTRAINTS** NOTES: Encode the data for each applicable front seat position. The attribute for the variables may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form. **AIR BAGS** Left Right Availability/Function R Deployment 1 1 S **Failure** Air Bag System Availability/Function Air Bag System Deployment Are There Indications of Air Bag (0) Not equipped/not available (O) Not equipped/not available System Failure? (1) Air bag (1) Air bag deployed during accident (0) Not equipped/not available (as a result of impact) (1) No Non-functional (2) Air bag deployed inadvertently just (2) Yes (specify): (2) Air bag disconnected (specify): prior to accident (3) Air bag deployed, accident sequence (9) Unknown (3) Air bag not reinstalled undetermined (9) Unknown (4) Nondeployed (5) Unknown if deployed (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical) (9) Unknown **AUTOMATIC BELTS** Left Right Availability/Function F Use R Type S **Proper Use** Failure Modes Automatic (Passive) Belt System Proper Use of Automatic (Passive) Belt Automatic (Passive) Belt Failure Modes Availability/Function System **During Accident**

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts type unknown

### Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

### Automatic (Passive) Belt System Use

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative)
- (3) Automatic belt use unknown
- (9) Unknown

## Automatic (Passive) Belt System Type

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

### Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify):
- (8) Other improper use of automatic belt system (specify):
- (9) Unknown

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify):
- (6) Broken retractor
- (7) Combination of above (specify):
- (8) Other automatic belt failure (specify):
- (9) Unknown

## MANUAL RESTRAINTS

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Ocupant Assessment Form.

If a Child safety seat is present, encode the data on the back of this page.

If the vehicle has automatic restraints available, encode the appropriate data on the back of the previous

		Left	Center	Right
E	Availability	4		4
i,	Evidence of usage	44		14
R	Used in this crash?	84		14
S	Proper Use	1		17
	Failure Modes			
s	Availability	4	3	
Ĕ	Evidence of usage	44	44	4 0
ő	Used in this crash?	<b>d</b>	a a	
SECOZD	Proper Use	d	4	<u> </u>
	Failure Modes	4	d d	4
	Availability		7	
우	Evidence of usage			<del> </del>
HER	Used in this crash?			
	Proper Use	/		<del>-/</del>
	Failure Modes			

## Manual (Active) Belt System Availability

(0) None available

- Belt removed/destroyed
- Shoulder belt
- (3) Lap belt

- (4) Lap and shoulder belt
- (5) Belt available type unknown

### Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt
- destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify):
- (9) Unknown

## Manual (Active) Belt System Use

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperable (specify):
- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05)Belt used - type unknown
- Other belt used (specify): (08)
- Shoulder belt used with child safety seat
- Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat -
- type unknown
- Other belt used with child safety seat (18)(specify):
- (99) Unknown if belt used

### Proper Use of Manual (Active) Belts

- (O) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

### Belt Used Improperly

- Shoulder belt worn under arm
- Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- Lap belt worn on abdomen
- Lap belt or lap and shoulder belt used improperly with child safety seat (specify):
- (8) Other improper use of manual belt system (specify):
- (9) Unknown

## Manual (Active) Belt Failure Modes During Accident

- (0) No manual belt used or not available (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify):
- (6) Broken retractor
- (7) Combination of above (specify):
- (8) Other manual belt failure (specify):
- (9) Unknown

When a child safety seat is no	resent enter the	occupant's number in the first row and complete the column below
the occupant's number using	the codes liste	d below. Complete a column for each child safety seat present.
Occupant Number	фa	
Type of Child     Safety Seat	1	
2. Child Safety Seat Orientation	φ1	
<ol><li>Child Safety Seat Harness Usage</li></ol>	12	
4. Child Safety Seat Shield Usage	Ø3	
<ol><li>Child Safety Seat Tether Usage</li></ol>	<b>\$</b> 3	
6. Child Safety Seat Make/Model		Specify Below for Each Child Safety Seat
Tether Usage $\not$ 3  6. Child Safety Seat		<ol> <li>Child Safety Seat Shield Usage</li> <li>Child Safety Seat Tether Usage         Note: Options Below Are Used for Variables 3-5.         (00) No child safety seat         Not Designed with Harness/Shield/Tether         (01) After market harness/shield/tether         added, not used         (02) After market harness/shield/tether used         (03) Child safety seat used, but no after market         harness/shield/tether added         (09) Unknown if harness/shield/tether         added or used         Designed With Harness/Shield/Tether         (11) Harness/shield/tether not used         (12) Harness/shield/tether used         (19) Unknown if harness/shield/tether used         (21) Harness/shield/tether not used         (22) Harness/shield/tether used         (23) Unknown if harness/shield/tether used         (29) Unknown if harness/shield/tether used         (39) Unknown if child safety seat used     </li> <li>Child Safety Seat Make/Model         (Specify make/model and occupant number)         </li> <li>Century Sed Series</li> <li>Imfaut Car Seat</li> </ol>

. . . . ::-::

% %

왕 - . 생

# **HEAD RESTRAINTS/SEAT EVALUATION**

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for these variables may be found at the bottom of the page. Head restraint type/damage and seat type/performance should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

		Left	Center	Right
F	Head Restraint Type/Damage	3	/	3
I R	Seat Type	41		41
S	Seat Performance	1		1
	Seat Orientation	1		,
s	Head Restraint Type/Damage			
E	Seat Type			
0 N	Seat Performance			
D	Seat Orientation _			
т	Head Restraint Type/Damage			
H	Seat Type			
R D	Seat Performance			
	Seat Orientation			-
0	Head Restraint Type/Damage			
T H	Seat Type			<del></del>
E	Seat Performance			
R	Seat Orientation			

# Head Restraint Type/Damage by Occupant at This Occupant Position

- (0) No head restraints
- (1) Integral no damage
- (2) Integral damaged during accident
- (3) Adjustable no damage
- (4) Adjustable damaged during accident
- (5) Add-on no damage
- (6) Add-on damaged during accident
- (8) Other Specify):
- (9) Unknown

ÇÎ:

:::.

- ; ; ;

# Seat Type (this Occupant Position)

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify):
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

# Seat Performance (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed specify:
- (4) Seat tracks/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify):
- (7) Combination of above (specify):
- (8) Other (specify):
- (9) Unknown

# Seat Orientation (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify):
- (9) Unknown

DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE (I.E., UNUSUAL OCCUPANT CONTACT PATTERN)

•••

1984 846 876

EJECTION No [ ] Yes [ Describe indications of ejection an	] d body parts i	nvolved in part	tial ejectio	n(s):		
Occupant Number						
Ejection -						
(Note on Vehicle Interior Sketch) Ejection Area						
Ejection Medium						
Medium Status						
Ejection (1) Complete ejection (2) Partial ejection (3) Ejection, Unknown degree (9) Unknown  Ejection Area (1) Windshield (2) Left front (3) Right front (4) Left rear (5) Right rear (6) Rear	(9) Unknown (9) Unknown (9) Unknown (9) Me (1) Door/(2) Nonfix (3) Fixed	r area (e.g., baip, etc.) (specif own edium /hatch/tailgate ixed roof struct	ture	(8) Ot (9) Un  Medium to Impac (1) Op (2) Clo (3) Into	Status (Imi	n (specify):  mediately Prior
ENTRAPMENT No [ 1 Yes  Describe entrapment mechanism:	[ ]					
Component(s):						

Old. Supartition: Of Transportation	000110441	Form A	pproved
National Highway Traffic Safety Administration	OCCUPANT AS	SESSMENT FORM NATIONAL ACCIDENT SA	No. 2127-0021 MPLING SYSTEM
Primary Sampling Unit Numbe	or	OCCUPANT'S SEATING	DATA SYSTEM
2. Case Number - Stratum	AB 23	10. Occupant's Seat Position Front Seat	11
3. Vehicle Number	41	(11) Left side (12) Middle	
4. Occupant Number	_\$ 1	(13) Right side	
OCCUPANT'S CHARA	CTERISTICS	(14) Other (specify):  (15) On or in the lap of another occupan	<u> </u>
5. Occupant's Age Code actual age at time of acc (00) Less than one year old (s  (97) 97 years and older (99) Unknown	ident. pecify by month):	Second Seat (21) Left side (22) Middle (23) Right side (24) Other (specify): (25) On or in the lap of another occupan	
6. Occupant's Sex (1) Male (2) Female (9) Unknown	2	Third Seat (31) Left side (32) Middle (33) Right side (34) Other (specify): (35) On or in the lap of another occupant	
7. Occupant's Height Code actual height to the neare centimeter. (999) Unknown 64 inches X 2.54 = 163 c		Fourth Seat (41) Left side (42) Middle (43) Right side (44) Other (specify): (45) On or in the lap of another occupant (97) In or on unenclosed area (98) Other seat (specify):	
<ul> <li>8. Occupant's Weight Code actual weight to the neare kilogram. (999) Unknown  13  pounds X .4536 = 5</li> <li>9. Occupant's Role (1) Driver (2) Passenger (9) Unknown</li> </ul>		(99) Unknown  11. Occupant's Posture (0) Normal posture  Abnormal posture (1) Kneeling or standing on seat (2) Lying on or across seat (3) Kneeling, standing or sitting in front o (4) Sitting sideways or turned to talk with occupant or to look out a rear window (5) Sitting on a console (6) Lying back in a reclined seat position (7) Bracing with feet or hands on a surface of seat (8) Other abnormal posture (specify):	another /
		(9) Unknown  BEST AVAILABLE COPY	

EJE	CTION/F	NTRAPMENT	Page
	O 11011/E	TO THAT WELVE	
12. Ejection (0) No ejection (1) Complete ejection (2) Partial ejection (3) Ejection, unknown degree (9) Unknown	<u>\$</u>	15. Medium Status (Immediately Prior To Impact (0) No ejection (1) Open (2) Closed (3) Integral structure (9) Unknown	) <u>4</u>
13. Ejection Area (0) No ejection (1) Windshield (2) Left front (3) Right front (4) Left rear (5) Right rear (6) Rear (7) Roof (8) Other area (e.g., back of pickup, etc.) (specify): (9) Unknown	ψ	16. Entrapment (NOTE: Entrapped means that part of the person was in the vehicle and mechanically restrained; jammed doors and immobilizing injuries by themselves are not sufficient to constitute entrapment.) (0) Not entrapped (1) Entrapped (9) Unknown	ly G
14. Ejection Medium (0) No ejection (1) Door/hatch/tailgate (2) Nonfixed roof structure (3) Fixed glazing (4) Nonfixed glazing (specify):  (5) Integral structure (8) Other medium (specify):  (9) Unknown	<u>φ</u>		
	·		

1

- 19. 20.

1 %

	RESTRAINT SYS	STEM EVALUATION	- uge
	17. Manual (Active) Belt System Availability (0) None available (1) Belt removed/destroyed (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt (5) Belt available—type unknown  Integral Belt Partially Destroyed (6) Shoulder belt (lap belt destroyed/removed) (7) Lap belt (shoulder belt destroyed/removed)		1
	(8) Other belt (specify):  (9) Unknown  18. Manual (Active) Belt System Use (00) None used, not available, or belt removed/destroyed (01) Inoperative (specify):  (02) Shoulder belt (03) Lap belt (04) Lap and shoulder belt (05) Belt used—type unknown (08) Other belt used (specify):	22. Air Bag System Deployment (O) Not equipped/not available (1) Air bag deployed during accident (as a result of impact) (2) Air bag deployed inadvertently just prior to accident (3) Air bag deployed, accident sequence undetermined (4) Nondeployed (5) Unknown if deployed (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical) (9) Unknown	<u>/</u>
1	(12) Shoulder belt used with child safety seat (13) Lap belt used with child safety seat (14) Lap and shoulder belt used with child safety seat (15) Belt used with child safety seat—type unknown (18) Other belt used with child safety seat (specify): (99) Unknown if belt used  9. Proper Use of Manual (Active) Belts (0) None used or not available (1) Belt used properly (2) Belt used properly with child safety seat	23. Are There Indications of Air Bag System Failure? (0) Not equipped/not available (1) No (2) Yes (specify): (9) Unknown  Note: See Variables 44 through 48 (Page 5) for Information on Automatic Belts	<u>/</u>
	<ul> <li>(3) Shoulder belt worn under arm</li> <li>(4) Shoulder belt worn behind back or seat</li> <li>(5) Belt worn around more than one person</li> <li>(6) Lap belt worn on abdomen</li> <li>(7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify):</li> <li>(8) Other improper use of manual belt system (specify):</li> <li>(9) Unknown</li> </ul>	(0) None used (1) Police did not indicate restraint use (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt (5) Belt used, type not specified (6) Child safety seat (7) Other or automatic restraint (specify):  ALEBAG DEPUMED  (8) Restrained, type unknown	7
20	D. Manual (Active) Belt Failure Modes  During Accident (0) No manual belt used (1) No manual belt failure(s) (2) Torn webbing (stretched webbing not included) (3) Broken buckle or latchplate (4) Upper anchorage separated (5) Other anchorage separated (specify): (6) Broken retractor (7) Combination of above (specify): (8) Other manual belt failure (specify):	(9) Police indicated "unknown"	

	System. Occupant Assessment Form	Page 4
HEAD RESTRAINT AND	D SEAT EVALUATION	
25. Head Restraint Type/Damage by Occupant at This Occupant Position  (0) No head restraints (1) Integral—no damage (2) Integral—damaged during accident (3) Adjustable—no damage (4) Adjustable—damaged during accident (5) Add-on—no damage (6) Add-on—damaged during accident (8) Other (specify): (9) Unknown  26. Seat Type (this Occupant Position) (00) Occupant not seated or no seat (01) Bucket (02) Bucket with folding back (03) Bench (04) Bench with separate back cushions (05) Bench with folding back(s) (06) Split bench with separate back cushions (07) Split bench with folding back(s) (08) Pedestal (i.e., column supported) (09) Other seat type (specify):  (10) Box mounted seat (i.e., van type) (99) Unknown	27. Seat Performance (this Occupant Position) (0) Occupant not seated or no seat (1) No seat performance failure(s) (2) Seat adjusters failed (3) Seat back folding locks or "seat back" fa (specify): (4) Seat track/anchors failed (5) Deformed by impact of occupant (6) Deformed by passenger compartment intr (specify): (7) Combination of above (specify): (8) Other (specify): (9) Unknown	

CHIL	LD SAFETY SEAT
(000) No child safety seat Applicable codes are found in your NASS CDS	$-$ 31. Child Safety Seat Harness Usage $\phi$ $\phi$
Data Collection, Coding and Editing (950) Built-in child safety seat (997) Other make/model (specify):	32. Child Safety Seat Shield Usage
(998) Unknown make/model (999) Unknown if child safety seat used	33. Child Safety Seat Tether Usage  Note: Options below applicable to Variables OA31-OA33.  (00) No child safety seat
29. Type of Child Safety Seat (0) No child safety seat (1) Infant seat (2) Toddler seat (3) Convertible seat (4) Booster seat (7) Other type child safety seat (specify):  (8) Unknown child safety seat type (9) Unknown if child safety seat used	Not Designed With Harness/Shield/Tether (01) After market harness/shield/tether added, not used (02) After market harness/shield/tether used (03) Child safety seat used, but no after market harness/shield/tether added (09) Unknown if harness/shield/tether added or used  Designed With Harness/Shield/Tether (11) Harness/shield/tether not used (12) Harness/shield/tether used (19) Unknown if harness/shield/tether used
(00) No child safety seat  Designed for Rear Facing for This Age/Weight (01) Rear facing (02) Forward facing (08) Other orientation (specify):  (09) Unknown orientation	Unknown If Designed With Harness/Shield/Tether
Designed For Forward Facing for This Age/Weig (11) Rear facing (12) Forward facing (18) Other orientation (specify):  (19) Unknown orientation  Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight (21) Rear facing (22) Forward facing (28) Other orientation (specify):  (29) Unknown orientation  (99) Unknown if child safety seat used	ight

ें े (अ

•1:1:

:::: •••

IN HIDY CONCECUENCE	Page
INJURY CONSEQUENCES	38. Working Days Lost 9 9
34. Injury Severity (Police Rating)	Code the number of days
(O) O. No injury	(up through 60) that the occupant
(0) O - No injury (1) C - Possible injury	lost from work due to the accident (00) No working days lost
(2) B - Nonincapacitating injury	(61) 61 days or more
(3) A - Incapacitating injury	(62) Fatally injured
(4) K - Killed	(97) Not working prior to accident
(5) U - Injury, severity unknown	(99) Unknown
(6) Died prior to accident (9) Unknown	
(6) Challowi	STOP - GO TO VARIABLE 44 ON PAGE 7
25 7	VARIABLES 39 THROUGH 43 ARE
35. Treatment - Mortality (0) No treatment	COMPLETED BY THE ZONE CENTER
(1) Fatal	
(2) Fatal - ruled disease (specify):	20. Time to B. II
	39. Time to Death
Manface	Code number of hours from time of accident to time of death up through 24
Nonfatal (3) Hospitalization	hours. If time of death is greater than 24
(4) Transported and released	hours, code number of days. (Note: 1 day =
(5) Treatment at scene - nontransported	$31, 2 \text{ days} = 32, \dots \text{ n days} = 30 + \text{n up}$
(6) Treatment later	through 30 days = 60) (00) Not fatal
(8) Treatment - other (specify):	(96) Fatal - ruled disease
(9) Unknown	(99) Unknown
(o) Onkilowii	
26 Time Of Madical Edition (Control of Control of Contr	40. 1st Medically Reported Cause of Death 中 中
36. Type Of Medical Facility (for Initial Treatment) 2 (0) Not treated at a medical facility	The second course of Death 4
(1) Trauma center	41. 2nd Medically Reported Cause of Death $\phi$ $\phi$
(2) Hospital	I —— I
(3) Medical clinic	42. 3rd Medically Reported Cause of Death $\phi$
(4) Physician's office	Code the Occupant Injury from line number(s) for the medically reported
<ul><li>(5) Treatment later at medical facility</li><li>(8) Other (specify):</li></ul>	injury(s) which reportedly contributed to
to other topechy).	this occupant's death
(9) Unknown	(00) Not fatal or no additional causes
•	(96) Mode of death given but specific
37. Hospital Stay	injuries are not linked to cause of death. (specify):
(00) Not Hospitalized	
Code the number of days (up through 60)	(97) Other result (includes fatal ruled
that the occupant stayed in hospital.	disease) (specify):
(61) 61 days or more	(99) Unknown
(99) Unknown	(SS) CHARGOVII
	42 Number of B
•	43. Number of Recorded Injuries for This Occupant
- 1	This OccupantCode the actual number of
j	injuries recorded for this occupant.
1	(00) No recorded injuries
	(97) Injured, details unknown
İ	(99) Unknown if injured
	I I

•••

:::::

AUTOMATIC BELT SYSTEM	40. 4
44. Automatic (Passive) Belt System Availability/ Function (0) Not equipped/not available (1) 2 point automatic belts (2) 3 point automatic belts (3) Automatic belts - type unknown  Non-functional (4) Automatic belts destroyed or rendered inoperative (9) Unknown  45. Automatic (Passive) Belt System Use	48. Automatic (Passive) Belt Failure Modes During Accident (0) Not equipped/not available/not in use (1) No automatic belt failure(s) (2) Torn webbing (stretched webbing not included) (3) Broken buckle or latchplate (4) Upper anchorage separated (5) Other anchorage separated (specify): (6) Broken retractor (7) Combination of above (specify): (8) Other automatic belt failure (specify):
(0) Not equipped/not available/destroyed or rendered inoperative (1) Automatic belt in use (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify):  (3) Automatic belt use unknown (9) Unknown  46. Automatic (Passive) Belt System Type (0) Not equipped/not available (1) Non-motorized system (2) Motorized system (9) Unknown	49. Seat Orientation (this Occupant Position) (0) Occupant not seated or no seat (1) Forward facing seat (2) Rear facing seat (3) Side facing seat (inward) (4) Side facing seat (outward) (8) Other (specify): (9) Unknown
47. Proper Use of Automatic (Passive) Belt System  (0) Not equipped/not available/not used (1) Automatic belt used properly (2) Automatic belt used properly with child safety seat  Automatic Belt Used Improperly (3) Automatic shoulder belt worn under arm (4) Automatic shoulder belt worn behind back (5) Automatic belt worn around more than one person (6) Lap portion of automatic belt worn on abdomen (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify):  (8) Other improper use of automatic belt system (specify): (9) Unknown	Check the Primary Source Used In Determining Belt Use.  [ ] Not equipped/not available/destroyed or rendered inoperative [ ] Vehicle inspection [ ] Official injury data [ ] Driver/occupant interview [ ] Other (specify):  [ ] Unknown if belt used
ARE ALL APPLICABLE MEDICAL RECORD WITH INITIAL SUBMISSION?	S INCLUDED NO[] YES[]
UPDATE CANDIDATE?	NO[] YES[]

# National Accident Sampling System-Crashworthiness Data System: Occupant Assessment Form BELT USE DETERMINATION STOP - VARIABLES 50 THROUGH 53 ARE COMPLETED BY THE ZONE CENTER 53. Primary Source of Belt Use Determination Not equipped/not available/destroyed or rendered inoperative TRAUMA DATA (1)Vehicle inspection (2) Official injury data 50. Glasgow Coma Scale (GCS) Score 97 (3) Driver/occupant interview (at Medical Facility) Other (specify): (8) (00) Not injured (9) Unknown if belt used (01) Injured - not treated at medical facility (02) No GCS Score at medical facility (03-15) Code the actual value of the initial GCS Score recorded at medical facility. (97) Injured, details unknown (99) Unknown if injured 51. Was the Occupant Given Blood? (1) No - blood not given (2) Yes - blood given (specify units): (9) Unknown if blood given 52. Arterial Blood Gases (ABG) - HCO3 97 (00) Not injured (01) Injured, ABGs not measured or reported (02-50) Code the actual value of theHCO3 (96) ABGs reported , HCO3 unknown (97) Injured, details unknown (99) Unknown if injured

100

•

BEST AVAILABLE COPY

Form Approved O.M.B. No. 2127-0021

National Highway Traffic Safety

Administration

# **OCCUPANT INJURY FORM**

NATIONAL ACCIDENT SAMPLING SYSTEM CRASHWORTHINESS DATA SYSTEM

1. Primary Sampling Unit Number		3. Vehicle Number	<u>ø</u> /
2. Case Number - Stratum	<u> ABZ3</u>	4. Occupant Number	<u>\$ 1</u>


# **INJURY DATA**


Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

				A.I.S 90									li	njury		Occupant
	of Ir	urce njury eta	Bo Reg	dy Jion	Type of Anatomic Structure		Leve		A.I.S. Severity	Aspect		Injury Source	Se Con	ource	Direct/ Indirect Injury	Area Intrusion Number
	5	7	s 7	7.	, <	8. <u>2 ø</u>	n 16:	)	<b>7</b>	. ጎ		11		1		, ,
		_	<b>.</b>		• <u> </u>	·· <u>· · · · · · · · · · · · · · · · · ·</u>	3. <u>p</u> g	<u>s</u> 10	• <u> </u>	1. <u>04</u>	12.	16	13	<u>l</u> 1.	4. <u>/</u> 1	5. <u>Ø</u> Ø
	16	1	7	_ 18	1	9	20	_ 21	2	2	23.	——.	24	25	i 2	š
	27. <u> </u>	_ 2	8	29	3	0	31,	_ 32.	3:	)	34.		35	36	3	<b>.</b>
	38	_ 3:	)	40.	41	l	42	_ 43.	44	· <u> </u>	45. <sub>-</sub>		46	_ 47	48	
	49	_ 50	ı	51.	52	·——	53	54.	55	'	56		57	_ 58.	59	
	60	_ 61	•	62.	63	:	64	65.	66.		37		68	_ 69.	70.	
	71	, 72.		73.	74.		75	76	77.	_ 7	8		79	80.	81.	
	82	83.		84	85.	5 ( ) ( ) ( ) ( ) ( ) ( ) ( ) ( ) ( ) (	16.	87	88.	8:	9		90	91.	92.	
•	93	94.		95	96.	9	7	98	99.	100	). <u> </u>	10	o1	102	103.	
ַ	04	105.	1	06	107.	10	3	109	_ 110	111	•	11	2	113	_ 114	

# OFFICIAL INJURY DATA — SOFT TISSUE INJURIES


Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

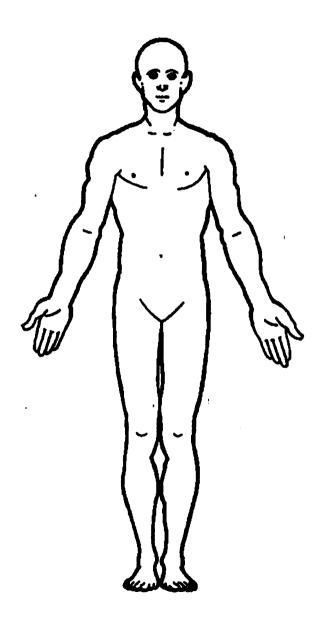


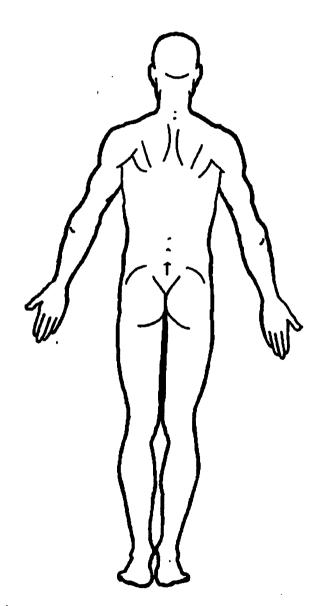

# OFFICIAL INJURY DATA - INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

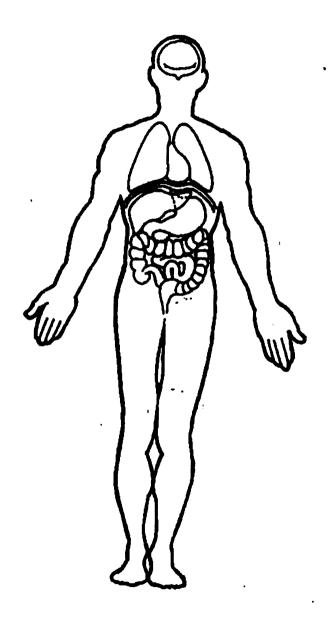

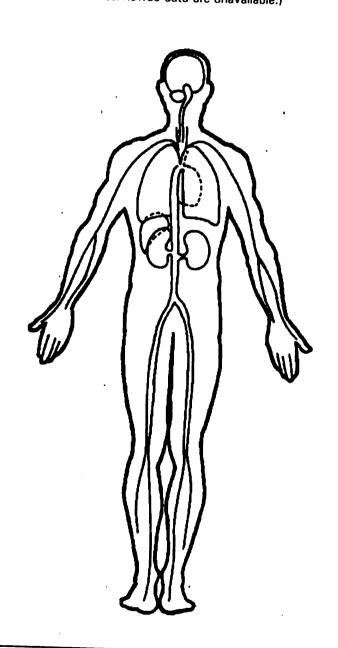

### SOURCE OF INJURY DATA (25) Left side window glass or frame (61) Backlight storage rack, door, etc. **OFFICIAL** (26) Left side window glass including (62) Other rear object (specify): (1) Autopsy records with or without hospital/ one or more of the following: medical records frame, window sill, A (A1/A2)-pillar, (2) Hospital/medical records other than B-pillar, or roof side rail. EXTERIOR of OCCUPANT'S VEHICLE emergency room (e.g., discharge (27) Other left side object (specify): (65) Hood summary) (66) Outside hardware (e.g., outside Emergency room records only (including (28) Left side window sill mirror, antenna) associated X-rays or other lab reports) Other exterior surface or tires (4) Private physician, walk-in or emergency RIGHT SIDE (specify): (30) Right side interior surface, (68) Unknown exterior objects excluding hardware or armrests UNOFFICIAL Right side hardware or armrest EXTERIOR OF OTHER MOTOR VEHICLE (5) Lay coroner report (32) Right A (A1/A2)-pillar (70) Front bumper E.M.S. personnel (33) Right B-pillar (71) Hood edge Interviewee (34) Other right pillar (specify): (72) Other front of vehicle (specify): (8) Other source (specify): (35) Right side window glass or frame (73)Hood (9) Police (36) Right side window glass including Hood ornament (74)one or more of the following: (75)Windshield, roof rail, A-pillar frame, window sill, A (A1/A2)-pillar, (76) Side surface **INJURY SOURCE** B-pillar, or roof side rail. (77) Side mirrors FRONT Other right side object (specify): (78) Other side protrusions (specify) (01) Windshield (02) Mirror (38) Right side window sill (79) Rear surface (03) Sunvisor (80) Undercarriage (04)Steering wheel rim INTERIOR (81) Tires and wheels (05) Steering wheel hub/spoke (40) Seat, back support Other exterior of other motor vehicle (06) Steering wheel (combination (41) Belt restraint webbing/buckle (specify): of codes 04 and 05) (42) Belt restraint B-pillar or door frame (07) Steering column, transmission attachment point (83) Unknown exterior of other motor vehicle selector lever, other attachment Other restraint system component (08) Add on equipment (e.g., CB, tape (specify): OTHER VEHICLE OR OBJECT IN THE (44) Head restraint system deck, air conditioner) **ENVIRONMENT** Left instrument panel and below (45)Air bag (use codes "16" and "17" for injuries (84) Ground (10) Center instrument panel and below sustained from air bag compartment covers) (85) Other vehicle or object (specify) (11) Right instrument panel and below (46) Other occupants (specify): (12) Glove compartment door (86) Unknown vehicle or object (13) Knee bolster (47) Interior loose objects (14) Windshield including one or more Child safety seat (specify): NONCONTACT INJURY of the following: front header, (90) Fire in vehicle A (A1/A2)-pillar, instrument panel, (49) Other interior object (specify): (91) Flying glass mirror, or steering assembly (driver Other noncontact injury source (92)side only) (specify): (15) Windshield including one or more ROOF (93) Air bag exhaust gases of the following: front header, (50) Front header (97) Injured, unknown source A (A1/A2)-pillar, instrument panel, or (51) Rear header mirror (passenger side only) (52) Roof left side rail **INJURY SOURCE CONFIDENCE** (16) Driver side air bag compartment cover (53) Roof right side rail **LEVEL** Passenger side air bag compartment cover (54) Roof or convertible top (1) Certain (18)Windshield reinforced by exterior object Probable (specify): 121 **FLOOR** Other front object (specify): (3) Possible (56) Floor (including toe pan) (9) Unknown (57) Floor or console mounted transmission lever, including LEFT SIDE console DIRECT/INDIRECT INJURY (20) Left side interior surface, (58) Parking brake handle Direct contact injury -(1) excluding hardware or armrests (59) Foot controls including parking Left side hardware or armrest (2) Indirect contact injury brake (3) (22) Left A (A1/A2)-pillar Noncontact injury (23) Left B-pillar Injured, unknown source RFAR (24) Other left pillar (specify): (60) Backlight (rear window)

-:-:-

3.35

# OCCUPANT INJURY CLASSIFICATION

# **Body Region**

- Head (2) Face
- (3) Neck
- (4) Thorax
- (5) Abdomen
- (6) Spine
- **Upper Extremity**
- Lower Extremity (8)
- (9) Unspecified

# Type of Anatomic Structure

- Whole Area
- Vassals
- (3) Nerves
- (4) Organs (includes muscles/
- ligaments)
- Skeletal (includes joints)
- Head LOC
- (9) Skin

## Specific Anatomic Structure

- Whole Area (02) Skin Abrasion
- (04) Skin Contusion
- (06) Skin Laceration (08) Skin - Avulsion
- Amputation
- (20) Burn
- (30) Crush
- (40) Degloving
- (50) Injury - NFS
- Trauma, other than mechanical

## Head - LOC

- (02) Length of LOC (04, 06, 08) Level of Consciousness (10) Concussion

- (02) Cervical (04) Thoracic
- (06) Lumbar
- Vessels, Nerves, Organs. Bones, Joints are assigned consecutive two digit numbers beginning with 02

## Level of Injury

- Specific injuries are assigned consecutive two-digit numbers beginning with 02.
- To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.

## Abbreviated Injury Scale

- Minor injury
- Moderate injury
- (3) Serious injury
- (4) Severe injury
- Critical injury
- Maximum (untreatable)
- (7)Injured, unknown severity

## **Aspect**

- (1) Right
- (2) Left
- Bilateral
- (4) (5) Central
  - Anterior
- (6) Posterior
- Superior
- Inferior 181
  - Unknown
- Whole region
- (9)

National Highway Traffic Safety

Administration

:33:

. \_ \_ ...;;

OCCUPANT ASSESSMENT FORM NATIONAL ACCIDENT SAMPLING SYSTEM CRASHWORTHINESS DATA SYSTEM

Primary Sampling Unit Number	OCCUPANT'S SEATING
2. Case Number - Stratum ABZ3	10. Occupant's Seat Position / 3
3. Vehicle Number	- Front Seat (11) Left side
4. Occupant Number 4 2	(12) Middle (13) Right side
OCCUPANT'S CHARACTERISTICS	(14) Other (specify): (15) On or in the lap of another occupant
5. Occupant's Age Code actual age at time of accident. (00) Less than one year old (specify by month):  (97) 97 years and older (99) Unknown	Second Seat (21) Left side (22) Middle (23) Right side (24) Other (specify):
6. Occupant's Sex (1) Male (2) Female (9) Unknown	(25) On or in the lap of another occupant  Third Seat (31) Left side (32) Middle (33) Right side (34) Other (specify): (35) On or in the lap of another occupant  Fourth Seat
7. Occupant's Height Code actual height to the nearest centimeter. (999) Unknown  20 inches X 2.54 = 451 centimeters	(41) Left side (42) Middle (43) Right side (44) Other (specify): (45) On or in the lap of another occupant (97) In or on unenclosed area (98) Other seat (specify): (99) Unknown
8. Occupant's Weight Code actual weight to the nearest kilogram. (999) Unknown	11. Occupant's Posture $\phi$ (0) Normal posture
9. Occupant's Role (1) Driver (2) Passenger (9) Unknown	Abnormal posture  (1) Kneeling or standing on seat (2) Lying on or across seat (3) Kneeling, standing or sitting in front of seat (4) Sitting sideways or turned to talk with another occupant or to look out a rear window (5) Sitting on a console (6) Lying back in a reclined seat position (7) Bracing with feet or hands on a surface in front of seat (8) Other abnormal posture (specify): (9) Unknown
	REST AVAILABLE COPY

		NTRAPMENT	Page
LJE		NIRAPIVIENI	
12. Ejection (0) No ejection (1) Complete ejection (2) Partial ejection (3) Ejection, unknown degree (9) Unknown	<u> </u>	15. Medium Status (Immediately Prior To Impact (0) No ejection (1) Open (2) Closed (3) Integral structure (9) Unknown	4
13. Ejection Area (0) No ejection (1) Windshield (2) Left front (3) Right front (4) Left rear (5) Right rear (6) Rear (7) Roof (8) Other area (e.g., back of pickup, etc.) (specify): (9) Unknown	4	16. Entrapment (NOTE: Entrapped means that part of th person was in the vehicle and mechanicall restrained; jammed doors and immobilizing injuries by themselves are not sufficient to constitute entrapment.) (0) Not entrapped (1) Entrapped (9) Unknown	y
14. Ejection Medium (0) No ejection (1) Door/hatch/tailgate (2) Nonfixed roof structure (3) Fixed glazing (4) Nonfixed glazing (specify):  (5) Integral structure (8) Other medium (specify):  (9) Unknown	<u>4</u>		

े े े अर्थ

			RESTRAIN	ΓSYS	STEM EVALUATION	raye 3
	17.	(0) (1) (2) (3) (4)	nual (Active) Belt System Availability None available Belt removed/destroyed	_4	21. Air Bag System Availability/Function (0) Not equipped/not available (1) Air bag  Non-functional (2) Air bag disconnected (specify):	1
		<i>Inte</i> (6)	gral Belt Partially Destroyed Shoulder belt (lap belt destroyed/removed) Lap belt (shoulder belt destroyed/removed)		(3) Air bag not reinstalled (9) Unknown	
			Other belt (specify): Unknown		22. Air Bag System Deployment (0) Not equipped/not available (1) Air bag deployed during accident (as a result of impact)	
		(00) (01) (02) (03) (04) (05) (08)	None used, not available, or belt removed/destroyed Inoperative (specify):  Shoulder belt Lap belt Lap and shoulder belt Belt used—type unknown Other belt used (specify):	4	(2) Air bag deployed inadvertently just prior to accident (3) Air bag deployed, accident sequence undetermined (4) Nondeployed (5) Unknown if deployed (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical) (9) Unknown	
		(13) (14) (15) (18)	Shoulder belt used with child safety seat Lap belt used with child safety seat Lap and shoulder belt used with child safety seat Belt used with child safety seat—type unknown of the child safety seat (specify): Unknown if belt used	own	23. Are There Indications of Air Bag System Failure? (0) Not equipped/not available (1) No (2) Yes (specify):	1
		(O) N (1) E	er Use of Manual (Active) Belts None used or not available Belt used properly Belt used properly with child safety seat	2	(9) Unknown  Note: See Variables 44 through 48 (Page 5) for Information on Automatic Belts	
	(	(3) S (4) S (5) B (6) L (7) L (8) O (8)	Shoulder belt worn under arm Shoulder belt worn behind back or seat Belt worn around more than one person ap belt worn on abdomen ap belt or lap and shoulder belt used improperly with child safety seat (specify): Other improper use of manual belt system specify):		24. Police Reported Restraint Use (0) None used (1) Police did not indicate restraint use (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt (5) Belt used, type not specified (6) Child safety seat (7) Other or automatic restraint (specify):	6
	20. N (() (1) (2)	Manua Ouring O) No 1) No 2) To in 3) Br 4) Ui	al (Active) Belt Failure Modes g Accident o manual belt used o manual belt failure(s) orn webbing (stretched webbing not . scluded) roken buckle or latchplate pper anchorage separated ther anchorage separated (specify):	]	(8) Restrained, type unknown (9) Police indicated "unknown"	
	(6 (7	5) Br 7) Co	roken retractor ombination of above (specify):			
			ther manual belt failure (specify):			
Ц.,				I		1

	Total Gyotem: Occupant Assessment Form	Page 4
HEAD RESTRAINT	AND SEAT EVALUATION	
· ·	27. Seat Performance (this Occupant Position) (0) Occupant not seated or no seat (1) No seat performance failure(s) (2) Seat adjusters failed (3) Seat back folding locks or "seat back" fa (specify): (4) Seat track/anchors failed (5) Deformed by impact of occupant (6) Deformed by passenger compartment int (specify): (7) Combination of above (specify): (8) Other (specify): (9) Unknown	

	CHILD SA	FETY SEAT
28.	Child Safety Seat Make/Model (000) No child safety seat Applicable codes are found in your NASS CDS Data Collection, Coding and Editing (950) Built-in child safety seat (997) Other make/model (specify):	31. Child Safety Seat Harness Usage  1 2  32. Child Safety Seat Shield Usage  4 3
	(998) Unknown make/model (999) Unknown if child safety seat used	33. Child Safety Seat Tether Usage  Note: Options below applicable to Variables OA31-OA33.  (00) No child safety seat
30.	Type of Child Safety Seat  (0) No child safety seat  (1) Infant seat  (2) Toddler seat  (3) Convertible seat  (4) Booster seat  (7) Other type child safety seat (specify):  (8) Unknown child safety seat type  (9) Unknown if child safety seat used  Child Safety Seat Orientation  (00) No child safety seat  Designed for Rear Facing for This Age/Weight  (01) Rear facing  (02) Forward facing  (08) Other orientation  Designed For Forward Facing for This Age/Weight  (11) Rear facing  (12) Forward facing  (13) Other orientation (specify):  (19) Unknown orientation  Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight  20) Rear facing  21) Rear facing  22) Forward facing  23) Other orientation (specify):	Not Designed With Harness/Shield/Tether (01) After market harness/shield/tether added, not used (02) After market harness/shield/tether used (03) Child safety seat used, but no after market harness/shield/tether added (09) Unknown if harness/shield/tether added or used  Designed With Harness/Shield/Tether (11) Harness/shield/tether not used (12) Harness/shield/tether used (19) Unknown if harness/shield/tether used  Unknown If Designed With Harness/Shield/Tether (21) Harness/shield/tether not used (22) Harness/shield/tether used (29) Unknown if harness/shield/tether used
	29) Unknown orientation	
(	99) Unknown if child safety seat used	

	IN HIRV CONCEQUENCES		Page
	INJURY CONSEQUENCES	38. Working Days Lost	97
34	. Injury Severity (Police Rating) 3	Code the number of days	
	(0) O - No injury	(up through 60) that the occupant lost from work due to the accident	
	(1) C - Possible injury	(00) No working days lost	
	(2) B - Nonincapacitating injury	(61) 61 days or more	
	(3) A - Incapacitating injury	(62) Fatally injured	
	(4) K - Killed	(97) Not working prior to accident (99) Unknown	
	<ul><li>(5) U - Injury, severity unknown</li><li>(6) Died prior to accident</li></ul>	(33) Olikilowij	
	(9) Unknown	STOR OO TO MADE TO THE	
		STOP - GO TO VARIABLE 44 ON PA	GE 7
35	Treatment - Mortality 3	VARIABLES 39 THROUGH 43 ARE	
<b>.</b>	(0) No treatment	COMPLETED BY THE ZONE CENTER	
	(1) Fatal		***************************************
	(2) Fatal - ruled disease (specify):	39. Time to Death	Q 4
		Code number of hours from time of	
	Nonfatal	accident to time of death up through 24	
	(3) Hospitalization	hours. If time of death is greater than 24	4
	(4) Transported and released	hours, code number of days. (Note: 1 da 31, 2 days = 32, n days = 30 + n up	ay =
	<ul><li>(5) Treatment at scene - nontransported</li><li>(6) Treatment later</li></ul>	through 30 days $= 60$ )	þ
	(8) Treatment - other (specify):	(00) Not fatal	
		(96) Fatal - ruled disease (99) Unknown	
	(9) Unknown	(00) Olikilowii	
20	T 0/11 11 12 11	40. 1st Medically Reported Cause of Death	a a
30.	Type Of Medical Facility (for Initial Treatment) 2 (0) Not treated at a medical facility	To the medically reported Cause of Death	$\stackrel{\checkmark}{-}\stackrel{\checkmark}{-}$
	(1) Trauma center	41. 2nd Medically Reported Cause of Death	<b>4 \$</b>
	(2) Hospital	<u>'</u>	
	(3) Medical clinic	42. 3rd Medically Reported Cause of Death  Code the Occupant Injury from line	4 4
	<ul><li>(4) Physician's office</li><li>(5) Treatment later at medical facility</li></ul>	number(s) for the medically reported	
	(8) Other (specify):	injury(s) which reportedly contributed to	
		this occupant's death	
	(9) Unknown	(00) Not fatal or no additional causes (96) Mode of death given but specific	İ
		injuries are not linked to cause	
<b>37</b> .	Hospital Stay Ø 3	of death. (specify):	
	(00) Not Hospitalized	(97) Other result (includes fatal ruled	
;	Code the number of days (up through 60) that the occupant stayed in hospital	disease) (specify):	
1	(61) 61 days or more		
(	(99) Unknown /	(99) Unknown	
	1000 MAL	43. Number of Recorded Injuries for	
	ADDITIONAL DAYS RELEASE -	This Occupant	\$ 5
	DAY RELL	Code the actual number of injuries recorded for this occupant.	ļ
	AFTISE	(00) No recorded injuries	
		(97) Injured, details unknown	
		(99) Unknown if injured	

AUTOMATIC BELT SYSTEM	
<ul> <li>44. Automatic (Passive) Belt System Availability/ Function (0) Not equipped/not available (1) 2 point automatic belts (2) 3 point automatic belts (3) Automatic belts - type unknown</li> <li>Non-functional (4) Automatic belts destroyed or rendered inoperative (9) Unknown</li> <li>45. Automatic (Passive) Belt System Use (0) Not equipped/not available/destroyed or</li> </ul>	48. Automatic (Passive) Belt Failure Modes  During Accident (0) Not equipped/not available/not in use (1) No automatic belt failure(s) (2) Torn webbing (stretched webbing not included) (3) Broken buckle or latchplate (4) Upper anchorage separated (5) Other anchorage separated (specify):  (6) Broken retractor (7) Combination of above (specify): (8) Other automatic belt failure (specify):
rendered inoperative  (1) Automatic belt in use (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify):  (3) Automatic belt use unknown (9) Unknown  46. Automatic (Passive) Belt System Type (0) Not equipped/not available (1) Non-motorized system (2) Motorized system (9) Unknown	49. Seat Orientation (this Occupant Position) (0) Occupant not seated or no seat (1) Forward facing seat (2) Rear facing seat (3) Side facing seat (inward) (4) Side facing seat (outward) (8) Other (specify): (9) Unknown
47. Proper Use of Automatic (Passive) Belt System  (0) Not equipped/not available/not used (1) Automatic belt used properly (2) Automatic belt used properly with child safety seat  Automatic Belt Used Improperly (3) Automatic shoulder belt worn under arm (4) Automatic shoulder belt worn behind back (5) Automatic belt worn around more than one person (6) Lap portion of automatic belt worn on abdomen (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify):  (8) Other improper use of automatic belt system (specify): (9) Unknown	Check the Primary Source Used In Determining Belt Use.  [ ] Not equipped/not available/destroyed or rendered inoperative [ Y Vehicle inspection [ ] Official injury data [ ] Driver/occupant interview [ ] Other (specify): [ ] Unknown if belt used
ARE ALL APPLICABLE MEDICAL RECORD WITH INITIAL SUBMISSION?	S INCLUDED NO[] YES[4
UPDATE CANDIDATE?	NO[4 YES[]

-(अ - (अ) -(\$)

3 = 7 stem Citation C	ata System: Occupant Assessment Form	Page
STOP - VARIABLES 50 THROUGH 53 ARE COMPLETED BY THE ZONE CENTER	BELT USE DETERMINATION	- 190
TRAUMA DATA  50. Glasgow Coma Scale (GCS) Score (at Medical Facility) (00) Not injured (01) Injured - not treated at medical facility (02) No GCS Score at medical facility (03-15) Code the actual value of the initial GCS Score recorded at medical facility. (97) Injured, details unknown (99) Unknown if injured	53. Primary Source of Belt Use Determination (0) Not equipped/not available/destroyed or rendered inoperative (1) Vehicle inspection (2) Official injury data (3) Driver/occupant interview (8) Other (specify): (9) Unknown if belt used	
51. Was the Occupant Given Blood? (1) No - blood not given (2) Yes - blood given (specify units): (9) Unknown if blood given	-	
52. Arterial Blood Gases (ABG) – HCO <sub>3</sub> (00) Not injured (01) Injured, ABGs not measured or reported (02-50) Code the actual value of theHCO <sub>3</sub> (96) ABGs reported, HCO <sub>3</sub> unknown (97) Injured, details unknown (99) Unknown if injured		

Form Approved O.M.B. No. 2127-0021

National Highway Traffic Safety Administration

# **OCCUPANT INJURY FORM**

NATIONAL ACCIDENT SAMPLING SYSTEM CRASHWORTHINESS DATA SYSTEM

1. Primary Sampling Unit Number

3. Vehicle Number

Ø 1

Case Number - Stratum

AR23


4. Occupant Number


<u> ø ュ</u>


# INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.


						A.I.S	90			<del></del>	Injur	γ	Occupant	1
	Sour of Inj Dat	ury	Body Region	Type Anato Struct	mic A	Specific Anatomic Structure	Level ( Injury			lnjur t Sourc	Sour y Confide	ce Direct/	Area Intrusion Number	ICD-9
; st	5. <u>. s</u>	<u>}</u> €	s. <u>/</u>	7. <u>#</u>	8. <u>(</u>	<u> 26</u>	9. <u>5 4</u>	10. <u>5</u>	11. <u>3</u>	12. <u>48</u>	13. <u>A</u> _	14. 📗 1	5. <u>øø</u>	854.૨
kd	16. <u>-</u>	<u>}</u> 17	1	8. <u>4</u>	19. 9	<u> 6</u>	20. <u>Ø 2</u>	21. <u>3</u>	22. <u>L</u>	23. <u>48</u>	24. <u>공</u>	25, 2	в. <u>ФФ</u>	<u>851.</u> p
	27. <u>J</u>	28	2	9. <u>4</u>	30. <b>9</b>	<u>86</u> :	31. <u>Ø 2.</u>	32. <u>3</u>	33. <u> </u>	34. <u>48</u>	35. <u>Z</u>	36. <u> </u>	7. <u>ØØ</u>	<u>851.ø</u>
### (First	38. <u>ब</u> े	39.	<u>/</u> 4	o. <u> </u>	41. <u>¢</u>	<u> </u>	12. <u>ØƏ</u>	43. <u>a</u>	44. <u>之</u>	45. <u>48</u>	46. <u> 7</u>	47. <u>l</u> 48	. Ø Ø	HOI.
::::::::::::::::::::::::::::::::::::::	49. <u>ఎ</u>	50.	<u>/</u> 51	ı. <u>5</u>	52. <b>£</b>	<u> </u>	3. <u>Ø</u> 2	54. <u>2</u>	55	56. <u>48</u>	57. <u>Z</u>	58. <u> </u> 59	. <u>øø</u>	900.2¢
đ	60. <u>.</u>	61.	62		63. <u>,    </u>	<u>.</u> 6	4. <u>}                                    </u>	65. <u></u>	66. <u> </u>	67	68	6970		
7	71	72.	73	•	74	7!	5	76	77	78	79	80 81.		
8եր՝ -	82	83.	84.		<b>8</b> 5	86	). 	87. <u> </u>	18	89.	90	91 92.		
9th	93	94	95.		96	97		98 9	)9 10	00	1011	02103.		::
10th	104	105	106.	10	07	108		09 11	011	1	112 1	13 114.		

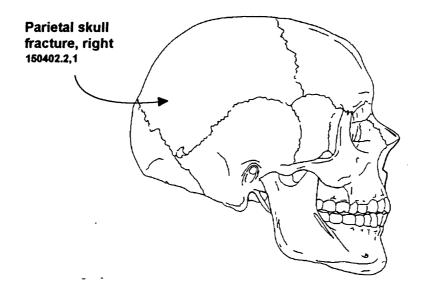


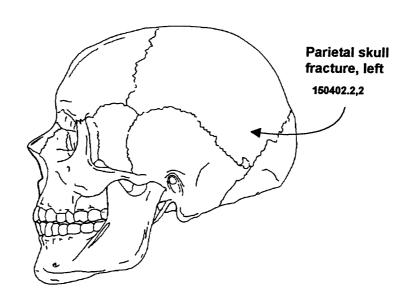

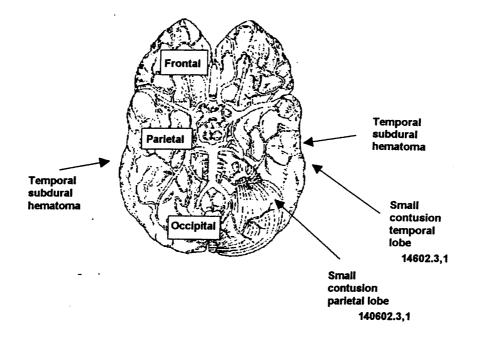

4 left and 1 right side parietal 3-8 mm foci, possibly related to contusions or shear injuries Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

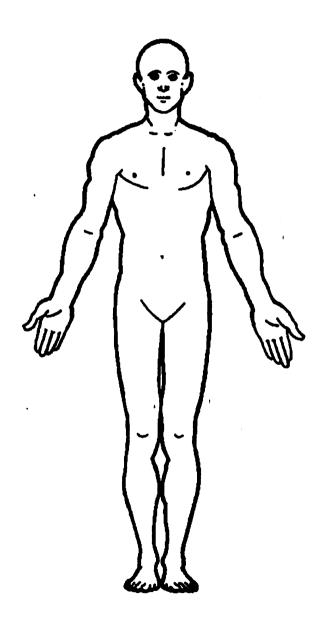


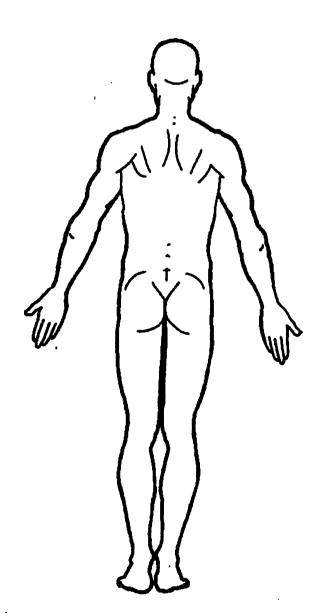


# OFFICIAL INJURY DATA — SKELETAL INJURIES Restrained? Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are

# OFFICIAL INJURY DATA —INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

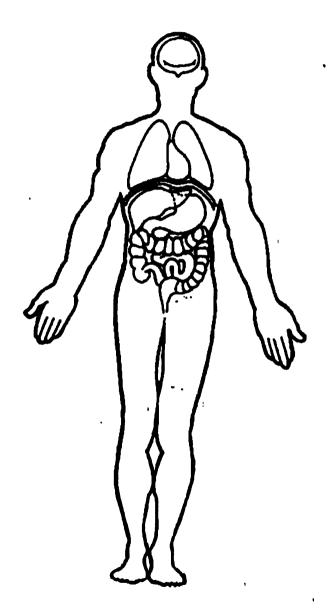

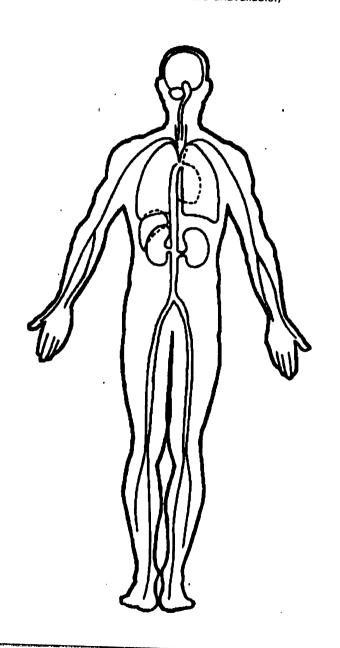

### **SOURCE OF INJURY DATA** (25) Left side window glass or frame (61) Backlight storage rack, door, etc. OFFICIAL (26) Left side window glass including (62) Other rear object (specify): (1) Autopsy records with or without hospital/ one or more of the following: medical records frame, window sill, A (A1/A2)-pillar, (2) Hospital/medical records other than B-pillar, or roof side rail. EXTERIOR of OCCUPANT'S VEHICLE emergency room (e.g., discharge (27) Other left side object (specify): (65) Hood summary) (66) Outside hardware (e.g., outside Emergency room records only (including (28) Left side window sill mirror, antenna) associated X-rays or other lab reports) (67) Other exterior surface or tires (4) Private physician, walk-in or emergency RIGHT SIDE (specify): clinic (30) Right side interior surface, (68) Unknown exterior objects excluding hardware or armrests UNOFFICIAL Right side hardware or armrest **EXTERIOR OF OTHER MOTOR VEHICLE** (5) Lay coroner report (32) Right A (A1/A2)-pillar (70) Front bumper (6) E.M.S. personnel (33) Right B-pillar (71) Hood edge Interviewee (34) Other right pillar (specify): (72) Other front of vehicle (specify): (8) Other source (specify): (35) Right side window glass or frame (73) Hood (9) Police (36) Right side window glass including (74) Hood ornament Windshield, roof rail, A-pillar one or more of the following: (75)frame, window sill, A (A1/A2)-pillar, (76) Side surface **INJURY SOURCE** B-pillar, or roof side rail. (77) Side mirrors FRONT (78) Other side protrusions (specify) (37) Other right side object (specify): (01) Windshield (02) Mirror (38) Right side window sill (79) Rear surface (03) Sunvisor Undercarriage (80) (04)Steering wheel rim INTERIOR (81) Tires and wheels Steering wheel hub/spoke (05) (40) Seat, back support (82) Other exterior of other motor vehicle (06) Steering wheel (combination (41) Belt restraint webbing/buckle (specify): of codes 04 and 05) (42) Belt restraint B-pillar or door frame (07) Steering column, transmission attachment point (83) Unknown exterior of other motor vehicle selector lever, other attachment Other restraint system component (08) Add on equipment (e.g., CB, tape (specify): OTHER VEHICLE OR OBJECT IN THE (44) Head restraint system deck, air conditioner) **FNVIRONMENT** Left instrument panel and below (45) Air bag (use codes "16" and "17" for injuries (84) Ground (10) Center instrument panel and below sustained from air bag compartment covers) (85) Other vehicle or object (specify) (11) Right instrument panel and below (46) Other occupants (specify): (12) Glove compartment door (86) Unknown vehicle or object (13) Knee bolster (47) Interior loose objects (14)Windshield including one or more (48) Child safety seat (specify): NONCONTACT INJURY of the following: front header, (90) Fire in vehicle A (A1/A2)-pillar, instrument panel, (49) Other interior object (specify): (91) Flying glass mirror, or steering assembly (driver Other noncontact injury source (92)side only) (specify): (15) Windshield including one or more ROOF (93) Air bag exhaust gases of the following: front header, (50) Front header (97) Injured, unknown source A (A1/A2)-pillar, instrument panel, or (51) Rear header mirror (passenger side only) (52) Roof left side rail INJURY SOURCE CONFIDENCE (16) Driver side air bag compartment cover (53) Roof right side rail **LEVEL** (17) Passenger side air bag compartment cover (54) Roof or convertible top Certain (1) Windshield reinforced by exterior object (18)Probable (specify): (2) FLOOR (19) Other front object (specify): (3) Possible (56) Floor (including toe pan) Unknown (57) Floor or console mounted transmission lever, including LEFT SIDE DIRECT/INDIRECT INJURY (20) Left side interior surface, (58) Parking brake handle -(1) Direct contact injury excluding hardware or armrests (59) Foot controls including parking Indirect contact injury Left side hardware or armrest (2) brake (22) Left A (A1/A2)-pillar (3) Noncontact injury Injured, unknown source (23) Left B-pillar RFAR (24) Other left pillar (specify): (60) Backlight (rear window) OCCUPANT INJURY CLASSIFICATION

# **Body Region**

- Head
- (2) Face
- Neck
- (4) Thorax
- (5) Abdomen
- Spine

ः

- (6) (7)
- **Upper Extremity**
- Lower Extremity
- (9) Unspecified

## Type of Anatomic Structure

- Whole Area
- (2) Vessels
- (3) Nerves
- (4) Organs (includes muscles/ ligaments)
- Skeletal (includes joints)
- Head LOC
- (9) Skin

# Specific Anatomic Structure

- Whole Area (02) Skin Abrasion
- (04) Skin Contusion
- (06) Skin Laceration (08) Skin Avulsion
- Skin Avulsion
- (10) Amoutation
- Burn
- (30) Crush
- (40) Degloving
- (50) Injury - NFS
- Trauma, other than mechanical

- Head LOC (02) Length of LOC (04, 06, 08) Level of Consciousness
- (10) Concussion

- (02) Cervical (04) Thoracic
- (06) Lumbar

# Vessels, Nerves, Organs. Bones, Joints are assigned consecutive two digit numbers beginning with 02

## Level of Injury

Specific injuries are assigned consecutive two-digit numbers beginning with 02.

To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.

## Abbreviated Injury Scale

- Minor injury
- Moderate injury
- (3) Serious injury
- (4) Severe injury
- (5) Critical injury (6) Maximum (untreatable)
- (7)Injured, unknown severity

## Aspect

- (1) Right
- (2) Left
- Bilateral
- (4) (5) Central
- Anterior
- **Posterior**
- (6) (7) Superior
- (8) Inferior
- 191 Unknown Whole region

National Highway Traffic Safety Administration GENI	ERAL VE	HICLE FORM NATIONAL ACCIDENT SAMPLING S CRASHWORTHINESS DATA S	SYSTE
3. Vehicle Number  VEHICLE IDENTIFICATION  4. Vehicle Model Year Code the last two digits of the model yea (99) Unknown  5. Vehicle Make (specify):  CHEVROLET Applicable codes are found in your	23 <del>\$2</del> <del>\$1</del>	44 9 " 9	ø
NASS Data Collection, Coding and Editing Manual. (99) Unknown		(99) Unknown Source: PAR	
6. Vehicle Model (specify):  MALIBU  Applicable codes are found in your NASS Data Collection, Coding and Editing Manual.  (999) Unknown	<u> 4                                    </u>	ACCIDENT RELATED  13. Speed Limit	<u> </u>
7. Body Type  Note: Applicable codes may be found on the back of this page.	φ4	14. Attempted Avoidance Maneuver (01) No avoidance actions	) —
8. Vehicle Identification Number  9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9		(02) Braking (no lockup) (03) Braking (lockup) (04) Braking (lockup unknown) (05) Releasing brakes (06) Steering left (07) Steering right (08) Braking and steering left (09) Braking and steering right (10) Accelerating (11) Accelerating and steering left (12) Accelerating and steering right (97) No driver present (98) Other action (specify):	
Code to the nearest kph (NOTE: 000 means less than 0.5 kph) (160) 159.5 kph and above (999) Unknown  43 mph X 1.6093 = 4 6 9 kph	69	Applicable codes may be found on the back of page two of this field form (00) No impact Code the number of the diagram that best describes the accident circumstance (98) Other accident type (specify):  (99) Unknown	-
	/37 IF GV	07 DOES NOT EQUAL 01-49 ****	-

20<u>%</u> 66 2

# **CODES FOR BODY TYPE**

# CDS APPLICABLE VEHICLES

## Automobiles

- (01) Convertible (excludes sun-roof, t-bar)
- (02) 2-door sedan, hardtop, coupe
- (03) 3-door/2-door hatchback
- (O4) 4-door sedan, hardtop
- (05) 5-door/4-door hatchback
- (06) Station wagon (excluding van and truck based)
- (07) Hatchback, number of doors unknown
- (08) Other automobile type (specify):
- (09) Unknown automobile type

## Automobile Derivatives

- (10) Auto based pickup (includes El Camino, Caballero, Ranchero, Brat, and Rabbit pickup)
- (11) Auto based panel (cargo station wagon, auto based ambulance/hearse)
- (12) Large limousine more than four side doors or stretched chassis
- (13) Three-wheel automobile or automobile derivative

# Utility Vehicles (≤ 4,500 kgs GVWR)

- (14) Compact utility (Jeep CJ-2 CJ-7, Scrambler, Golden Eagle, Renegade, Laredo, Wrangler, Cherokee [84 and after], Dispatcher, Raider, Bronco II, Bronco [76 and before], Explorer, S-10 Blazer, Geo Tracker, Bravada, S-15 Jimmy, Thing, Pathfinder, Trooper, Trooper II, Rodeo, Amigo, Navajo, 4-Runner, Montero, Samurai, Sidekick, Rocky)
- (15) Large utility (includes Jeep Cherokee [83 and before], Ramcharger, Trailduster, Bronco-fullsize [78 and after], fullsize Blazer, fullsize Jimmy, Landcruiser, Rover, Scout)
- (16) Utility station wagon (Chevy Suburban, GMC Suburban, Travelall, Grand Wagoneer, includes suburban limousine)
- (19) Utility, unknown body type

# Van Based Light Trucks (≤ 4,500 kgs GVWR)

- (20) Minivan (Chrysler Town and Country, Caravan, Grand Caravan, Voyager, Grand Voyager, Mini-Ram, Dodge/Plymouth Vista, Aerostar, Villager, Lumina APV, Trans Sport, Silhouette, Astro, Safari, Toyota Van, Toyota Minivan, Previa, Nissan Minivan, Quest, Mitsubishi Minivan, Vanagon/Camper.)
- (21) Large van (B150-B350, Sportsman, Royal, Maxiwagon, Ram, Tradesman, Voyager [83 and before], E150-E350, Econoline, Clubwagon, Chateau, G10-G30, Chevy Van, Beauville, Sport Van, G15-G35, Rally Van, Vandura,)
- (22) Step van or walk-in van (≤ 4,500 kgs GVWR)
- (23) Van based motorhome (≤ 4,500 kgs GVWR)
- (24) Van based school bus (≤ 4,500 kgs GVWR)
- (25) Van based other bus (≤ 4,500 kgs GVWR)
- (28) Other van type (Hi-Cube Van, Kary) (specify):
- (29) Unknown van type

# Light Conventional Trucks (Pickup style cab, ≤ 4,500 kgs GVWR)

- (30) Compact pickup (D50, Colt P/U, Ram 50, Dakota, Arrow Pickup [foreign], Ranger, Courier, S-10, T-10, LUV, S-15, T-15, Sonoma, Datsun/Nissan Pickup, P'up, Mazda Pickup, Toyota Pickup, Mitsubishi Pickup)
- (31) Large Pickup (Jeep Pickup, Comanche, Ram Pickup, D100-D350, W100-W350, F100-F350, C10-C35, K10-K35, R10-R35, V10-V35, Silverado, Sierra, R100-R500,)

- (32) Pickup with slide-in camper
- (33) Convertible pickup
- (39) Unknown pickup style light conventional truck type

# Other Light Trucks (≤ 4,500 kgs GVWR)

- (40) Cab chassis based (includes rescue vehicles, light stake, dump, and tow truck)
- (41) Truck based panel
- (42) Light truck based motorhome (chassis mounted)
- (45) Other light conventional truck type
- (48) Unknown light truck type
- (49) Unknown light vehicle type (automobile, utility, van, or light truck)

# OTHER VEHICLES

## Buses (Excludes Van Based)

- (50) School bus (designed to carry students, not cross country or transit)
- (58) Other bus type (e.g., transit, intercity, bus based motorhome) (specify):
- (59) Unknown bus type

# Medium/Heavy Trucks (> 4,500 kgs GVWR)

- (60) Step van (> 4,500 kgs GVWR)
- (61) Single unit straight truck (4,500 kgs < GVWR ≤ 8,850 kgs)
- (62) Single unit straight truck (8,850 kgs < GVWR ≤ 12,000 kgs)
- (63) Single unit straight truck (> 12,000 kgs GVWR)
- (64) Single unit straight truck, GVWR unknown
- (65) Medium/heavy truck based motorhome
- (67) Truck-tractor with no cargo trailer
- (68) Truck-tractor pulling one trailer
- (69) Truck-tractor pulling two or more trailers
- (70) Truck-tractor (unknown if pulling trailer)
- (78) Unknown medium/heavy truck type
- (79) Unknown truck type (light/medium/heavy)

# Motored Cycles (Does Not Include All-Terrain Vehicles/Cycles)

- (80) Motorcycle
- (81) Moped (motorized bicycle)
- (82) Three-wheel motorcycle or moped
- (88) Other motored cycle (minibike, motorscooter) (specify):
- (89) Unknown motored cycle type

# Other Vehicles

- (90) ATV (All-Terrain Vehicle) and ATC (All-Terrain Cycle)
- (91) Snowmobile
- (92) Farm equipment other than trucks
- (93) Construction equipment other than trucks
- (97) Other vehicle type
- (99) Unknown body type

Nat	ional Accident Sampling System-Crashwort	thiness Da	ta System: General Vehicle Form	Page
	OCCUPANT RELATED		24. Rollover	
16	<ul><li>Driver Presence in Vehicle</li><li>(0) Driver not present</li><li>(1) Driver present</li><li>(9) Unknown</li></ul>	_1_	(0) No rollover (no overturning)  **Rollover (primarily about the longitudinal axis (1) Rollover, 1 quarter turn only (2) Rollover, 2 quarter turns	<u>\$</u> s)
17	<ul> <li>Number of Occupants This Vehicle (00-96) Code actual number of occupants for this vehicle (97) 97 or more</li> </ul>	<u>φ2</u>	(3) Rollover, 3 quarter turns (4) Rollover, 4 or more quarter turns (specification)	y):
18	(99) Unknown  Number of Occupant Forms Submitted	<u>φ</u> Z	<ul><li>(5) Rolloverend-over-end (i.e., primarily about the lateral axis)</li><li>(9) Rollover (overturn), details unknown</li></ul>	
	<b>VEHICLE WEIGHT ITEMS</b>		OVERRIDE/UNDERRIDE (THIS VEHICL	.E)
19	Code weight to nearest	<u>4 B</u> 0		1
	10 kilograms. (045) Less than 450 kilograms (610) 6,100 kilograms or more		26. Rear Override/Underride (this Vehicle)	4
	(999) Unknown	· aa	(0) No override/underride, or not an end-to-end impact	٠
	Source:	-	Override (see specific CDC) (1) 1st CDC (2) 2nd CDC	
20.	Vehicle Cargo Weight Code weight to nearest 10 kilograms. (000) Less than 5 kilograms (450) 4,500 kilograms or more	<u></u> 0	(3) Other not automated CDC (specify):	
	(999) Unknown lbs X .4536 =, k	gs -	(4) 1st CDC (5) 2nd CDC (6) Other not automated CDC (specify):	
21.	RECONSTRUCTION DATA Towed Trailing Unit	Φ	(7) Medium/heavy truck or bus override (9) Unknown	
	(0) No towed unit (1) Yes—towed trailing unit (9) Unknown		HEADING ANGLE AT IMPACT FOR HIGHEST DELTA V	
	Documentation of Trajectory Data for This Vehicle (0) No (1) Yes	<u>Φ</u>	Values: (000)-(359) Code actual value (997) Noncollision (998) Impact with object (999) Unknown	
	Post Collision Condition of Tree or Pole (For Highest Delta V) (0) Not collision (for highest delta V) with	φ_	27. Heading Angle For This Vehicle 2 Ø	Ø
	tree or pole (1) Not damaged (2) Cracked/sheared (3) Tilted <45 degrees (4) Tilted ≥45 degrees (5) Uprooted tree (6) Separated pole from base (7) Pole replaced (8) Other (specify):		28. Heading Angle For Other Vehicle <u> 夕                                  </u>	<u>φ</u> _
	(9) Unknown			
				- 1

	Cate- gory	Configur-	ACCIDENT TYPES (Includes Intent) BEST AVAILABLE COPY
160-7	-	A. Right Roadside Departure	DRIVE OFF CONTROL/ ROAD TRACTION LOSS WITH VEH BED AND SPECIFICS SPECIFICS
高 高 器	I. Single Driver	B. Left Roadside Departure	OFF CONTROL/ ROAD TRACTION LOSS WITH VEH., PED., ANIM. OTHER UNKNOWN  OFF CONTROL/ TRACTION LOSS WITH VEH., PED., ANIM. OTHER UNKNOWN
		C Forward Impact	PARKED VEH. STA. OBJECT PEDESTRIAN/ END SPECIFICS SPECIFICS
ş.	Trafficway Direction	I) Rear-End	20 22 24 26 28 30 (EACH • 32) (EACH • 33)  STOPPED SLOWER DECEL. 31 SPECIFICS SPECIFICS
	II. Same Trafficwa Same Direction	f: Forward Impact F:	CONTROL/ TRACTION LOSS  OTHER  UNKNOWN  40  LEACH • 42) [EACH • 43]  AVOID COLLISION WITH OBJECT  OTHER  UNKNOWN  AVOID COLLISION SPECIFICS OTHER  UNKNOWN  AVOID COLLISION WITH OBJECT  OTHER  UNKNOWN
		Sideswipe Angle	44 45 45 (EACH • 48) (EACH • 49) SPECIFICS OTHER SPECIFICS UNKNOWN
	uento Se t	G Head-On	50 51 (EACH • 52) (EACH • 53)  SPECIFICS OTHER SPECIFICS UNKNOWN
8 88.38	Same Trafficway Opposite Direction	H Forward Impact	54 55 56 57 58 59 60 61 (EACH • 62) (EACH • 63)  CONTROL/ TRACTION LOSS TRACTION LOSS WITH VEH.  SECURITIES SPECIFICS SPECIFICS OTHER UNKNOWN
	111	l. Sideswipe <sup>,</sup> Angle	65 (EACH • 66) (EACH • 67)  SPECIFICS SPECIFICS UNKNOWN  LATERAL MOVE . OTHER
	Trafficuay Turning	J. Turn Across Path	69 71 70 73 72 INITIAL OPPOSITE INITIAL SAME DIRECTIONS SPECIFICS SPECIFICS OTHER UNKNOWN
	IV. Change ' Vehicle '	K. Turn Into Path	77 79 81 (EACH • 84) (EACH • 85)  TURN INTO SAME DIRECTION TURN INTO OPPOSITE DIRECTIONS  SPECIFICS SPECIFICS
	V Intersecting Paths (Vehicle Damage)	L. Straight Paths	87 (EACH • 90)  88 89 SPECIFICS SPECIFICS UNKNOWN  OTHER
	VI. Miscel- lancous	M. Backing Eic.	92 93 CID OTHER VEH. OR OBJECT SACKING VEH. 98 Other Accident Type 99 Unknown Accident Type 00 No Impact

29. Basis for Total Delta V (highest)	Highest
<ul> <li>Delta V Calculated</li> <li>(1) CRASH program—damage only routine</li> <li>(2) CRASH program—damage and trajectory routine</li> <li>(3) Missing vehicle algorithm</li> <li>Delta V Not Calculated</li> <li>(4) At least one vehicle (which may be this vehicle) is beyond the scope of an acceptable reconstruction program, regardless of collision conditions.</li> <li>(5) All vehicles within scope (CDC applicable) of CRASH program but one of the collision conditions is beyond the scope of the CRASH program or other acceptable reconstruction technique, regardless of adequacy of damage data.</li> <li>(6) All vehicle and collision conditions are within scope of one of the acceptable reconstruction programs, but there is insufficient data available.</li> </ul>	32. Lateral Component of Delta V 9 9 9
COMPUTER GENERATED DELTA V  Highest  30. Total Delta V  Nearest kph (highest)  Nearest kph (secondary)	34. Confidence In Reconstruction Program Results (For Highest Delta V)  (0) No reconstruction (1) Collision fits model — results appear reasonable (2) Collision fits model — results appear high (3) Collision fits model — results appear low (4) Borderline reconstruction — results appear reasonable
(NOTE: 000 means less than 0.5 kph) (160) 159.5 kph and above (999) Unknown	35. Type of Vehicle Inspection (0) No inspection (1) Complete inspection (2) Partial inspection (specify):  PHOTOS ONLY
31. Longitudinal Component of + Delta V - 9 9 9  Nearest kph (highest)  Nearest kph (secondary)  (NOTE:000 means greater than -0.5 kph and less than +0.5 kph) (±160) ±159.5 kph and above (999) Unknown	36. Is this an AOPS Vehicle?  (0) No  (1) Yes - researcher determined  (2) VIN determined air bag system  (3) VIN determined automatic (passive) belts  (4) VIN determined air bag and automatic (passive) belts
IS OLDMISS APPLICABLE FOR T	HIS VEHICLE? ['] YES [ ] NO

IF YES: IS A COMPLETED OLDMISS PROGRAM SUMMARY INCLUDED? [ /YES [ ] NO

191 188

:::::

Traditional Accident Sampling System-Crashworthiness Date	3 System: General Vehicle Form	Pag
37. Police Reported Other Drug Presence (0) No other drug(s) present (1) Yes [other drug(s) present] (7) Not reported (8) No driver present (9) Unknown  38. Police Reported Drug Evaluation Classification (DEC) Test For Driver (0) No DEC process available or given (1) DEC process given, results known (2) DEC process given, results unknown (3) DEC process available, unknown if given (8) No driver present  39. Other Drug Specimen Test Type For Driver (0) No specimen test given (1) Blood test (2) Urine test (3) Other specimen tests (specify):  (7) Unspecified specimen test (8) No driver present (9) Unknown if specimen test given	DRUG EVALUATION CLASSIFICA OTHER DRUGS TEST RESULTS FOR DRI  DEC STEST Results Narcotic Drug 40. \$\phi\$ 40. \$\	TION VER  Specimen Test Results 1. φ. 3. φ. 5. φ. 7. φ. 9. ψ. 1. φ. 3. φ. 55. φ. 7. φ. 9. φ. 1. φ. 3. φ. 5. φ. 7. φ. 9. φ. 1. φ. 3. φ. 5. φ. 7. φ. 9. φ. 1. φ. 3. φ. 5. φ. 7. φ. 9. φ. 1. φ. 3. φ. 5. φ. 7. φ. 9. φ. 1. φ. 3. φ. 5. φ. 7. φ. 9. φ. 1. φ. 3. φ. 1. φ. 3. φ. 1.

# CODES FOR ROLLOVER INITIATION OBJECT CONTACTED

(00) No rollover	(57) Fence
(01-30) — Vehicle Number	(58) Wall
Noncollision	(59) Building
	(60) Ditch or culvert
(31) Turn-over — fall-over	(61) Ground
(33) Jackknife	(62) Fire hydrant
Collinian Mich Fire d Ott	(63) Curb
Collision With Fixed Object	(64) Bridge
(41) Tree (≤ 10 cm in diameter)	(68) Other fixed object (specify):
(42) Tree (> 10 cm in diameter)	, ,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,
(43) Shrubbery or bush	(69) Unknown fixed object
(44) Embankment	
(AE) Baselianus	Collision with Nonfixed Object
(45) Breakaway pole or post (any diameter)	(71) Motor vehicle not in-transport
lonbrookerrar Deleger B	(76) Animal
Ionbreakaway Pole or Post	(77) Train
(50) Pole or post (≤ 10 cm in diameter)	(78) Trailer, disconnected in transport
(51) Pole or post (> 10 cm but ≤ 30 cm in	(79) Object fell from vehicle in-transport
diameter)	(88) Other nonfixed object (specify):
(52) Pole or post (> 30 cm in diameter)	the object topoonly).
(53) Pole or post (diameter unknown)	(89) Unknown nonfixed object
IEAN Comments to III	
(54) Concrete traffic barrier	(98) Other event (specify):
(55) Impact attenuator	
(56) Other traffic barrier (includes guardrail)	(99) Unknown event or object
(specify):	

....

-

OTHER DATA	04 6 11
56. Driver's Zip Code	61. Rollover Initiation Object Contacted φ φ
(00000) Driver not present (00001) Driver not a resident of U.S. or territories Code actual 5-digit zip code (99999) Unknown	62. Location on Vehicle Where Initial Principal Tripping Force Is Applied  (0) No rollover (1) Wheels/tires
57. Driver's Race/Ethnic Origin (0) Driver not present (1) White (non-Hispanic) (2) Black (non-Hispanic) (3) White (Hispanic) (4) Black (Hispanic) (5) American Indian, Eskimo or Aleut (6) Asian or Pacific Islander (8) Other (specify): (9) Unknown  58. Vehicle Special Use (This Trip) (0) No special use (1) Taxi (2) Vehicle used as school bus (3) Vehicle used as other bus (4) Military (5) Police (6) Ambulance	(2) Side plane (3) End plane (4) Undercarriage (5) Other location on vehicle (specify):  (8) Non-contact rollover forces (specify): (9) Unknown  63. Direction of Initial Roll  (0) No rollover (1) Roll right - primarily about the longitudinal axis (2) Roll left - primarily about the longitudinal axis (5) End-over-end (i.e., primarily about the lateral axis) (9) Unknown roll direction
(7) Fire truck or car (8) Other (specify): (9) Unknown  ROLLOVER DATA	PRECRASH DATA  64. Pre-Event Movement (Prior to Recognition of Critical Event)
If GV07 (Body Type) ≠ 1-49, leave GV59-GV63 blank. If GV24 (Rollover) = 0, then GV59-GV63 must equal 0. If GV24 = 9, then GV59-GV63 must equal 9.	<ul> <li>(01) Going straight</li> <li>(02) Slowing or stopping in traffic lane</li> <li>(03) Starting in traffic lane</li> <li>(04) Stopped in traffic lane</li> <li>(05) Passing or overtaking another vehicle</li> </ul>
59. Rollover Initiation Type  (0) No rollover (1) Trip-over (2) Flip-over (3) Turn-over (4) Climb-over (5) Fall-over (6) Bounce-over (7) Collision with another vehicle (8) Other rollover initiation type specify):  (9) Unknown rollover initiation type	(06) Disabled or parked in travel lane (07) Leaving a parking position (08) Entering a parking position (09) Turning right (10) Turning left (11) Making a U-turn (12) Backing up (other than for parking position) (13) Negotiating a curve (14) Changing lanes (15) Merging (16) Successful avoidance maneuver to a previous critical event (97) Other (specify):
(0) No rollover (1) On roadway (2) On shoulder—paved (3) On shoulder—unpaved (4) On roadside or divided trafficway median (9) Unknown	(98) No driver present (99) Unknown

#### PRECRASH DATA (Continued) 98 65. Critical Precrash Event Pedestrian or Pedalcyclist, or Other Nonmotorist (80) Pedestrian in roadway This Vehicle Loss of Control Due To: (81) Pedestrian approaching roadway (01) Blow out or flat tire (82) Pedestrian—unknown location (02) Stalled engine (83) Pedalcyclist or other nonmotorist in roadway (03) Disabling vehicle failure (e.g., wheel fell off) (specify): (specify): (84) Pedalcyclist or other nonmotorist approaching (04) Non-disabling vehicle problem (e.g., hood flew roadway (specify):\_ up) (specify): (85) Pedalcyclist or other nonmotorist—unknown (05) Poor road conditions (puddle, pot hole, ice, etc.) location (specify): (specify): (06) Traveling too fast for conditions Object or Animal (08) Other cause of control loss (specify): (87) Animal in roadway (88) Animal approaching roadway (09) Unknown cause of control loss (89) Animal-unknown location (90) Object in roadway This Vehicle Traveling (91) Object approaching roadway (10) Over the lane line on left side of travel lane (92) Object—unknown location (11) Over the lane line on right side of travel lane (12) Off the edge of the road on the left side (98) Other critical precrash event (specify): (13) Off the edge of the road on the right side TRAVEL ON WRONG SIDE ROADWAY (14) End departure (99) Unknown (15) Turning left at intersection (16) Turning right at intersection (17) Crossing over (passing through) intersection For Corrective Actions Attempted see variable GV14 (19) Unknown travel direction (Attemped Avoidance Manuever) Other Motor Vehicle In Lane (50) Stopped 66. Precrash Stability After Avoidance Maneuver (51) Traveling in same direction with lower speed (0) No avoidance maneuver (i.e., lower steady speed or decelerating) (52) Traveling in same direction with higher speed (1) Tracking (53) Traveling in opposite direction (2) Skidding longitudinally—rotation less than 30 (54) In crossover (55) Backing (3) Skidding laterally—clockwise rotation (59) Unknown travel direction of other motor vehicle (4) Skidding laterally—counterclockwise rotation (7) Other vehicle loss-of-control (specify): Other Motor Vehicle Encroaching Into Lane (8) No driver present (60) From adjacent lane (same direction) - over left (9) Precrash stability unknown lane line (61) From adjacent lane (same direction)—over right lane line 67. Precrash Directional Consequences of (62) From opposite direction—over left lane line Avoidance Maneuver (Corrective Action) (63) From opposite direction—over right lane line (0) No avoidance maneuver (64) From parking lane (1) Vehicle stayed in travel lane where avoidance (65) From crossing street, turning into same maneuver was initiated direction (66) From crossing street, across path (2) Vehicle stayed on roadway but left travel lane (67) From crossing street, turning into opposite where avoidance maneuver was initiated direction (3) Vehicle stayed on roadway, not known if left (68) From crossing street, intended path not known travel lane where avoidance maneuver was (70) From driveway, turning into same direction initiated (71) From driveway, across path (4) Vehicle departed roadway (72) From driveway, turning into opposite direction (5) Avoidance maneuver initiated off roadway (73) From driveway, intended path not known (8) No driver present (74) From entrance to limited access highway (9) Directional consequences unknown (78) Encroachment by other vehicle-details unknown

\*\*\* IF THE CDS APPLICABLE VEHICLE WAS NOT INSPECTED (I.E., GV35 = 0), \*\*\* DO NOT COMPLETE THE EXTERIOR AND INTERIOR VEHICLE FORMS.

\*\*\* IF GV07 DOES NOT EQUAL 01-49, DO NOT COMPLETE \*\*\*
THE EXTERIOR VEHICLE, INTERIOR VEHICLE,
OCCUPANT ASSESSMENT, AND OCCUPANT INJURY FORMS.

iational High Administratio	nway Traffic Safety n	E	XTERIO	R VE	HICLE	FORM	M NATI	ONAL AC	CCIDENT WORTHIN	SAMPLIN ESS DAT	IG SYS
1. Prima	ary Sampling Unit I	Number			3. Veh	icle Num	ber				\$ /
2. Case	Number - Stratum		1 B Z	3							<u> </u>
	,		VEHICLE	IDEN	TIFICA	TION					
VIN 9	9999	9 9	9 9 9	9	9 9	9 9	9	9	Model	Year _6	3 /
Vehicle M	lake (specify):			- <del></del> -	<del></del>				1ALIB		
				LOCAT			, opcomy	·	.,,,,,,	<u>~</u>	
ocate th	e end of the damag	ge with respo				al cente	r line or	bumper	corner	for end	impact
	Impact No.		n of Direct I	Damage		<del></del>		Location	of Field	j L	<del></del>
<del>-</del> ,	/ 4	L.F. COR	NER								
<del></del>							<del></del>			<del></del>	
		CRI	JSH PROF	FILE IN	CENT	IMETE	RS				
	Free space value is the individual C loc side taper, etc. Re	cord the value	necessary to	C-measi	urement	and ma	r lead, b iximum	umper 1 crush.	body co taper, sid	ntour ta de protr	ken at usion,
pecific mpact	Plane of Impact	Direct Width	Damage Max	Field			T				
lumber	C-Measurements	(CDC)	Crush	L	C <sub>1</sub>	C <sub>2</sub>	C <sub>3</sub>	C₄	C <sub>5</sub>	C <sub>6</sub>	±D
				<del>                                     </del>			-	<u> </u>			
		·									
<del></del>					-						
						i	i	- 1	i	ı	

. .:::

等 汉, 心

....

\*\*:-:-

63. 483 381


HS Form 435A (Rev. 1/94)

TIRE—WHEEL DA  a. Rotation physically restricted	
RF 2 LF T RR 2 LR 1	RF 2 LF 2 RR 2 LR 2
(1) Yes (2) No (8) N	A (9) Unk.
TYPE OF TRANSMI	SSION
☐ Manual ☐ Aut	tomatic


-::::

#### **ORIGINAL SPECIFICATIONS** (108.3) Wheelbase cm Overall Length (142.5) cm Maximum Width (17.4) cm Curb Weight 3258 kg Average Track cm 90 Front Overhang cm '24 Rear Overhang cm **Undeformed End Width** NA cm Engine Size: cyl./displ. L

**VEHICLE DAMAGE SKETCH** 

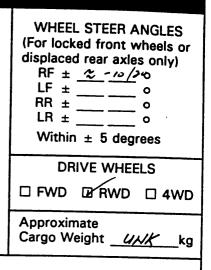

## **MEASUREMENTS IN CENTIMETERS**

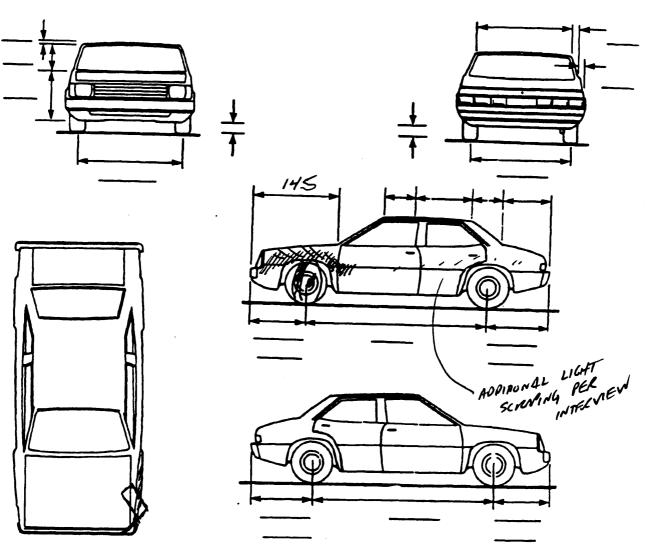

: Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page.

Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.

(4) (4)

	ccident Sampl			WORKSH			Verlicle For	m 	Pa
				R OBJECT CO					
(01-30	) — Vehicle Ni	umber				Fence			
Noncol	lision					Wall			
	Overturn — r	edle				Buildin			
	Fire or explos						or culvert		
(32)	Jackknife	sion				Ground			
				(	62)	Fire hy	rdrant		
(34)	Other intraun	iit damage (spe	BCITY):			Curb			
(25)	Nancelliaine :	F-10-11-11-11-11-11-11-11-11-11-11-11-11-		(	64)	Bridge			
(38)	Noncollision i Other noncoll	injury lision (specify)	:				fixed object		
(39)	Noncollision -	- details unkn	own		69)	Unkno	wn fixed ob	ject	
				Col	lisio	n with N	Nonfixed Ob	ioot	
Collisio	n With Fixed C	)bject		001	71)	Motor	vehicle not	in-transport	
(41)	Tree (≤ 10 c	m in diameter)	İ	ì	72)	Pedest	rian	in-transport	
(42)	Tree (> 10 c	m in diameter)	ı				or cycle		
(43)	Shrubbery or	bush		ï	741	Other r	or cycle	or conveyar	
(44)	Embankment			•	• • •	Other 1	iomiotorist	or conveyar	ice
				C	75)	Vehicle	occupant		
(45)	Breakaway po	ole or post (an	y diameter)	Ċ	76)	Animal	Coodpant		
						Train			
Nonbre	akaway Pole o	r Post					disconnecto	ed in transpo	
(50)	Pole or post (	≤ 10 cm in di	ameter)	$\ddot{c}$	79)	Object	fell from vel	hicle in-trans	)
(51)	Pole or post (	> 10 cm but	≤ 30 cm in	is	381	Other n	onfived obj	ect (specify)	port
	diameter)			,,	,,	O tiloi II	ionnixed obji	ect (specify)	•
(52) (53)	Pole or post (	> 30 cm in di diameter unkno	ameter) own)	(8	39)	Unknov	vn nonfixed	object	
	Concrete traff		·	(9	8)	Other e	vent (specif	y):	
(55)	Impact attenua	ator							_
(56)	Other traffic b	ator parrier (include:	s guardrail)	(9	19)	Unknow	vn event or	object	<del></del>
	(specify):								
		255000							
		DEFORM	ATION CLASS	SIFICATION I	BY E	VENT N	NUMBER		
<b>A</b> = =!=!						(4)	(5)		
Accident Event		(1) (2)	•	•	S	pecific	Specific	(6)	
Sequence	Object	Direction of Force	Incremental	(3)		gitudinal	Vertical or	Type of	(7)
Number	Contacted	(degrees)	Value of Shift	Deformation		Lateral	Lateral	Damage	Deformation
			Shire	Location	Lo	cation	Location	Distribution	Extent
A 1									

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force (degrees)	Incremental Value of Shift	(3) Deformation Location	(4) Specific Longitudinal or Lateral Location	(5) Specific Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
φ 1	4 1	14	<u> </u>	F	1	E	E	Φ 6
					-			
	<del></del>							
					<del></del>			
				-	<del></del>			
							-	
					<del></del>	<del></del>		

ः -जु

::: ::: ::::

ं है। | क्यू

		COLLISION	1 DEFORMA	TION CLAS	SIFICATIO	N	
HIGHEST D	ELTA "V"						
Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u> </u>	5. <u>4</u> 1	61	7. <u>F</u>	8. <u> </u>	9. <u>E</u>	10. <u>É</u>	11
Second High	hest Delta "V	•					
12	13	14	15	16	17	18	19
		CRUS	H PROFILE	IN CENTIMI	ETERS		
Т	he crush prof in the appro	ile for the dam	nage described pelow. (ALL M	in the CDC(s) s	boug should b	e documented TIMETERS.)	i .
HIGHEST DE	ELTA "V"						
20. 	21. 			C <sub>4</sub>	C <sub>5</sub>	2	2. 
Second High	est Delta "V"		<del></del>				<del></del>
23. 	24. 			C <sub>4</sub> (	C <sub>5</sub> C	25 	5. ±D
26. Are CDCs D but Not Cod Automated (0) No (1) Yes	led on The	<u>中</u> (0) (1)	searcher's Asses Vehicle Dispositi Not towed due vehicle damage Towed due to vehicle damage Unknown	to I	near (999) Unk	ode to the rest centimeter nown	
				<u> </u>	_ inches X 2.54	= <u>273</u> cen	timeters

. . . . .

- ::

ı						_ · ug
40	). Location of Fuel System-1 Leakage			44. Is 7	This Vehicle Equipped With More Than	4
4	. Location of Fuel System-2 Leakage		4		o Fuel Tanks? No (one or two tanks only)	
İ	(0) No fuel tank			'''	to tone of two tanks only)	
ı	(1) No fuel leakage			Yes	s - More Than Two Tanks	
				(1)	Yes no damage to any tank or filler	
İ	Primary Area Of Leakage			'''	cap and no fuel system leakage	
	(2) Tank			(2)	Yes no damage to any tank or filler	
ı	(3) Filler neck			,,	cap but there is fuel system leakage	
ŀ	(4) Cap				(specify leakage location):	
1	(5) Lines/pump/filter				topoony leakage location).	
	(6) Vent/emission recovery			(3)	Yes damage to an additional tank or	
1	(8) Other (specify):			'0'	filler cap and there is fuel system leakage	
1					(specify the following):	<u>e</u>
1	(9) Unknown			ł	Type of tank	
1				1	Type of tank Tank location	
				]	Tank location	
42	. Fuel Type-1	4	1		Filler cap location	_
					Tank damage Location of leakage	
43	. Fuel Type-2	4	4		Type of fuel	
1				(9)	Type of fuel	
l	Single Fuel Type			\ \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	Chikhowh ii more than two tanks	
1	(00) No fuel tank			i		•
	(01) Gasoline					
ł	(02) Diesel				COMMENTS	
1	(03) CNG (Compressed Natural Gas)				COMMEN 12	
	(04) LPG (Liquid Petroleum Gas) also					
1	known as Propane					
	(05) LNG (Liquid Natural Gas)					
İ	(06) Methanol (M100 or M85)			· <del></del>		_
l	(07) Ethanol (E100 or E85)					
	(08) Other (Hydrogen or others) (specify):					_
			_			
	Electric Powered or Electric/Solar					_
	Powered Vehicles	-	ļ			_
	(10) Lead Acid Battery		İ			
	(11) Nickel-Iron Battery		- 1			_
	(12) Nickel-Cadmium Battery		1			
	(13) Sodium Metal Chloride Battery		į			_
	(14) Sodium Sulfur Battery		ı			
	(18) Other (Specify):					-
	(98) Other Hybrid (specify):					-
			-	-		_
	(99) Unknown fuel type					
						-
**	STOP IE THE COS ADDITION DE LA					

\*\*\* STOP: IF THE CDS APPLICABLE VEHICLE WAS NOT TOWED AND WAS NOT AN AOPS \*\*\*
(I.E., GV09=0 OR 9 AND GV36=0), DO NOT COMPLETE THE INTERIOR VEHICLE FORM.

**National Highway Traffic Safety** 

100

## Form Approved

# OCCUPANT ASSESSMENT FORM NATIONAL ACCIDENT SAMPLING SYSTEM

NATIONAL ACCIDENT SAMPLING SYS	T
OCCUPANT'S SEATING	T
10. Occupant's Seat Position	_
(11) Left side	
(13) Right side	
(14) Other (specify):	
Second Seat (21) Left side (22) Middle (23) Right side (24) Other (specify): (25) On or in the lap of another occupant	
Third Seat (31) Left side (32) Middle (33) Right side (34) Other (specify): (35) On or in the lap of another occupant	
Fourth Seat (41) Left side (42) Middle (43) Right side (44) Other (specify): (45) On or in the lap of another occupant (97) In or on unenclosed area (98) Other seat (specify): (99) Unknown	
11. Occupant's Posture 9 (0) Normal posture	
Abnormal posture  (1) Kneeling or standing on seat (2) Lying on or across seat (3) Kneeling, standing or sitting in front of seat (4) Sitting sideways or turned to talk with another occupant or to look out a rear window (5) Sitting on a console (6) Lying back in a reclined seat position (7) Bracing with feet or hands on a surface in front of seat (8) Other abnormal posture (specify):  (9) Unknown	
	OCCUPANT'S SEATING  10. Occupant's Seat Position Front Seat (11) Left side (12) Middle (13) Right side (14) Other (specify): (15) On or in the lap of another occupant  Second Seat (21) Left side (22) Middle (23) Right side (24) Other (specify): (25) On or in the lap of another occupant  Third Seat (31) Left side (32) Middle (33) Right side (34) Other (specify): (35) On or in the lap of another occupant  Fourth Seat (41) Left side (42) Middle (43) Right side (44) Other (specify): (45) On or in the lap of another occupant  (97) In or on unenclosed area (98) Other seat (specify): (99) Unknown  11. Occupant's Posture (0) Normal posture  Abnormal posture (1) Kneeling or standing on seat (2) Lying on or across seat (3) Kneeling, standing or sitting in front of seat (4) Sitting sideways or turned to talk with another occupant or to look out a rear window (5) Sitting on a console (6) Lying back in a reclined seat position (7) Bracing with feet or hands on a surface in front of seat (8) Other abnormal posture (specify):

EJE	CTION/E	NTRAPMENT
12. Ejection (0) No ejection (1) Complete ejection (2) Partial ejection (3) Ejection, unknown degree (9) Unknown		<ul> <li>15. Medium Status (Immediately Prior To Impact) Φ</li> <li>(0) No ejection</li> <li>(1) Open</li> <li>(2) Closed</li> <li>(3) Integral structure</li> <li>(9) Unknown</li> </ul>
13. Ejection Area (0) No ejection (1) Windshield (2) Left front (3) Right front (4) Left rear (5) Right rear (6) Rear (7) Roof (8) Other area (e.g., back of pickup, etc.) (specify): (9) Unknown	φ	16. Entrapment (NOTE: Entrapped means that part of the person was in the vehicle and mechanically restrained; jammed doors and immobilizing injuries by themselves are not sufficient to constitute entrapment.) (0) Not entrapped (1) Entrapped (9) Unknown
14. Ejection Medium (0) No ejection (1) Door/hatch/tailgate (2) Nonfixed roof structure (3) Fixed glazing (4) Nonfixed glazing (specify):  (5) Integral structure (8) Other medium (specify):  (9) Unknown	<b>•</b>	
	<b>1</b>	

•

ः - अक्ष

	RESTRAINT	rsys	TEM EVALUATION	
	<ul> <li>17. Manual (Active) Belt System Availability</li> <li>(0) None available</li> <li>(1) Belt removed/destroyed</li> <li>(2) Shoulder belt</li> <li>(3) Lap belt</li> <li>(4) Lap and shoulder belt</li> <li>(5) Belt available—type unknown</li> </ul>	4	21. Air Bag System Availability/Function (0) Not equipped/not available (1) Air bag  Non-functional (2) Air bag disconnected (specify):	<u> </u>
	Integral Belt Partially Destroyed (6) Shoulder belt (lap belt destroyed/removed) (7) Lap belt (shoulder belt destroyed/removed)		(3) Air bag not reinstalled (9) Unknown	
	(8) Other belt (specify): (9) Unknown		22. Air Bag System Deployment     (0) Not equipped/not available     (1) Air bag deployed during accident (as a result of impact)	φ
	18. Manual (Active) Belt System Use (00) None used, not available, or belt removed/destroyed (01) Inoperative (specify): (02) Shoulder belt (03) Lap belt (04) Lap and shoulder belt (05) Belt used—type unknown (08) Other belt used (specify):	4	(2) Air bag deployed inadvertently just prior to accident (3) Air bag deployed, accident sequence undetermined (4) Nondeployed (5) Unknown if deployed (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical) (9) Unknown	·
	<ul> <li>(12) Shoulder belt used with child safety seat</li> <li>(13) Lap belt used with child safety seat</li> <li>(14) Lap and shoulder belt used with child safety seat</li> <li>(15) Belt used with child safety seat—type unknown if belt used</li> <li>(18) Other belt used with child safety seat (specify):</li> <li>(99) Unknown if belt used</li> </ul>	own	23. Are There Indications of Air Bag System Failure? (0) Not equipped/not available (1) No (2) Yes (specify): (9) Unknown	<u>ø</u>
1	<ul> <li>9. Proper Use of Manual (Active) Belts</li> <li>(0) None used or not available</li> <li>(1) Belt used properly</li> <li>(2) Belt used properly with child safety seat</li> </ul>	9	Note: See Variables 44 through 48 (Page 5) for Information on Automatic Belts	
	<ul> <li>Belt Used Improperly</li> <li>(3) Shoulder belt worn under arm</li> <li>(4) Shoulder belt worn behind back or seat</li> <li>(5) Belt worn around more than one person</li> <li>(6) Lap belt worn on abdomen</li> <li>(7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify):</li> <li>(8) Other improper use of manual belt system (specify):</li> <li>(9) Unknown</li> </ul>		24. Police Reported Restraint Use  (0) None used (1) Police did not indicate restraint use (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt (5) Belt used, type not specified (6) Child safety seat (7) Other or automatic restraint (specify):	4
20	O. Manual (Active) Belt Failure Modes During Accident (O) No manual belt used (1) No manual belt failure(s) (2) Torn webbing (stretched webbing not . included) (3) Broken buckle or latchplate (4) Upper anchorage separated (5) Other anchorage separated (specify): (6) Broken retractor (7) Combination of above (specify):	1	(8) Restrained, type unknown (9) Police indicated "unknown"	
	(8) Other manual belt failure (specify): (9) Unknown			
		ı		

	HEAD RESTRAINT A	ND SEAT EVALUATION
at T (0) (1) (2) (3) (4) (5) (6) (8) (9) (02) (03) (04) (05) (06) (07) (08) (09) (10)	d Restraint Type/Damage by Occupant his Occupant Position No head restraints Integral—no damage Integral—damaged during accident Adjustable—no damage Adjustable—damaged during accident Add-on—no damage Add-on—damaged during accident Other (specify):  Unknown  Type (this Occupant Position) Occupant not seated or no seat Bucket Bucket with folding back Bench Bench with separate back cushions Bench with folding back(s) Split bench with folding back(s) Pedestal (i.e., column supported) Other seat type (specify):  Box mounted seat (i.e., van type) Unknown	27. Seat Performance (this Occupant Position) (0) Occupant not seated or no seat (1) No seat performance failure(s) (2) Seat adjusters failed (3) Seat back folding locks or "seat back" failed (specify): (4) Seat track/anchors failed (5) Deformed by impact of occupant (6) Deformed by passenger compartment intrusion (specify):  (7) Combination of above (specify): (8) Other (specify): (9) Unknown

		CHILL	سنيد			
28.	Child Safety Seat Make/Model (000) No child safety seat Applicable codes are found in your NASS Data Collection, Coding and Editing (950) Built-in child safety seat (997) Other make/model (specify):	S CDS	<u>φ</u> S		Seat Harness Usage Seat Shield Usage	<u></u> \$ \$
-	(998) Unknown make/model (999) Unknown if child safety seat used	<u> </u>				<u> </u>
30.	Type of Child Safety Seat  (0) No child safety seat  (1) Infant seat  (2) Toddler seat  (3) Convertible seat  (4) Booster seat  (7) Other type child safety seat (specify):  (8) Unknown child safety seat type  (9) Unknown if child safety seat used  Child Safety Seat Orientation  (00) No child safety seat  Designed for Rear Facing for This Age/We  (01) Rear facing  (02) Forward facing  (08) Other orientation  Designed For Forward Facing for This Age  (11) Rear facing  (12) Forward facing	_4 'eight	-	Not Designed (01) After madded, (02) After madded, (03) Child sa harness, (09) Unknow added o  Designed Witt (11) Harness, (12) Harness, (19) Unknow Unknown If D (21) Harness, (22) Harness, (29) Unknow (29) Unknow (21)	d With Harness/Shield/Tethenarket harness/shield/tethenot used harket harness/shield/tethenarket harness/shield/tethenarket seat used, but no after shield/tether added which if harness/shield/tether	er used ter market used ield/Tether
() ,, () ()	(18) Other orientation (specify):  (19) Unknown orientation  Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight  (21) Rear facing (22) Forward facing (28) Other orientation (specify):					
(:	99) Unknown if child safety seat used					

		- age
INJURY CONSEQUENCES		38. Working Days Lost 9 9
34. Injury Severity (Police Rating)	φ	Code the number of days
, , , , , , , , , , , , , , , , , , , ,	<u> </u>	(up through 60) that the occupant
(0) O - No injury		lost from work due to the accident
(1) C - Possible injury		(00) No working days lost
(2) B - Nonincapacitating injury		(61) 61 days or more
(3) A - Incapacitating injury		(62) Fatally injured
(4) K - Killed		(97) Not working prior to accident (99) Unknown
(5) U - Injury, severity unknown		(99) OHKHOWH
(6) Died prior to accident (9) Unknown		
(5) Unknown		STOP - GO TO VARIABLE 44 ON PAGE 7
35. Treatment - Mortality	A.	VARIABLES 39 THROUGH 43 ARE
(0) No treatment	4_	COMPLETED BY THE ZONE CENTER
(1) Fatal		
(2) Fatal - ruled disease (specify):		39. Time to Death
		39. Time to Death  Code number of hours from time of
		accident to time of death up through 24
Nonfatal		hours. If time of death is greater than 24
(3) Hospitalization		hours, code number of days. (Note: 1 day =
(4) Transported and released		31, 2 days = 32, n days = 30 + n up
<ul><li>(5) Treatment at scene - nontransported</li><li>(6) Treatment later</li></ul>		through 30 days = 60)
(8) Treatment - other (specify):		(00) Not fatal
(o) Treatment - other (specify):		(96) Fatal - ruled disease
(9) Unknown		(99) Unknown
36. Type Of Medical Facility (for Initial Treatment) (0) Not treated at a medical facility (1) Trauma center (2) Hospital (3) Medical clinic (4) Physician's office (5) Treatment later at medical facility (8) Other (specify): (9) Unknown  37. Hospital Stay (00) Not Hospitalized  Code the number of days (up through 60) that the occupant stayed in hospital. (61) 61 days or more (99) Unknown	4	<ul> <li>40. 1st Medically Reported Cause of Death</li></ul>
•	-	43. Number of Recorded Injuries for This Occupant Code the actual number of injuries recorded for this occupant. (00) No recorded injuries (97) Injured, details unknown (99) Unknown if injured

ः • अ

AUTOMATIC BELT SYSTEM	rage
44. Automatic (Passive) Belt System Availability/ Function (0) Not equipped/not available (1) 2 point automatic belts (2) 3 point automatic belts (3) Automatic belts - type unknown  Non-functional (4) Automatic belts destroyed or rendered inoperative (9) Unknown  45. Automatic (Passive) Belt System Use (0) Not equipped/not available/destroyed or rendered inoperative (1) Automatic belt in use (2) Automatic belt in use (manually disconnected, motorized track inoperative) (specify):  (3) Automatic belt use unknown (9) Unknown  46. Automatic (Passive) Belt System Type (0) Not equipped/not available (1) Non-motorized system (2) Motorized system (9) Unknown	48. Automatic (Passive) Belt Failure Modes During Accident (0) Not equipped/not available/not in use (1) No automatic belt failure(s) (2) Torn webbing (stretched webbing not included) (3) Broken buckle or latchplate (4) Upper anchorage separated (5) Other anchorage separated (specify): (6) Broken retractor (7) Combination of above (specify): (8) Other automatic belt failure (specify): (9) Unknown  49. Seat Orientation (this Occupant Position) (0) Occupant not seated or no seat (1) Forward facing seat (2) Rear facing seat (3) Side facing seat (inward) (4) Side facing seat (outward) (8) Other (specify): (9) Unknown
47. Proper Use of Automatic (Passive) Belt System (0) Not equipped/not available/not used (1) Automatic belt used properly (2) Automatic belt used properly with child safety seat  Automatic Belt Used Improperly (3) Automatic shoulder belt worn under arm (4) Automatic shoulder belt worn behind back (5) Automatic belt worn around more than one person (6) Lap portion of automatic belt worn on abdomen (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): (8) Other improper use of automatic belt system (specify): (9) Unknown	Check the Primary Source Used In Determining Belt Use.  [ ] Not equipped/not available/destroyed or rendered inoperative [ ] Vehicle inspection [ ] Official injury data [ ] Driver/occupant interview [ ] Other (specify):  PAR [ ] Unknown if belt used
ARE ALL APPLICABLE MEDICAL RECORD WITH INITIAL SUBMISSION?	OS INCLUDED NO[] YES[]
UPDATE CANDIDATE?	NO[] YES[]

Nati	lational Accident Sampling System-Crashworthiness Date			
ST CC	TOP - VARIABLES 50 THROUGH 53 AR OMPLETED BY THE ZONE CENTER	Œ		
	TRAUMA DATA			
	Glasgow Coma Scale (GCS) Score (at Medical Facility) (00) Not injured (01) Injured - not treated at medical facility (02) No GCS Score at medical facility (03-15) Code the actual value of the initial GCS Score recorded at medical facility. (97) Injured, details unknown (99) Unknown if injured	4		
51.	Was the Occupant Given Blood? (1) No - blood not given (2) Yes - blood given (specify units): (9) Unknown if blood given			
	Arterial Blood Gases (ABG) – HCO <sub>3</sub> $\phi$ (00) Not injured (01) Injured, ABGs not measured or reported (02-50) Code the actual value of theHCO <sub>3</sub> (96) ABGs reported, HCO <sub>3</sub> unknown (97) Injured, details unknown (99) Unknown if injured	4		

## BELT USE DETERMINATION

- 53. Primary Source of Belt Use Determination
  (0) Not equipped/not available/destroyed or rendered inoperative
  (1) Vehicle inspection
  (2) Official injury data
  (3) Driver/occupant interview
  (8) Other (specify): PAK
  (9) Unknown if belt used

43-1-.

.

BEST AVAILABLE COPY

Form Approved

: Safety

OCCUPANT ASSESSMENT FORM NATIONAL ACCIDENT SAMPLING SYSTEM

Primary Sampling Unit Number	OCCUPANT'S SEATING
2. Case Number - Stratum ABZ3	10. Occupant's Seat Position / 3
3. Vehicle Number $\psi$ Z	Front Seat (11) Left side
<del></del>	(12) Middle
4. Occupant Number	(13) Right side (14) Other (specify):
OCCUPANT'S CHARACTERISTICS	(15) On or in the lap of another occupant
5. Occupant's Age Code actual age at time of accident. (00) Less than one year old (specify by month):  (97) 97 years and older (99) Unknown  6. Occupant's Sex (1) Male (2) Female (9) Unknown	Second Seat (21) Left side (22) Middle (23) Right side (24) Other (specify): (25) On or in the lap of another occupant  Third Seat (31) Left side (32) Middle (33) Right side (34) Other (specify): (25)
7. Occupant's Height Code actual height to the nearest centimeter. (999) Unknowninches X 2.54 = centimeters	(35) On or in the lap of another occupant  Fourth Seat (41) Left side (42) Middle (43) Right side (44) Other (specify): (45) On or in the lap of another occupant (97) In or on unenclosed area (98) Other seat (specify): (99) Unknown
8. Occupant's Weight Code actual weight to the nearest kilogram. (999) Unknown  — pounds X .4536 = kilograms  9. Occupant's Role (1) Driver (2) Passenger (9) Unknown	11. Occupant's Posture (0) Normal posture  Abnormal posture (1) Kneeling or standing on seat (2) Lying on or across seat (3) Kneeling, standing or sitting in front of seat (4) Sitting sideways or turned to talk with another occupant or to look out a rear window (5) Sitting on a console (6) Lying back in a reclined seat position (7) Bracing with feet or hands on a surface in front of seat (8) Other abnormal posture (specify):  **ELEE** (9) Unknown
	İ

EJEC	CTION/E	NTRAPMENT	Page 2
12. Ejection (0) No ejection (1) Complete ejection (2) Partial ejection (3) Ejection, unknown degree (9) Unknown	Φ	15. Medium Status (Immediately Prior To Impact) (0) No ejection (1) Open (2) Closed (3) Integral structure (9) Unknown	φ
13. Ejection Area (0) No ejection (1) Windshield (2) Left front (3) Right front (4) Left rear (5) Right rear (6) Rear (7) Roof (8) Other area (e.g., back of pickup, etc.) (specify): (9) Unknown	4	16. Entrapment (NOTE: Entrapped means that part of th person was in the vehicle and mechanicall restrained; jammed doors and immobilizing injuries by themselves are not sufficient to constitute entrapment.) (0) Not entrapped (1) Entrapped (9) Unknown	y
14. Ejection Medium (0) No ejection (1) Door/hatch/tailgate (2) Nonfixed roof structure (3) Fixed glazing (4) Nonfixed glazing (specify):  (5) Integral structure (8) Other medium (specify):	-		

....

-::::

		TEM EVALUATION	
Manual (Active) Belt System Availability (0) None available (1) Belt removed/destroyed (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt	4	21. Air Bag System Availability/Function (0) Not equipped/not available (1) Air bag  Non-functional	4
Integral Belt Partially Destroyed  (6) Shoulder belt (lap belt destroyed/removed)  (7) Lap belt (shoulder belt destroyed/removed)		(2) Air bag disconnected (specify):  (3) Air bag not reinstalled (9) Unknown	
·		22. Air Bag System Deployment (0) Not equipped/not available (1) Air bag deployed during accident (as a	<u> </u>
(00) None used, not available, or belt removed/destroyed (01) Inoperative (specify): (02) Shoulder belt (03) Lap belt (04) Lap and shoulder belt (05) Belt used—type unknown (08) Other belt used (specify):	4	(2) Air bag deployed inadvertently just prior to accident (3) Air bag deployed, accident sequence undetermined (4) Nondeployed (5) Unknown if deployed (6) Air bag deployed as a result of a noncollisic event during accident sequence (e.g., fire, explosion, electrical) (9) Unknown	on
<ul> <li>13) Lap belt used with child safety seat</li> <li>14) Lap and shoulder belt used with child safety seat</li> <li>15) Belt used with child safety seat—type unknown (specify):</li> </ul>	own	23. Are There Indications of Air Bag System Failure? (0) Not equipped/not available (1) No (2) Yes (specify):	φ
O) None used or not available  1) Belt used properly	9	(9) Unknown  Note: See Variables 44 through 48 (Page 5) for Information on Automatic Belts	
3) Shoulder belt worn under arm 4) Shoulder belt worn behind back or seat 5) Belt worn around more than one person 6) Lap belt worn on abdomen 7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): 8) Other improper use of manual belt system (specify):		24. Police Reported Restraint Use (0) None used (1) Police did not indicate restraint use (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt (5) Belt used, type not specified (6) Child safety seat (7) Other or automatic restraint (specify):	4
No manual belt used No manual belt used No manual belt failure(s) Torn webbing (stretched webbing not included) Broken buckle or latchplate Upper anchorage separated Other anchorage separated (specify):  Broken retractor Combination of above (specify):	1	(8) Restrained, type unknown (9) Police indicated "unknown"	
	(0) None available (1) Belt removed/destroyed (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt (5) Belt available—type unknown  Integral Belt Partially Destroyed (6) Shoulder belt (lap belt destroyed/removed) (7) Lap belt (shoulder belt destroyed/removed) (8) Other belt (specify): (9) Unknown  Manual (Active) Belt System Use (00) None used, not available, or belt removed/destroyed (01) Inoperative (specify): (02) Shoulder belt (03) Lap belt (04) Lap and shoulder belt (05) Belt used—type unknown (08) Other belt used with child safety seat (13) Lap belt used with child safety seat (14) Lap and shoulder belt used with child safety seat (15) Belt used with child safety seat (15) Belt used with child safety seat (15) Belt used with child safety seat (15) Belt used with child safety seat (18) Other belt used with child safety seat (199) Unknown if belt used  Proper Use of Manual (Active) Belts (1) None used or not available (2) Belt used properly (3) Shoulder belt worn under arm (4) Shoulder belt worn under arm (5) Belt used properly with child safety seat (5) Belt worn around more than one person (6) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): (6) Other improper use of manual belt system (specify): (7) Unknown  Inanual (Active) Belt Failure Modes (1) No manual belt failure(s) (2) Torn webbing (stretched webbing not	(1) None available (1) Belt removed/destroyed (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt (5) Belt available—type unknown Integral Belt Partially Destroyed (6) Shoulder belt (lap belt destroyed/removed) (7) Lap belt (shoulder belt destroyed/removed) (8) Other belt (specify): (9) Unknown  Manual (Active) Belt System Use (00) None used, not available, or belt removed/destroyed (01) Inoperative (specify): (02) Shoulder belt (03) Lap belt (04) Lap and shoulder belt (05) Belt used—type unknown (06) Other belt used with child safety seat (101) Lap belt (102) Lap belt used with child safety seat (113) Lap belt used with child safety seat (114) Lap and shoulder belt used with child safety seat (115) Belt used with child safety seat (116) Belt used with child safety seat (117) Belt used with child safety seat (118) Lap belt used with child safety seat (119) Unknown if belt used (119) Unknown if belt used (120) None used or not available (131) Belt used properly (141) Shoulder belt worn under arm (152) Belt used properly with child safety seat (153) Shoulder belt worn behind back or seat (154) Belt used properly (155) Belt worn on abdomen (156) Belt worn on abdomen (157) Shoulder belt worn under arm (158) Shoulder belt worn behind back or seat (159) Belt worn on abdomen (159) Shoulder belt worn under arm (150) Shoulder belt worn behind back or seat (151) Belt worn on abdomen (150) Shoulder belt worn under arm (150) Shoulder belt worn under arm (151) Belt worn on abdomen (150) Shoulder belt worn under arm (151) Shoulder belt worn under than one person (151) Belt worn on abdomen (151) Belt worn on abdomen (151) Belt worn on abdomen (151) Belt worn on abdomen (151) Belt worn on abdomen (151) Belt worn on abdomen (151) Belt worn on abdomen (151) Belt worn on abdomen (151) Belt worn on abdomen (159) Shoulder belt worn behind back or seat (150) Belt worn on abdomen (150) Shoulder belt worn behind back or seat (151) Belt worn on abdomen (151) Belt worn on abdomen (151) Belt worn on abdomen (151) Belt worn on abdome	(i) None available   (ii) Not equipped/mot available   (ii) Not equipped/mot available   (iii) None available

	a System. Occupant Assessment Form	Page ·
HEAD RESTRAINT AN	D SEAT EVALUATION	
25. Head Restraint Type/Damage by Occupant at This Occupant Position  (0) No head restraints (1) Integral—no damage (2) Integral—damaged during accident (3) Adjustable—no damage (4) Adjustable—damaged during accident (5) Add-on—no damage (6) Add-on—damaged during accident (8) Other (specify):  (9) Unknown  26. Seat Type (this Occupant Position) (00) Occupant not seated or no seat (01) Bucket (02) Bucket with folding back (03) Bench (04) Bench with separate back cushions (05) Bench with folding back(s) (06) Split bench with separate back cushions (07) Split bench with folding back(s) (08) Pedestal (i.e., column supported) (09) Other seat type (specify):  (10) Box mounted seat (i.e., van type) (99) Unknown	27. Seat Performance (this Occupant Position) (0) Occupant not seated or no seat (1) No seat performance failure(s) (2) Seat adjusters failed (3) Seat back folding locks or "seat back" fa (specify): (4) Seat track/anchors failed (5) Deformed by impact of occupant (6) Deformed by passenger compartment intr (specify):  (7) Combination of above (specify): (8) Other (specify): (9) Unknown	

andr 1676 Lister

:

	CHILD SA	AFETY SEAT
	Child Safety Seat Make/Model  (000) No child safety seat  Applicable codes are found in your NASS CDS  Data Collection, Coding and Editing  (950) Built-in child safety seat	31. Child Safety Seat Harness Usage $\phi$ $\phi$ 32. Child Safety Seat Shield Usage $\phi$ $\phi$
	(997) Other make/model (specify):  (998) Unknown make/model (999) Unknown if child safety seat used	33. Child Safety Seat Tether Usage  Note: Options below applicable to Variables OA31-OA33.  (00) No child safety seat
30. () () () () () () () () () () () () () (	Type of Child Safety Seat  (0) No child safety seat  (1) Infant seat  (2) Toddler seat  (3) Convertible seat  (4) Booster seat  (7) Other type child safety seat (specify):  (8) Unknown child safety seat type  (9) Unknown if child safety seat used  Child Safety Seat Orientation  (00) No child safety seat  Child Safety Seat Orientation  (00) No child safety seat  Designed for Rear Facing for This Age/Weight  (01) Rear facing  (02) Forward facing  (08) Other orientation (specify):  (09) Unknown orientation  Designed For Forward Facing for This Age/Weight  11) Rear facing  12) Forward facing  13) Other orientation (specify):  19) Unknown orientation  Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight  21) Rear facing  22) Forward facing  23) Other orientation (specify):  24) Unknown orientation  25) Unknown orientation	Not Designed With Harness/Shield/Tether (01) After market harness/shield/tether added, not used (02) After market harness/shield/tether used (03) Child safety seat used, but no after market harness/shield/tether added (09) Unknown if harness/shield/tether added or used  Designed With Harness/Shield/Tether (11) Harness/shield/tether not used (12) Harness/shield/tether used (19) Unknown if harness/shield/tether used  Unknown If Designed With Harness/Shield/Tether (21) Harness/shield/tether not used (22) Harness/shield/tether used (29) Unknown if harness/shield/tether used (99) Unknown if child safety seat used

\*\*\*

	IN HIPV CONSEQUENCES			ray
	INJURY CONSEQUENCES	38. Working Days Lost	9	9
34.	Injury Severity (Police Rating)	Code the number of days	-/	
	(0) O - No injury	(up through 60) that the occupant lost from work due to the accident		
	(1) C - Possible injury	(00) No working days lost		
	(2) B - Nonincapacitating injury	(61) 61 days or more		
	(3) A - Incapacitating injury	(62) Fatally injured		
	(4) K - Killed	(97) Not working prior to accident		
	(5) U - Injury, severity unknown	(99) Unknown		
	(6) Died prior to accident (9) Unknown		*********	
	(5) CHRIOWII	STOP - GO TO VARIABLE 44 ON PA	GE	7
		WARIABIES SO TUROUS.		
35.	Treatment - Mortality 9	VARIABLES 39 THROUGH 43 ARE COMPLETED BY THE ZONE CENTER		
	(0) No treatment	ODM: CELED DI LUE SOME CEMIEN		
	(1) Fatal (2) Fatal - ruled disease (specify):			
	(2) I didi - I died disease (specity):	39. Time to Death	Φ	4
		Code number of hours from time or	f	
	Nonfatal	accident to time of death up through 24	_	
	(3) Hospitalization	hours. If time of death is greater than 2 hours, code number of days. (Note: 1 d	4	
	(4) Transported and released	31, 2 days = 32, n days = 30 +n u	ay =	
	<ul><li>(5) Treatment at scene - nontransported</li><li>(6) Treatment later</li></ul>	through 30 days $= 60$ )	P	
	(8) Treatment - other (specify):	(00) Not fatal		
	•	(96) Fatal - ruled disease (99) Unknown		
	(9) Unknown	(99) Ohknown		
36. <sup>-</sup>	Type Of Medical Facility (for Initial Treatment)	40. 1st Medically Reported Cause of Death	¢	4
	(0) Not treated at a medical facility			
(	1) Trauma center	41. 2nd Medically Reported Cause of Death	<u>q</u>	<u>\$</u>
	(2) Hospital	42. 3rd Medically Reported Cause of Death	1	1.
	3) Medical clinic 4) Physician's office	Code the Occupant Injury from line	4	<u>v</u>
Ò	5) Treatment later at medical facility	number(s) for the medically reported		
(	8) Other (specify):	injury(s) which reportedly contributed to		
		this occupant's death		
(	9) Unknown	<ul><li>(00) Not fatal or no additional causes</li><li>(96) Mode of death given but specific</li></ul>		
		injuries are not linked to cause		
37. F	Hospital Stay	of death. (specify):		
	00) Not Hospitalized			
_	Code the number of days (up through 60)	(97) Other result (includes fatal ruled		
t	hat the occupant stayed in hospital.	disease) (specify):		
()	61) 61 days or more 99) Unknown	(99) Unknown		
	- Chikhowii			
	·	43. Number of Recorded Injuries for		
	-	This Occupant	<b>\$</b> 9	ı
		Code the actual number of	<u> </u>	
		injuries recorded for this occupant.		
		(00) No recorded injuries (97) Injured, details unknown		
		(99) Unknown if injured		

	44. Automatic (Passive) Belt System Availability/ Function (0) Not equipped/not available (1) 2 point automatic belts (2) 3 point automatic belts (3) Automatic belts - type unknown  Non-functional (4) Automatic belts destroyed or rendered inoperative (9) Unknown  45. Automatic (Passive) Belt System Use (0) Not equipped/not available/destroyed or	48. Automatic (Passive) Belt Failure Modes During Accident (0) Not equipped/not available/not in use (1) No automatic belt failure(s) (2) Torn webbing (stretched webbing not included) (3) Broken buckle or latchplate (4) Upper anchorage separated (5) Other anchorage separated (specify):  (6) Broken retractor (7) Combination of above (specify): (8) Other automatic belt failure (specify):
4	rendered inoperative  (1) Automatic belt in use (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify):  (3) Automatic belt use unknown (9) Unknown  6. Automatic (Passive) Belt System Type (0) Not equipped/not available (1) Non-motorized system (2) Motorized system (9) Unknown	49. Seat Orientation (this Occupant Position) (0) Occupant not seated or no seat (1) Forward facing seat (2) Rear facing seat (3) Side facing seat (inward) (4) Side facing seat (outward) (8) Other (specify): (9) Unknown
4	7. Proper Use of Automatic (Passive) Belt System (0) Not equipped/not available/not used (1) Automatic belt used properly (2) Automatic belt used properly with child safety seat  Automatic Belt Used Improperly (3) Automatic shoulder belt worn under arm (4) Automatic shoulder belt worn behind back (5) Automatic belt worn around more than one person (6) Lap portion of automatic belt worn on abdomen (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): (8) Other improper use of automatic belt system (specify): (9) Unknown	Check the Primary Source Used In Determining Belt Use.  [ ] Not equipped/not available/destroyed or rendered inoperative [ ] Vehicle inspection [ ] Official injury data [ ] Driver/occupant interview [ ] Other (specify):
	ARE ALL APPLICABLE MEDICAL RECORD WITH INITIAL SUBMISSION?	OS INCLUDED NO[] YES[]
	UPDATE CANDIDATE?	NO[] YES[]

STOP - VARIABLES 50 THROUGH 53 COMPLETED BY THE ZONE CENTER	AFI	E	
TRAUMA DATA			
50. Glasgow Coma Scale (GCS) Score (at Medical Facility) (00) Not injured (01) Injured - not treated at medical facility (02) No GCS Score at medical facility (03-15) Code the actual value of the initial GCS Score recorded at medical facility. (97) Injured, details unknown (99) Unknown if injured	Φ	4	
51. Was the Occupant Given Blood? (1) No - blood not given (2) Yes - blood given (specify units): (9) Unknown if blood given		_	
62. Arterial Blood Gases (ABG) – HCO <sub>3</sub> (00) Not injured (01) Injured, ABGs not measured or reported (02-50) Code the actual value of theHCO <sub>3</sub> (96) ABGs reported, HCO <sub>3</sub> unknown (97) Injured, details unknown (99) Unknown if injured	<u>4</u> .	4	

## BELT USE DETERMINATION

- Primary Source of Belt Use Determination
   Not equipped/not available/destroyed or rendered inoperative
   Vehicle inspection
   Official injury data
   Driver/occupant interview
   Other (specify): PAK
   Unknown if belt used 8

AIRBAG VEHICLE INSPECTION

## **ACCIDENT SUMMARY**

1.	Accident Date: FALL / We	EEKDAY	10.	Date Vehicle Inspected:	<b>P</b>
2.	Police Investigated (1) Yes (2) No (3) Unknown  Agency: City: County:		11.	Reason Vehicle Not Inspected (0) Not Required (1) Inspection Completed (2) Cannot be Located (3) Repaired or Destroyed (5) Refusal or Impounded (7) Other:	1
3.	General Locality (1) Freeway, Limited Access (2) Urban (City) (3) Urban-Rural (mixed) (4) Rural, Fields	4	12.	Impact Data Obtained (0) No Data Obtained (1) CDC Only (2) Crush Profile Only	4
4.	Configuration (First Harm) (0) Struck Object or Ped (1) Rear-End (2) Head-On (3) Rear-to-Rear (4) Angle	a	12	<ul> <li>(3) Trajectory Data Only</li> <li>(4) CDC and Crush Profile</li> <li>(5) CDC and Trajectory</li> <li>(6) Crush and Trajectory</li> <li>(7) CDC, Crush, and Trajectory</li> </ul>	
	<ul> <li>(4) Fingle</li> <li>(5) Sideswipe-Same Direction</li> <li>(6) Sideswipe-Opposite Dir.</li> <li>(7) Noncollision</li> <li>(8) Nonimpact Deployment</li> <li>(9) Unknown</li> </ul>	- <sub>-</sub>	13.	Basis of Delta-V (0) Not Computed (Unknown why) (1) CRASH - Damage Only (2) CRASH - Damage + Traj (3) OLDMISS (4) POLES	7
5.	Fire Involved (0) None (1) Airbag Vehicle (2) Other Vehicle (3) Both Vehicles (9) Unknown	Ø	VEHI	(5) Unknown Basis (6) One Vehicle Beyond Scope (7) Collision Beyond Scope (8) Insufficient Data  CLE HISTORY	
6.	Vehicles Involved	2	14.	Prior Impacts for AB Vehicle? (1) Yes (2) No (9) Unknown	2
7.	Persons Involved	4	15.	Has Any Prior Maintenance or	2
8.	Injured Persons	. 2		Service Been Performed on System (1) Yes (2) No	الجدا
9.	Maximum AIS in Accident	5		(9) Unknown	

#### AIRBAG VEHICLE 21. Airbag Vehicle First Harmful Event NONE 13 Fleet: (01) Fire or explosion INXAEØ4B5 RZXXXXXX VIN: (02) Immersion 17429 Km (10,830 mi) (03) Gas Inhalation (04) Fell from vehicle SYSTEM READINESS LAMP (05) Injured in vehicle (06) Other noncollision (specify): 16. Pre-Impact Lamp Condition (07) Overturn 9 (1) Functioning/Proved Out (08) Jackknife (2) Inoperative **COLLISION WITH:** (9) Unknown (09) Pedestrian (10) Pedalcyclist 17. Driver's Report of Pre-Impact (11) Railway train 99 Flashing (12) Animal (00) No Flashing Reported (13) Motor vehicle in transport (01) Continuous Flashing (same roadway) (14) Motor vehicle in transport Number of Flashes: (other roadway) (11)(15) Parked motor vehicle (12) Constant Light (16) Other type nonmotorist (specify): (19) Flashing, Unknown Number (17) Thrown or falling object (88) Not Applicable, System Removed (18) Boulder (99) Unknown COLLISION WITH FIXED OBJECT (20) Building Period of Pre-Impact Flashing 18. (21) Impact attenuator/crash cushion (0) No Flashing (22) Bridge pier or abutment (1) Same Day as Impact (23) Bridge parapet end (2) Prior Day (24) Bridge rail (3) Prior Two Days (25) Guardrail (4) Prior Week (26) Concrete traffic barrier (5) Prior Month (27) Median barrier (6) Over One Month (28) Other longitudinal barrier (specify): (9) Unknown (29) Highway/traffic sign post (30) Overhead sign support 19. Post-Impact Lamp Condition 9 (31) Luminaire/light support (1) Functioning/Proved Out (32) Utility pole (2) Inoperative (33) Other post, pole, or support (9) Unknown (34) Culvert (35) Curb 20. Post-Impact Flashing (36) Ditch 199 (00) No Flashing Reported (37) Embankment-earth (01) Continuous Flashing (38) Embankment-rock, stone, or concrete (02)(39) Fence Number of Flashes: (40) Wall (11)(41) Fire hydrant (12) Constant Light (42) Shrubbery (19) Flashing, Unknown Number (43) Tree (88) Not Applicable, System Removed (44) Other fixed object (specify): (99) Unknown (45) Pavement surface irregularity (99) Unknown

#### AIRBAG VEHICLE IMPACT SUMMARY FRONT BUMPER E.A.D. STATUS 22. Vehicle Role 30. 3 Left (0) Noncollision (1) Striking unit (2) Struck unit 31. Right (3) Both striking and struck (9) Unknown (1) Normal (2) Extended 23. Manner of Leaving Scene (3) Partial Compression a (1) Driven (4) Complete Compression (2) Towed-due to damage (5) Not Applicable (3) Towed-not for damage (9) Unknown (4) Towed-details unknown (5) Abandoned FIRST AIRBAG VEHICLE IMPACT: (9) Unknown 32. Configuration 2 24. Number of Impact Events (0) Struck Object or Ped (8) 8 or more (1) Rear-End (9) Unknown (2) Head-On (3) Rear-to-Rear 25. Rollover (4) Angle (0) No rollover (5) Sideswipe-Same Direction (1) First event (6) Sideswipe-Opposite Dir. (2) Subsequent event (7) Noncollision (3) Yes, Unknown event (8) Nonimpact Deployment (9) Unknown (9) Unknown 26. Override/Underride 33. CDC: 12FLEE3 3 (0) No override/underride (1) Override - 1st CDC 34. Object Contacted: 1981 CHEV. MALIBU (2) Override - Other CDC (3) Underride - 1st CDC PRIMARY/DEPLOYMENT IMPACT: (4) Underride - Other CDC (9) Unknown 35. **Event Number** AIRBAG VEHICLE DAMAGE CODES: (1) Yes, damaged 36. Total Delta-V (2) No damage (9) Unknown 37. Longitudinal Delta-V 27. Left Front Fender Damage 38. Configuration 28. Right Front Fender Damage See 32 above for codes 39. CDC: IZFLEE 3 29. Center Top of Grille Damage 40. Object Contacted: 1981 CHEV MALIBU

### AIRBAG SYSTEM DAMAGE

Left Front Sensor

### CODES:

42.

- (1) Yes, Damaged
- (2) No, Intact
- (3) Not Applicable
- (9) Unknown

41.	Airbag Module	2


- 9
- 43. Center Front Sensor 9
- 44. Right Front Sensor
- 45. Rear Cowl Sensor 9
- 46. Diagnostic Module
- 47. Wiring
- 48. Knee Diverter 3
- 49. Indication of disconnected a or loose electrical connectors


1

- 50. Condition of Deployed Bag
  - (1) Bag intact
  - (2) Split or torn
  - (3) Cut by object in impact
  - (4) Cut after accident
  - (5) Other
  - (8) NA (not deployed)
  - (9) Unknown

## DESCRIBE SYSTEM AND BAG DAMAGE:

NOTE DAMAGE AND CONTACT MARKS ON AIRBAG DIAGRAMS BELOW:

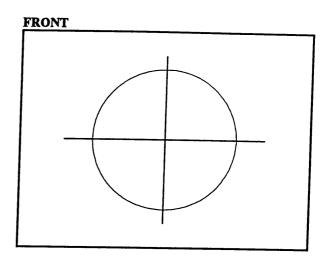

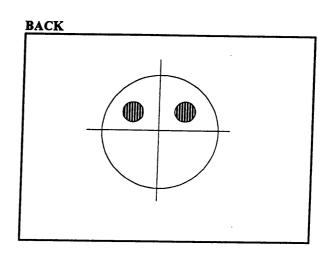

## OCCUPANTS OF AIRBAG CAR

51.	Number of Occupants in Vehicle	a	MAXIMUM AIS BY BODY REGION							
-			REGION	MAX AIS	CONTACT					
52.	Number of Injured Persons	2	Head/Neck/Face							
			Chest							
<i>5</i> 3.	Maximum AIS in Airbag Vehicle (0) No Injury	5	Abdomen		*****					
	(1-6) AIS Severity		Legs/Hips							
	<ul><li>(7) Injured, unknown severity</li><li>(9) Unknown</li></ul>		Other (Arms)	2	16					
DRIV			Driver Maximum	<u> 2.                                    </u>	16					
	Age: Q.C Sex: Female		EJECTION							
54.	Number of Driver Injuries		Extent:	NONE						
		<u>ت</u>	Portal:	NONE						
55.	Source of Best Injury Data (0) Not injured	7				_				
	(1) Autopsy (2) Hospital Medical Records		OTHER VEHICL	Æ:						
	(3) Emergency Room only (4) Private physician, clinic		Maximum AIS		Ø					
	(5) Lay Coroner Report (6) EMS Personnel (7) Interviewee		Prime/Deploy Imp Event Number	ø1	_					
	(8) Police (9) Unknown		CDC: 12 FL	EE G						
	(5) 0.122.0		Total Delta V		NA	L				
			Make: (							
	•	•	Model Ye							
			Model:	MALIBU						
			Body Type	e: 4-door						

**NOTES:** 

DRIVER BELT USAGE: (1) Used (2) Not Used (9) Unknown

1

Evidence:

DRIVER POSTURE: Any comments Recorded (1) Yes, (2) No

2

Describe driver's posture and position on seat including specific comments on head, torso, buttocks, legs, and feet. Also note hand and arm position. Did driver brace before crash? Describe:

DRIVER FOREIGN OBJECTS: Comments Recorded (1) Yes, (2) No

Z

Was driver wearing contact lenses or eyeglasses? Or holding any foreign object at the time of the impact (packages on lap, pipe, food, bottle, cigarette, etc.)? Did any lenses, objects, or jewelery play any role?:

DRIVER COMMENTS: Comments Recorded (1) Yes, (2) No

2

Was the driver aware that the vehicle was equipped with a supplemental restraint system? Did driver offer any comments on smoke, noise, etc.? Did the driver comment on the airbag as a restraint system? Describe:

PASSENGER-AIRBAG CONTACT: (1) Yes, (2) No, (9) Unknown

ユ

Describe:

### R/F OCCUPANT

### AIRBAG SYSTEM DAMAGE

CODES: (1) Yes, Damaged

- (2) No, Intact
- (3) Not Applicable
- (9) Unknown

56. Airbag Module

57. Condition of Deployed Bag

- (1) Bag intact
  - (2) Split or torn
  - (3) Cut by object in impact
  - (4) Cut after accident
  - (5) Other
  - (8) NA (not deployed)
- (9) Unknown


DESCRIBE SYSTEM AND BAG DAMAGE:

NOTE DAMAGE AND CONTACT MARKS ON AIRBAG DIAGRAMS BELOW:

**FRONT** 

SCRAPE

**BACK** 

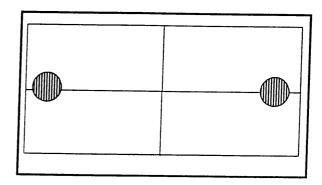

## R/F Occupant

ಾರ

Age: 3 mas.

Sex: FEMALE

58. Number of Injuries

5

59. Source of Best Injury Data

a

- (0) Not injured (1) Autopsy
- (2) Hospital Medical Records
- (3) Emergency Room only
- (4) Private physician, clinic
- (5) Lay Coroner Report
- (6) EMS Personnel
- (7) Interviewee
- (8) Police
- (9) Unknown

## MAXIMUM AIS BY BODY REGION

REGION	MAX AIS	CONTACT
Head/Neck/Face	_5_	<u>48</u>
Chest		<del></del>
Abdomen		
Legs/Hips	<del></del>	<del></del>
Other (Arms)		
Occupant Maximum	_5_	48

**EJECTION** 

Extent: NONE

Portal: Nand

....

Describe:

R/F OCCUPANT:	
R/F OCCUPANT BELT USAGE: (1) Used (2) Not Used (9) Unknown	1
Evidence:	
R/F OCCUPANT POSTURE: Any comments Recorded (1) Yes, (2) No	<u>_</u>
Describe occupant's posture and position on seat including specific comments on head, torso, buttocks, legs, and feet note hand arm position. Did occupant brace before crash? Describe:	i. Also
R/F OCCUPANT FOREIGN OBJECTS: Comments Recorded (1) Yes, (2) No	<u>2</u>
Was occupant wearing contact lenses or eyeglasses? Or holding any foreign object at the time of the impact (package) lap, pipe, food, bottle, cigarette, etc.)? Did any lenses, objects, or jewelery play any role?:	ges on
- -	
R/F OCCUPANT COMMENTS: Comments Recorded (1) Yes, (2) No	Z

Was the occupant aware that the vehicle was equipped with a supplemental restraint system? Did occupant offer any


comments on smoke, noise, etc.? Did the occupant comment on the airbag as a restraint system? Describe:

DRIVER-AIRBAG CONTACT: (1) Yes, (2) No, (9) Unknown

7								G - 114 174			TAPE MISE		COAR STOTE	PAGE	1.13
00:	idi	-Da	-a-sT	7	MANGER .	PELONY	37.1.	10	<u> </u>	***************************************			L DISTRICT LOCAL		v.a 1.3.
	217	317	NGR.	/	Z)	HIT & PURM	COUNTY	<u></u>		EPORTING DE				1000 38602	וכ באות
1.5		•				420	<u></u>				ineci .	_ =	W	- overthe	7 30. X
	COLL	MON OCC	URRED ON		<u> </u>					ــــــــــــــــــــــــــــــــــــــ	- J wa.	DAY YEAR			
rest		PA	11/4	I	PPC	12	2711	(A)	77	إند د ويدووا	ب- ا	DAY YEAR	TIME ( 2000 ),	A NCIC #	OFFICER LO.
j	MU		MATION			CH	<u> </u>	34	HEH	0 · X	DAY	OF WEEK "	MATOW AWAY W	;	
<b>Š</b>	1	الأعير	- טוגיניונטן	E TET/MILI		. eir		33	T REGUIRE	и - 9		WIFS	ENT QA	PHOTOGRAPHS BY	-
ŏ		TWISHES	HETRON WITH			FLICH LUE	P.P	71	#4.97 <b>&gt;</b> 30 /			15.11			T. LEINES
_	ذ	R: 25	523.	:( TET/ <b>(so</b> t€	<b>.</b>			_				Hermese, not	MARS. MICE	PO MET 200	SILVE STATE
YI nA	DAIVE	IT'S UCEN	E HUMBER	. P			Mid			PETY VEIL Y		TOTAL MAKE / MOD	EL/COLOR 171 hay	A LOWER TOO	MINER IN
_1	<u> </u>						USE	1	. /	1.0 8/	CH		7/200	***	in the second second
P IA	MAME	PRET, M	DOLE, LA	T)	الد (۱۱) ك	المنائد وليتراب	الر المنافقة الم	ين لاد ونها	CONTRACT ( ) I	CU10 24 14	NOL	الله والأراء الما	Par Plati		
<u>`</u>									2 3 -	1	1.20	2150m	71 72	ATTA   "1240 7/	LOO YARA
MEDER	BIRLE	TADORES	acraA;	1. 1.	<b>troos</b>	W MOSTAT	ER CARI &	Passenc	41	OWNER	TE NAME JOEN	ntania 2.	FAME AS DRIVER		A vo seen a ve
A 10	-						,			<u>.j</u>	•	बार एस अपन्	MOD E GOV	<u> </u>	
	11.75		73		A TOTAL		A THE PARTY	STORES			ABORESS	THE REAL PROPERTY.	OHC CONVER	STATE OF	2 2 3 4 C 7 C
MCY. 7	-; 9EX	= E-MAI		ra >   -	POHT - W	mourr: I	deritana del	Area	خاسب ب				the state of the s		a Chief
مي الم	1	i là s	2	2/2	<b>**</b> /		-	THOATE	YEAR !	- F	<b>表于亚维马斯 (1</b>	LE ON ORDERS OF	ASHA L		OTHER STATE
÷	HOME !	THOME HIT	MUSI H	<u> </u>	O'V'	BUSINES	B PHONE w		<u> </u>		ZIVE				TELL KST OF
						(	~	SHEET O		~1`└──	ECHANICAL DE	PECTS: CXIN	ASS NONE APPARI		FER TO NARRATIVE
===		NCE CARR			.4		POLICY	UMBER			PERCLE TYPE		EVEHCLE DAMAGE	7 2 7 7 7 7	E IN DAMAGED AREA
	1	OZZ	- K	-{}-		NEW WEN	COMST. E	KANKON )		-1-0	/	<b>           </b>		ANOR	
~ <del>.</del> ~ .		ON ST	REET OR HE	YAWH	7			CP HITTY	077	7 700	1 12 (00		non L	OTAL	The second second
1	132	PZ	WATE	EM	DPE	メフィ	-1-2/4	129070		가 ASE		1-1344 ALL			
FY.	DAIVER	CENSE	NUMBER	· Lee L				STATE C	LASS SAFE	TY VEH YEA	A	MAKE / MODEL		E LICENSE NU	MBER LEWS, IN STATE
2 -										1 94	100	/	OROUM		
VER	AWIE (I	PRETINED	OLF, LAST	ئەپىمىسەر ئەرىمىسەر	·	200	22- Jan		Falais	AWOR	7/21	FEA 2: 2CY	460 X	Cap it	
<b>_</b>	-,,	ADDRESS		<del></del>		-		· · · · · · ·	12 3	1		A BUT UR UP AND	W To Market		day of the same of the
4			3 K 1 K	<u> </u>			oci-hora teo	Em JAV		OWNERS			ME AS DRIVER		larce seriors
IK C	117/81/	ATE/2P	<del></del>	( )				. بر ادر عدد. . برادر عدد	on the contract of	OWNERS	<del> · · · · · · · · · · · · · · · · · · </del>	3.1273	ME AS DREVER		STORE STREET
≝ .  <i>;</i>	2		-			, ,						M.		THE CO	NAME OF THE PARTY
Υ	90C.	1 2 KAIR	5 EYES	HEDG	HT WE	cirr	al ATTH	DATE	y RAC		ON OF VEHICLE	ON ORDERS OF:	OFFICER	- ANNEAR -	TOTHER THE
- Z		1200	7492X	154	/3	0.12	ر د د د د د د د د د د د د د د د د د د د	-67	と一種					D24 20 20 10	2 3348
a∵ ∏ig	QME PHO	ONE U - C	대기 기	1 : 1	adain Freing	SUSPERS P	HOME AND	Marie Carlo	والمام والمام المام	PRIOR MEC	HANCAL DEFE	CT8:	NONE APPARENT	(Z)	TO MARATIVE [4]
<u> </u>		·, -	··•	<del>,</del> .	<u> </u>	()	TA GATHERA	राप्रधाव व	-+	CH	USE ONLY	DESCRIBE	EHCLE DAMAGE		N DAMAGED AREA
line.	enimic	E CYNNEI	R	<del></del>			POLICY MUN	BER :	_ <u> </u>	A ANNUAL PROPERTY IN	CLETYPE			SHOTTION OU Y	AHGLOR TO
. L	•	··	<u> </u>					. <u> </u>		101			Duran Dia	AL SA	The state of the s
	MAYEL	ON STREET	ET OR HOM	WAY .	000	Rol		(47H)	1	PUC	AMPONCE	i paganisasan	1		1 21007
7 0=	IVE TO	LICENSE M	MASS.	15/	<u>ZC)k</u>	ere y	=104 =	,		CHP		erolerun in ta		A 4.20	
		· • • • • • • • • • • • • • • • • • • •	<u> </u>					TATE CLA	EQUP.	VER YEAR		MAKE/MODEL/C			STATE
-		ST, MODIL													V
	· • · • • • • • • • • • • • • • • • • •		- · · · · · · · · · · ·	• -:	ين ي			androdie Phylogipa							· 25:00, 17=,
3 STR	EET AD	ORESS		<del></del>				****	<del></del>	OWNER'S NA	ME		AS DRIVER	<u> </u>	Z
1	7412				127.3		المراق المستعدد	- Parent State and Street			market in the second	ا	م رئيسميد ، ده سب		-3
io an	// STATE	E/21P			<b>.</b>	,		<del></del>		OWNER'S AD	ORESS	□ SAME			
_							``.	•					\$ <i>a</i> :	ool Bus	
•	EX	HAIR	EAER	HEIGHT	WEGH	п · мо.	BIRTHOA	TE, YEAR	RACE	DISPOSITION	OF VEHICLE ON	ORDERS OF:	OFACEA"	DAVER TO	THER
	18 65 5			<u>.</u>				_ <u>i</u>			:		n O'ë	er	
(	ie Phon (	`			<b>.</b> /	MMESS PHO	ME.				MCAL DEFECT	D:	NONE APPARENT	REFERTO	O TENEMATIVE
IMBU	RANCE	CARRIER					OUCY NUMBE	ta			se only Le type	DESCRIBEVE	CLE DAMAGE	SIVO E IN C	DAMAGED AREA
1							(Cample				i		NOME MINOR		
	OF 0	M STREET	OR HIGHWA		• • •	100	MED POP			ICC []	!	<u>  1</u> 111000	MAJORTOTAL	, (	▶)
	VEL					"	MATT			PUC				1	·····
A S NAM	4	_			_	- 1	1 0	SPATCH A	OTIFED	NENEWEN'S H	ME .			DATE MEVIEWED	
101 <b>-</b> 1					<u></u>	-	NA.	ES O NO	D N/A			•		•	

TRAFFIC	COLLISION	CODING					•	•			· ~
DATE OF COLUM		TBME ( 2400 )	NCIC MAMARIE			OFRCER + O	i i	4070			PAGE of
	OWNER'S NAME / ADDRESS		_L							·	
PROPERTY							••	j -			MOTIFIED
Unimade	DESCRIPTION OF DAMAGE	)						51.	- 2-		AES
SEATI	NG POSITION	T	SAF	FTV F	CU	IPMENT		<u> </u>	-		
		OCCUPANTS	, JAP			OEPLOYED	M/C RICYCLE	HEL	MET	EJECTED FR	
<b>(                                    </b>	en en en en en en en en en en en en en e	A - NONE IN VEHICLE	-		BA	A NOT DEPLOYED	DRIVER			0 - NOT EJECTED	
$\Rightarrow$		C - LAP BELT USED	7385			QUIRED	V - NO W - YES			2-PARTIALLY E	ECTED :
	DRIVER D 6 • PASSENGERS :	D - LAP BELT NOT USED E - SHOULDER HARNESS US	ED						11:21	3 - UNKNOWN	
4 5 6 7-5	STATION WAGON REAR REAR OCC. TRK. OR VAN	F SHOULDER HARNESS NO G - LAP / SHOULDER HARNE	SS USED	CHILD I		IRAINI CLE USED	PASSENGER X - NO		-	अस्य अध्यक्तिकातः	· [
3 - E	POSITION UNKNOWN	H - LAP / SHOULDER HARNES J - PASSIVE RESTRAINT USE	S NOT USED	R-INV	EHIC	LE NOT USED	Y-YES		125		٠٠٠٠٠
٠٠٠٠ الم	THER	K - PASSIVE RESTRAINT NOT		T-IN VI	EHIC	LE IMPROPER USE			-	THE PROPERTY OF	ATYRS 17
		ITEMS MARKED BELOW FO	LLOWED BY AN AS	TERISK (	• ) S	VEHICLE HOULD BE EXPLAINED	IN THE MARRAT	IVE	لــــــــــــــــــــــــــــــــــــــ	1.22	3 1
PRIMARY ST NUMBER (	COLLISION FACTOR  #) OF PARTY AT FAULT			1 2	7	7		ाँग	2		PRECEDING
A VC SECTIO			NING -	++	+	APASSENGER CAR		M .	1-	COLL	SION : 🗘
		B CONTROLS NOT FUN	CTIONING .			BPASSENGER CAR		+	V	A STOPPED	• •
	ROPER DRIVING :	C CONTROLS OBSCUR		$\Box$	oxday	C MOTORCYCLE 7-80		上		CRAN OFF ROA	
	N DRIVER	DNO CONTROLS PRES		+	+	D PICKUP OR PANEL		$\perp$	$\Box$	D MAKING RIGH	TURN -
D UNKNOWN	Li Lip.	AHEAD - ON	USION TOTAL	1 1 -	+	F TRUCK OR TRUCK		R ·	=	- E MAKING LEFT	
E FELL ASLER	P •	B SIDESWIPE		1-	$\vdash$	GTRUCK / TRUCK TR		<del>]  </del>	-;-	F MAKING U TUP GBACKING ;	
	name Care	CREAR END	James wites a summ			H SCHOOL BUS -		+	-	HSLOWING/STO	
	IARK 1.TO 2 ITEMS )		AS \$27.225		$\Box$	OTHER BUS :	1 1			-   PASSING OTHE	
ACLEAR			31	- -	口	J EMERGENCY VEHIC		F		J CHANGING LAI	<u></u>
C RAINING		GVEHICLE / PEDESTRIA			Н	K HIGHWAY CONST. E	QUIPMENT	4-4	4	K PARKING MANI	
D SNOWING -2	the star ten	HOTHER :	#21.1			MOTHER VEHICLE :		1	7	MOTHER UNSAF	
E FOG / VISIBIL		MOTOR VEHICLE INVO	LVED WITH UND			N PEDESTRAN	12 18 N 1 Ng	11	_	N XING INTO OPP	
	MA ABASIA AT TO SEE	ANON-COLLISION	: JAMET 1924)	12 14	rig	O MOPED ;		$\Box$	工	· OPARKED	YAN YTH
	KCY Series Law 18 -	B PEDESTRIAN CONTRACTOR VEHICLE			1			E	1	P MERGING NAME	
A DAYLIGHT		C OTHER MOTOR VEHICLE ON C			7	OTHER ASSOCIATED	FACTORes	X	#	Q TRAVELING WR	
B DUSK - DAW	North Action	_ E PARKED MOTOR VEHIC		1 2	3	MARK 1.TO 2	TEMS)	H	<del>.                                     </del>	ROTHER :	- 1 34
C DARK-STRE		F TRAIN	المرافق المتنابة بالمرافق المرافقة			AVC SECTION VIOLATION	: CITED	口	Ť		34114 41C3:
D DARK - NO S	ET LIGHTS NOT	G BICYCLE	1			~ \\ \\ \\ \\ \	NO	П	•	3 7 7 7 6 8	J. 17 Km
FUNC	TIONING **	H	Rimoon Trumo	+: s	E	AC SECTION ADDITION	CITED YES	Ц	4		ALC: \$3393
	Y SURFACE	FIXED OBJECT:				VC SECTION VIOLATION :	ç⊷ÿer 🗸 🔲 NO.	۱,۱	ź   3	SOBRIETY -	DRUG []
	the state that he had to	an diseas no stone	<b>₫</b>		ş li	C. 4 7 3 2 2 2 2 2 4	TYES	ا اخر		(MARK 1 TO	
C SNOWY - ICY		OTHER OBJECT:	500 P		r	)~	* □no	V)	<b></b>	AHAD NOT BEEN	
	UDDY, OILY, ETC.)					VISION OBSCUREMEN	VT: 1 - 121	$oxed{\Box}$		B HBD - UNDER INF	
ROADWAY	CONDITION(S)	· · · · · · · · · · · · · · · · · · ·	4. YTHICLEY	$\Box$		INATTENTION :: \	1		+	CHBD - NOT UNDE	
MARK Y	O2ITEMS)	PEDESTRIAN'S INV		++		STOP & GO TRAFFIC ENTERING / LEAVING	PAUD		75.	E UNDER DRUG INF	
		A NO PEDESTRIAN INVOL		1-1-		PREVIOUS COLLISION			1.	F IMPAIRMENT - PH	
	RUT * # 12 W * * * * * * * * * * * * * * * * * *	B CROSSING IN CROSSW/	W. Barll	2.		UNFAMILIAR WITH RO		- [-	· [ ·	GIMPAIRMENT NOT	
	ON ROADWAY	CROSSING IN CROSSWA			K	DEFECTIVE VEH EQU	P. L. CITED	-	1-7	H NOT APPLICABLE    SLEEPY / FATIGUE	
	N - REPAIR ZONE	C AT INTERSECTION		K   i   "		ETATE	NO	<del></del>		PECIAL INFORMATIO	
	DWAY MOTH	D CROSSING - NOT IN CRO				UNINVOLVED VEHICLE				AHAZARDOUS MAT	
OTHER :	1	E IN ROAD - INCLUDES SH		41		OTHER : : WUSAFE	SADED	L		بغيران والأراف سياري	~,
NO UNUSUAL C	ONDITIONS	F NOT IN ROAD G APPROACHING/LEAVIN	S SCHOOL BUS	KI-	-	NONE APPARENT RUNAWAY VEHICLE		$\mathcal{L}$	$\vdash \vdash$		1 1 1
4.1					יטו		CELLANEOUS	1_		ANGRES A TELE	1
-HAVATA	E-ROAD-		May L'Pamo	<u></u>				co	*-017		
•	<b>7.</b> //	/				マンギ	HOTOS			* *********************************	£ 3.50e-
جناويدية.		1 1 Janiy		<b>4</b> 7		PROCATE HORTH	•			<del>a se e con</del>	
استا م		-/	\(\\)		-3.	7.12	<b>L</b>	2 - <b>E</b> -		1 24	3
	A second of the second	(	ישוניזט אנ אין	<u>::::-} .::</u> .	<u>.</u>	رية ويرود <b>المسكو</b> ر		· -, -		1. ROL	<u> </u>
T 10 Mil.		7/5	181 1 10 .				<del>-</del>			وسد البيت	A PAGE
`\.	7594	THE TANK SOM SEASO	TREE	SIRA	27)	CHURTS	.:	•		1 A 127-3 27 11 -	4.1
	7 212	m ocal		אכון	. (1)	711	•			A A A A A A D I TOMANO	
		(	(100)	<b>/</b>		42. C7 Pro 1		Y) we		BIF ET 100 F14LBT 8	1.: 1
	-	\ \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	7	1		meu -		•		CONTRACTOR TO RIE	i i
2.4			PERSONAL SE	ينسار	TA:	isc     ==		-		- Line	COA.4.232
1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 -		The second of the second	Was a Company	I GAL						25-75:	1.12.24.2
1. 300 to See 1. 1. 1. 1	ra a millionian m m	Same   arether passes and	- 1 - 2 - 2 - 2			- 27					
PAGE 2 ( Per	OPI 042									٠٠٠٠ ۽ ١٠٠٠ ه	7 at 2

<u>INJUF</u>	RED / V	VITNE	SSE	S / PAS	SENGI	ERS						:.'	: .	: • •	PAGE	<b>?</b>
C Lorm				TIME CHAM		NCIC NUMBER		OFFICE	1810		NUMBER	· · · · · · · · · · · · · · · · · · ·	•			."
WITNESS	PASSENGER	. AGE	• eex	EX.	TENT OF I	NJURY ( "X" O	NE)	INJ	URED	WAS (	"X" OI	VE)	PARTY	SEAT	SAFETY	
W.Y	OMLY			PATAL NURY	SEVERE	OTHER VIRIALE INJURY	COMPLA OF PA		PASE	PEO.	SICYCUST	OTHER	NUMBER	POS.	SOUP.	EJECTED
MAME / D.O.B	ADDRESS	BMOS	F						図				2	3	丁	0
- 45	LYI TRANSPOR	TED 8Y:				AME AS	P-2	. )	-		94	•	TELEPHON	•		
DESCRIBE IN		By		ULA					<del> , `</del>	HO	SPI	TAL				
	<u> </u>	72	90	MA	*	····								<u> </u>		
	<del></del>				·····	•				-						·
=	<u></u>	15.1	_		·				T T						ME NOTIFIE	o .
L I	/ ADDRESS	1301	<u>+  </u>		141			<u> </u>				믜		3	GI	0
IN. ED ONL	Y) TRANSPORT	ED BY:				-64	FAKEN TO:		<u>,</u>	<del></del> :			<del></del> -		,	
DESCHIBE INJU	UNI ES		<u>:</u>		· · · · · · · · · · · · · · · · · · ·	<i>.</i>	· · ·				<u> </u>	<del></del>				<u> </u>
<u> </u>												<u>-                                    </u>				••
— <u>;</u> ——				•	•	•	•								<del>-</del>	·
70.1		22	n									☐ vici	M OF VIOL	ENT CRIM	E NOTIFIED	
<u> </u>	400RE34	33/	-/	<u> Ш</u>	بالا	<u> </u>									<del></del>	•
HURED ONLY)	TRANSPORTE	BY:					LKEN TO:	<u>- · · ·</u>	<del>-, -,</del>	•	· · · ·	<u>-</u>			ور ورب	of the section
SC E INJUR	WES .		·			<del></del>		·· · · · · · · · · · · · · · · · · · ·					-74.···			is is ry <mark>ak</mark> teder
· · · · · · · · · · · · · · · · · · ·				•	• .	·	<u>.</u>				<del>.</del>		·	•	• .	
	·	· - ;			•		-					7			•	i i i i i i i i i i i i i i i i i i i
7#		27 F	=				—————————————————————————————————————	- 1731		3 F	7 / [	J VICTIA	OFVIOLE	VI CHIME	NOTIFIED	O 95
WI	DORESS			E P-2	)		<u>(C</u>	1 (4)	<u> </u>	<u> </u>		TELE	PHONE	12 45 34	• भू कम्ब्रेट न	Fraire
ine Sum wa	**********	<del></del>			ANCE	TAN	CEN TO:		-	HA	50,7	<u> </u>				
CON	1 //	FINIT				LEFT	201	<u></u>		<u>, , , , , , , , , , , , , , , , , , , </u>	<i>3/- // (</i>			<del></del>		
	<i>17 =</i>	7.0							-		<del></del>					
45								·			Г	7 устім	OF VIOLEN	T CRIME N	IOTIFIED	
]#T				ПТ	П	ПП	П		7/-	IT	1   F	1	T	T		
66 / 0.0.8. / AD	ORESS			_=		· ·		<u>, — , , , , , , , , , , , , , , , , , ,</u>	<u> </u>		<u></u>	TELES	PHONE			
UR ONLY) T	RANSPORTED	BY:	-			TAKI	EN TO:									
CRIBE INJURIE	ts .										- W. L.					
*** 															i	
												VICTIM C	F VIOLENT	CRIME NO	TIPLED	
			_			<u> </u>			1							
				<u> </u>												
€ / _     AB. / AO				U. L	<u>. U I</u>							TELEP	HOME			
RED ONLY) TR	ANSPORTED &	v:		<u>U 1</u>		TAKE	N TO:					TELEPH	HONE			
E / J.B. / ADO	ANSPORTED &	v:				TAKE	n to:					TELEP	IONE			
RED ONLY) TR	ANSPORTED &	7:				TAKE	N TO:					TELEP	IONE			
NUNES	ANSPORTED E	7:		[Lanas		TAKEI		LA   REVIEWER	5 NAME				VIOLENT (		nmeo AY	7544

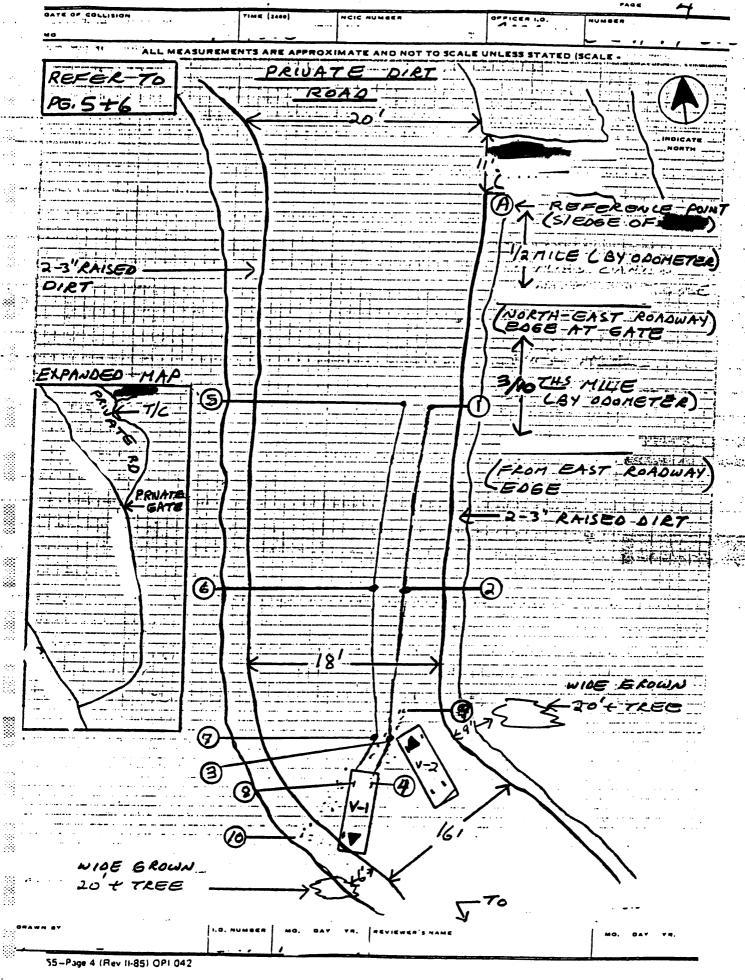

'56 (Rev 7-90)	OPI 042 -	<u>.</u>			DEST HAUTTURE COBA	ige 5						
DATE OF INCIDENT/OCC	URRENCE .	TIME (2400)	NCIC NUMBER	OFFICER LO. NUMBER	NUMBER 11	190 3						
	"X" ONE	<u>:                                    </u>	TYPE SUPPLEMENTAL	27 400 MADI CI	" (							
Narrative	Collision n	enort	BA update	Fatal								
Supplemental	Other:	•		erials School bus	Hit and run update Other:	المراجعة المواجعة المراجعة المراجعة المراجعة المراجعة المراجعة المراجعة المراجعة المراجعة المراجعة المراجعة ال المراجعة المراجعة //COUNTY/JUDICIAL D	ISTRICT	<b>411</b> ,			REPORTING DISTRICT/BEAT	CITATION NUMBE
		·	•									
OCATION/SUBJECT	Salar Salar Salar Salar	tion of all the control of the contr	•		STATE HIGHWAY RELATED	ration conserves.						
· · · · · · · · · · · · · · · · · · ·	<u>```</u>		•	· · · · · · · · · · · · · · · · · · ·	Yes	<del>∑</del> No						
1.	·	· · · · · · · · · · · · · · · · · · ·	LEGEND									
organis Selekt			•									
·	34 4											
S. (H-15)	ARTICUL	AR OR	<u> </u>	PRIVATE	DIRT ROAD	AND						
SPE	ED LIN	17 15	PPLICABLE	ALL "MEASY	REMENTS, AT	THE						
SCENE,	WERE 7	AKBU U	SITH A R.	OL- A-TAPE,	THE MARIA							
6 ALAT 7	3	= R.P=	PEFFE	NCE POINT	O A HAU							
	SCACE	<u> </u>	<u> </u>	UCE POINT	K.P. A WA	1.5						
ESTABL	15HED, 1	FROM T	4E 5/E06	E OF THE	PRIVATE PRI	ue .						
BAT		•	ASAR	EFERENCE	00/NT.							
	•	٠.	•									
VEHICLE	An. vec	- A		· · · · · · · · · · · · · · · · · · ·								
VEHICLE	POINTS		<u>es/</u>	·								
-IS RIR TO	re is izi'	5/0 "A"	AND 4 Elo	THE WIEDGE OF	THE PRIVATE D	IRT ROAD,						
V-1'S R/F	" 129°	3/0 "A"	" 2/2'w/o	· 10 · · · · · · · · /( · · · · · · / ( · · · ·	n n n n	10 11						
	graphic are in		Light parts of the									
-21545 1	1 121'	5/2 1/4 11	1. 615 : 121/2 E/0	a h	77	1						
					" 1(2 .7	2						
11-2'S 4/2 "	129 -	40 A	" 8 1/2 E/0	70 70								
PHYSICAL	EUIDE	WC F										
***												
CEFE	7ωε	SELS OF	- IMPENDIN	G SKIDMARKS	ON THE	PLET .						
ROADWAY	: R.A. + 1	<u>-2 = 2</u>	41, R.P. # 5	-6 = 241.								
				KIDHAKKSIR. P. "2	4 = 0010 044 -	8=801						
1-11 EET 17	Was SER	SOFCI	ing Spinak	eKS : R.P.43-4	7 - 60, KIT 6.	0-41						
· · · · · · · · · · · · · · · · · · ·	1/-	<del> </del>	- ING / SKILLIT AT	EN-3 - R.P. 7.5-7.	- 8: , K.P17	-8=4						
<u>el left</u>	8/2/0	F-DISTUR	BEO BILT	BETWEEN	THE REAL A	صلد-						
FRONT TI	KES A	7 175	POINT OF	REST	•							
epe.												
=AAIC A	F 61 466			-47-	12111 1 -	·····						
				teo over	15 h FRO	7~1						
e p. # 9	To .	R.P. VIE	)									
**************************************			<u> </u>									
			<del></del>									
*												
R'S NAME AND I.D. NU	MBER	0.	ATE REVIEW	VER'S NAME	DAT	E						
		1	!		1	1						

I ARRATIVE/SUPPLEMENTAL

1 1	RRATIVE/SUPI				<b>-</b>	•	BES	T AVAILAI	BLE COP	γ Ξ	Pag	
DATE	OF INCIDENT/OCCURREN	CE	TIME (2400)	NCIC NUM	86A	OFFICER I	D. NUMBER	NUI	4BER	7.7	- Pag	6
	ľ	ONE Collision re		□ BA u	PLEMENTAL (X pdate urdous materi	☐ Fata		<u></u> 🗆	Other:	run updat		TION NUMBER
LOCA	TION/SUBJECT	renime Meriman		··· ·· · · · · · · · · · · · · · · · ·				STAT	E HIGHW	AY RELATED		
_ ‡			5Y''!	• ••••••••••••••••••••••••••••••••••••	<u></u>	•			Yes _		Zł	No .
	PHYSICAL			ECC					<u></u>	<u> </u>		•••
	2.P. # 15 21	1 1	<u>ىدر ''A''.</u>	IB SIDE,	& 17'E	10 THE	W/EDG	E OF	THE	PRIVAT	TE DIA	et roa
	A'2 " 45		"A" N	18 SIDE,	11 14' E	/o //	- /1	<u> </u>	· (	11	"	<b>/</b> .
	P. 43 " 117			ILA SIDE,			ereten.	· · · · · · · · · · · · · · · · · · ·		<u></u>	• • • • • • • • • • • • • • • • • • • •	//
	44 6 14	S/6		A SIDE,					- //	1		
	P'S 21'	2/67		A SIDE,								
	. <b>r. 6</b> 43	- 2/o "		LA SIDE,					- 11			
	P. 7 111	5/0 "		le SIDE,		Elo !!	· · · · · · · · · · · · · · · · · · ·	<u></u>	12	16	11	"
	A+8 "_121'	5/0 17		LA SIDE,	., _,	Elo. (			//	- 10	16	"
	P. 9 " 110" P. 10 " 124"	5/0 "/	۸ ر <del>ا</del>	ILA SIDE		5/0	<u> </u>			98 (1)	//	// ~
1 .	P."10 " 124"	70 /	1 , W//	KAISED DIRT	r, 12 /2	W/0			· · · · ·			<u> </u>
2.		<u> </u>	<u></u>		<u> </u>	<u> </u>		=:		• • •		
3.:: <u> </u>					<u> </u>	· · · · · · · · · · · · · · · · · · ·	<u>.</u>			<u></u>	·.	20)
4			<u> </u>		<u> </u>			<u> </u>	-	*	<u></u>	
<u>.                                    </u>	<del></del>	<u> </u>			<u> </u>	<u> </u>		· · · · · ·		A Section	\$1. 1444 .TA	
,	<u> </u>				-		· · ·	·•			• • •	· :
<u>.                                    </u>				<u> </u>		•			<u> </u>	<u> </u>	<u> </u>	
<b>-</b> []-		•	<u> </u>		<del></del>	<u> </u>			<u>.</u> .	•		
• 175		•	•						-· <u>-</u>	<u>.</u>		
<b>-</b> :-	. •			•			<del></del>			<u> </u>		
· ※			· · ·	·		•	· ·	<del></del>				· · · · · · · · · · · · · · · · · · ·
			······································				<del></del>	···				
445				·								
_***_									<del></del>	<del></del>		
	· · · · · · · · · · · · · · · · · · ·			<del></del>			-	··········		<del></del>		
::- ::::::::::::::::::::::::::::::::				••••				·				
-::-					· · · · · · · · · · · · · · · · · · ·	<del></del>	•					
14. 14.												
*1* <b>7</b> *1			_				<del></del>					
334 334	S NAME AND I.D. NUMBER											

IA IRATIVE/SU HF 356 (Rev 7-90) O	PI 042				EST AVAILABLE COPY .	Page 7
PATE OF INCIDENT/OCCUR	RENCE	TIME (2400)	NCIC NUMBER	OFFICER LD. NUMBER	NUMBER	19 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
rio s	"X" ONE	1 2 2	TYPE SUPPLEMENTAL CX	C APPLICABLE)		
Narrative	Collision r	• • • • • • • • • • • • • • • • • • • •	BA update	, · · 🔲 Fatal	Hit and run update	
Upplemental  TY DUNTY/JUDICIAL DIS	Other:		Hazardous mate	rials . School bus	☐ Other:	
OF SCHIPTOURIAL DIS	INC Hills Lift The	** <b>****</b> _*** <u>*</u>			REPORTING DISTRICT/BEAT	CITATION NUMBER
CATIONSUBJECT	LINE AND	rat ytg			STATE HIGHWAY RELATED	TO ALLIGN AFIN
, 11 T	• .	<u> </u>		· · · · · · · · · · · · · · · · · · ·	Yes	ØN₀
I. FACTS						
2.	•		•			
NOTIFI	CATION	1: IA	PEEIVE	A	CADIO CAL	<u></u>
DE A	1/.///	TURL	CCINENT		CALITO CAL	
1//07	- 770 0	Dieg in	TATERA	000		<del>- /</del>
· NOTOR			L RESPO	WDED FRO		
		-: IIN	IE OF C	ALL	HRS. I	
ARRIV	ED C	DN THE	T/C S	CENE AT	HX	2S
TWO.		<i>K</i>	D UNI	73,	FIK	) <u></u>
DEPT	ANI	O RESI	CUE W	PERE ON	THE SCEN	)F
UPON	MU	ARRIU	AL TI	11)45 4	BOKHT	- رگ
CIFA	12/5	11/1/1/11/	ALTER	110011 111	CIRILITI	1
1711	720	DALL	BUDI	DOCKO VI	5/5/2/1/0	
DOA	11010	UNITY ALL	2-00	RVES IN	1HE FR	IVAIL
2.	RINA	· MIL	THEA	UREITENT	-S TAKEN	) 5.
109		EIER	KOLA	TAPE ME	ETHODS.	
*-		<del>-</del>				in with the second
ALL S	PEED	S AND	MERSURE	EMEJUTS A	E APPROXIV	SOUTH
			-		/\-\-	٠
SCENE	-					•
THIS	TIC	CC1 801	21 (24)	0 1/15 7/11	A: > a=/	
0011	//C	DOAN		7 NO , 2W	AY, DIRT/A	POCE
PRIVI	7/2	RUMB	TURINITA	4/NED BY	THE'H	OME
	ER, U	DHO ZIV	ESOFF	THE ROP	90), ITU	NAS
WEL	LM	AINTA	WED.	THERE A	RE DIRT	4
_BRU	SH A	REAS	BORDE	RING THE	= MAIN	
TRA	JELL	EO 801	e TION)	OF THE	PRIVATE	:
ROAL	2. NI	SPEC	DIMI	TEN PRI	VATE PROP	2-2771
THE 7	7c 7	OOK PI	ACE IA	I A CIIL	HT CURV	15
	PE T	1/20 ) 25	2/10/50	STUR TUT	DIFOSITE	-
DIRE		1 0000	ALCES C	TO THE	OFFOSITE	00.50
- F/11 - C		30 15	7001 30	-E EACH	OTHER	MIDE

REVIEWER'S NAME

DATE

FOR NAME AND I.D. NUMBER

DATE

14 1HA IIVE/SU H: 556 (Rev 7-90) O		AL			BEST AV	AILABLE COPY	
ATE OF INCIDENT/OCCUR		TIME (2400)	NCIC NUMBER	OFFICER LD.	NUMBER	NUMBER	Page 8
_		:			•		
CI E	TONE	. •		(X. APPLICABLE)	1		
Narrative	Collision rep		BA update		•	Hit and run upo	late
OUNTY/JUDICIAL DIS	TRICT grand grand	ر بنام المحاد ال	L Hazaroous m	aterials :		Other:	For Lower
• • • • • • • • • • • • • • • • • • •						THE CHILLIAGE DISTRICTION	EAT _ CITATION NUMBER
CATION/SUBJECT	1.874 p. in 1844 water.	GAT 1)		·		STATE HIGHWAY RELAT	ED
	4023	<u>-</u>				Yes	SZ No
1. PARTI	ES						
2. 🐰							
PART	4#11	VEHICE	5#1:	WAS	LOCA	TEO OF	V 17 C
WHEZ	15. F	ACING:			EC710	4 110 7	
CURI	IE PA	ACTIAL	Carri Ann	CKING	300	- 1	OF THE ROAD
1 V-1 SU	ISTAINE	D MAJO	RC DA	MAGE		ELE	
FROM	UT 4	SIDE	AREA,	ID.	10 10		ERVE -
ANY	MEC	HANIC	AL DE	EECTS.	I	1DENT	
_D-/	By +	tis CD	L 95	HE STO	000 /	VEAR I	
VER	ticlE.					M.	¥.,
						i	
PARTY	142/1	EHICLE	#2!	WAS	LOCAT	EO ON	) 175
WHEE	ZS F	4CING	AN	W DIR	ECTI	ON 11	ITHE
NIB	POR	TON C	E TIT	E PRI	VATE	ROAD	
DIO	NOT !	BBSER	VE A	W ME	CHA	VICAN	
DEFE	CTS,	V-2	SUSTA	NEO	MA	TOR P	RONT :
LEXT	- Y 1	EFT.	SIDE.	DAMAC	र्जि. उ	I IDEN	MAED
<u> カ-ブ</u>	By	HER (	2DL 4	TALK	EO 1	JITH A	HER,
AS.5		AT IN	THE	AMB		ICE, I	
OBSE	EVED	THAT	BOTH	AIR	BAGS	HAD DE	PLOVED.
	·:	·					
	·	•• .					
		•					
_# <del></del>							
			<i>-,</i> · .		•		
	· · · · · · · · · · · · · · · · · · ·						
RE NAME AND LO. NUME	369	1					
T. William State To HOME	<i>7</i> °	-   OATE	REV	IEWER'S NAME			DATE
							1

RATIVE/SUPPLEMENTAL

6 (Rev 7-90) نت . PATE OF INCIDENT/OCCUR		TIME (2400)	NCIC NUMBER		OFFICER LD. NUMBER	أسروا	NUMBER	Page 9
				_			4	en de la companya de la companya de la companya de la companya de la companya de la companya de la companya de
Σ E	"X" ONE	• • •			LICABLE)		The state of the s	
Narrative	Collision rep		☐ BA upda	ite ···	· ☐ Fatal		Hit and run updat	
	Other:	<u> </u>	Hazardo	us materials	School bus .		Other:	
OUNTY/JUDICIAL DIS	TRICT ····································	• • • • • • • • • • • • • • • • • • • •					REPORTING DISTRICT/BEA	T CITATION NUMBER
OCATION/SUBJECT	and the second of the second o		<del></del>				STATE HIGHWAY RELATED	
<b></b>	genne.	$\epsilon t_{i}^{m}$				.	Yes	) <b>⊠</b> 4No
4			<del>7.'</del>			•		≥ No
0	#							
2. PARTO	1"2	VEHICL	モザユ		TINUE	2 :	I wa.	
B. ASSIT	EO A	TH	ETIC	SCE	NE BO	_/	, —	
	IPON	HIS	INSPE	C770	UOF	77/	CHILD	
QEST	DALACT	- (EVA)		-,,-		<del>, , , ,</del> ,	- 11-	
	~~~		<u>, 47 / </u>	HE !	1 <u> 2 2 C</u>	-702	HEF	OUND :
. 1 HE	SEAT	MOR	71000 7	DE 72	7CHED"	70	Rom THE	E BASE
POR	17010.	HEF	ours ?	1745	PORTIO	<b>2</b> U	IN THE	CHATTER
Con	SOLE	AREA	HE C	ONAC	15720 1	9 E	JUCTION	,
CHEC	V TO	COT !		4.20.1	000	07	200 C/ ( 0)C	
2.0		see /		200	- REI	771	ACH AND	7 //
. <u>DIE</u>	unet	100 C	ORREC	72Y.	1 100	707	IFIED	HE -
. CHIL	D RE	STRAI	NT SET	97 (	73 A	()	CENTUR	1 1 mm - mg 58
LOTA							THE RE	
RELI	5 WEX	E-115	7 211	CHE	en Til	100	U647 TH	LE PART
DE F	to SEX	27 TH	FU mall	10 103		200	OCH TI	- DACK
1		-0 ()	29 002	900		<u> </u>	16H 1748	<u> </u>
COM	FORIE	K, W	41CH W	1115 1	-11/11/16	14	E SEAT,	T.HE ::
CHILD	SEAT	BASE	WAS	COR	RECTLY	A	NC HORE	SO BU
THE	PASSE	WER	SIDE	SEAT	BEZT	$\mathcal{I}$	HECKEZ	77/2
CLIP	UN DE	TUCE	THAT A	TACI	450 TO	770	THE CA	2-7-4
1000	d IT	- 100	T 1010 =	· / · / · / · /			THE CA	COI C.H
	7/	DID	PUNCT	070	CORREC	120	1.	
			·	·	•		·.	
					•			
200 200 200								
	<del></del>				<del></del>			
<del>-</del> \$					<del></del>			
								1
			•					
	·			<del> </del>				
	<del> </del>				<del></del>			
				······································				
RE NAME AND I.D. NUME	BER	_ 70	DATE .	REVIEWER'S	IAME		16	ATE
			, ,	L				

N/ RATIVE/SUPPLEMENTAL

ATE OF INCIDENT/OCCURRENCE  TIME (2400)  NCIC NUMBER  OFFICER LD. NUMBER  NUMBER  OFFICER LD. NUMBER  NUMBER  OFFICER LD. NUMBER  NUMBER  NUMBER  Fatal  Hit and run update  Hazardous materials  School bus  Other:	36 (Rev 7-90) O		• • • •	• • • • • • · · · · · · · · · · · · · ·	A Section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the section of the sect	DEST HANTEMBLE COLA	age //
RADIATION BOSTONIA DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTIC	ATE OF INCIDENT/OCCUR	RENCE	TIME (2400)	NCIC NUMBER	OFFICER LD. NUMBER 100	NUMBER	
RADIATION BOSTONIA DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTICIONES DE LOS PARTIC	ec :	-YC ONE		Type erion cucara		<u>k</u>	
PRIDENTS  TRUDE #1: STATED HE WAS SIA ON THE PRIVATE CONTROLLING STATEMENTS  TRUDE #1: STATED HE WAS SIA ON THE PRIVATE CONTROLLING STATEMENTS  TRUDE #1: STATED HE WAS SIA ON THE PRIVATE CONTROLLING THE SAME  PROPERTY ROAD & 30-35MPH TRAJERSING A CURVE.  WHEN HE SAW U. N. A TRAVERSING THE SAME  CURVE HE APPLIED HIS BRAKES BUT COULD HE SAME  CURVE HE APPLIED HIS BRAKES BUT COULD HE SAME  RESAM HE WAS WETRING HIS SETT SEET. HE  SAID HE HAD NO INSURFACE, HE SAID HIS  PASSENGER ( STATED THAT SHE WAS  SLIEDING AT THE TIME OF THE TIC SHE SAID  THAT WAS THE DELIVER AND SHE WENT  FOR HEAR AFTER THE TIC, DU FOOT SHE SAID  SHE WAS INTERNIK HER COULD NOT GUE ANY  FULTHER FACTUAL INFORMATION.  DRIVED #2! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  LURVE IN THE PRIVATE ROAD WAY, SHE  SAID SHE WAS IN THE RIGHT THE ROAD SHE WILLIAM  E 10-15 MPH NEGOTIATING A  LURVE SHE SAW U-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE ROAD SHE WILLIAM  HER BLAKES BUT COULD WAT AUDIN BEING HER WERE WAS  WERRING HER SELT BETT AND HER DAUGHTER  WHEN IN A CHILD RESTRAINT SEAT AT THE TIME  B THE WERETAME  B THE TIC.  B THE WENT BAIN SEAT AT THE TIME  B THE ROAD WHER SEAT AT THE TIME  B THE WENT BAIN SEAT AT THE TIME  B THE WENT BAIN SEAT AT THE TIME  B THE WENT BAIN SEAT AT THE TIME  B THE WENT BAIN SEAT AT THE TIME  B THE WENT BAIN SEAT AT THE TIME  B THE WENT BAIN SEAT AT THE TIME  B THE WENT BAIN SEAT AT THE TIME  B THE WENT BAIN SEAT AT THE TIME  B THE WENT BAIN SEAT AT THE TIME  B THE WENT BAIN SEAT AT THE TIME  B THE WENT BAIN SEAT AT THE TIME  B THE WENT BAIN		l	ort				**************************************
REPORTING CONTROLLED THE WAS SIDE ON THE PRIVATE CONTROLLED THE WAS SIDE ON THE PRIVATE CURVE.  STATEMENTS  DRIVER # 1: STATED HE WAS SIDE ON THE PRIVATE PROPORTY ROAD & 30-35MPH TRADELSING A CURVE.  WHEN HE SAW UP. DIE TRAVELSING THE SAME.  CURVE HE APPLIED HIS BRAKES PUT COND.  NOT AVOID A HEAD-ON COLLISION WITH UP.  HE SAID HE WAS WEARING HIS SEAT BEST. HE SAID HE SAID HE WAS WEARING HIS SEAT BEST. HE SAID HE SAID HE THE TIC SCETUE TO BE HERE.  PASSENGED LETT THE TIC SCETUE TO BE HERE.  FASSENGED (STATED THAT SHE WAS SHE WENT)  FELL HERE AFTER THE TIME OF THE TIC. SHE SAID  SHE WAS INTERCRIBE HERE SETTIFET AND SHE WAS NOT HART SHE COULD NOT GIVE ANY  FURTHER FACTUAL INFORMATION.  DRIVER # 1: STATED SHE WAS NIB.  CURVE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  EF THE ROAD. AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW U-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE ROAD SHE APPLIED  HER BLAKES, BUT COULD NOT FUOLD BEING  HIT HEAD-ON BY U-I. SHE SAID THAT SHE WAS  WESDINK HER SEAT BETT AND HER PAUGHTER  WHIS IN A CHILD RESPONDED SHE APPLIED  DETHE TIC.	Supplemental	Other: protect	-			Other:	0
STATEMENTS  DRIVER # 1: STATED HE WAS SIA ON THE PRIVATE PROPERTY ROAD & 30-35MPH TRADERSING A CURVE WHEN HE SAW UP NO TRAVERSING THE SAME CURVE HE APPLIED HIS BRAYES BUT COULD NOT AVOID A HEAD-ON COULSION WITH UP. HE SAID HE WAS WERKING HIS SEAT BETT HE: SAID HE HAD NO INSURANCE HE SAID HERE PASSENDED LETT THE TITLE SCENE TO BET HERE  PASSENDED ( STATED THAT SHE WAS SLEEDING AT THE TIME OF THE TIC SHE SAID  SHE WAS INTERPLAND HERE AND SHE WENT  THAT WAS THE DRIVER AND SHE WENT  SHE WAS INTERPLAND HERE SOIT SELT AND SHE: WAS NOT HURT, SHE COULD NOT GIVE ANY FURTHOR FACTUAL INFORMATION.  DRIVER # 2: STATED SHE WAS NIB.  CURVE IN THE PRIVATE ROADWAY, SHE SAID SHE WAS IN THE ROADWAY, SHE CURVE SHE SAW UP ON HER SIDE OF THE ROAD SIB ON THE PRIVATE ROAD SHE APPLIED HER BLAKES, BUT COULD NOT ROOT OF THE SHE WAS IN THE PRIVATE ROAD SHE APPLIED HER BLAKES, BUT COULD NOT ROOT GEING NIT HEAD-ON BY UP. SHE SAID THAT SHE WAS WERNING HER SEAT BETT AND HER DAUGHTER WAS IN A CHILD RESTRAIN SEAR AT THE TIME  DET THE TIC.	TY XUNTY/JUDICIAL DIST	TRICT	all ma			REPORTING DISTRICT/BEA	T CITATION NUMBER
STATEMENTS  DRIVER # 1: STATED HE WAS SIA ON THE PRIVATE PROPERTY ROAD & 30-35MPH TRADERSING A CURVE WHEN HE SAW UP NO TRAVERSING THE SAME CURVE HE APPLIED HIS BRAYES BUT COULD NOT AVOID A HEAD-ON COULSION WITH UP. HE SAID HE WAS WERKING HIS SEAT BETT HE: SAID HE HAD NO INSURANCE HE SAID HERE PASSENDED LETT THE TITLE SCENE TO BET HERE  PASSENDED ( STATED THAT SHE WAS SLEEDING AT THE TIME OF THE TIC SHE SAID  SHE WAS INTERPLAND HERE AND SHE WENT  THAT WAS THE DRIVER AND SHE WENT  SHE WAS INTERPLAND HERE SOIT SELT AND SHE: WAS NOT HURT, SHE COULD NOT GIVE ANY FURTHOR FACTUAL INFORMATION.  DRIVER # 2: STATED SHE WAS NIB.  CURVE IN THE PRIVATE ROADWAY, SHE SAID SHE WAS IN THE ROADWAY, SHE CURVE SHE SAW UP ON HER SIDE OF THE ROAD SIB ON THE PRIVATE ROAD SHE APPLIED HER BLAKES, BUT COULD NOT ROOT OF THE SHE WAS IN THE PRIVATE ROAD SHE APPLIED HER BLAKES, BUT COULD NOT ROOT GEING NIT HEAD-ON BY UP. SHE SAID THAT SHE WAS WERNING HER SEAT BETT AND HER DAUGHTER WAS IN A CHILD RESTRAIN SEAR AT THE TIME  DET THE TIC.	CATION/SUBJECT	TO TAX SEE SEPTEMBER 2011	Many Many Bara	·			
STATEMENTS  DRIVER # 1: STATED HE WAS SIA ON THE PRIVATE PROPORTY ROAD @ 30-35MPH TRADESING A CURVE. WHEN HE SAW UN NIB TRADESING THE SAME. CURVE HE APPLIED HIS BRAKES, BUT COULD NOT AVOID A HEAD-ON COULSION WITH U-2: HE SAID HE WAS WEARING HIS SEAT BEST. HE SAID HE SAID HE WAS WEARING HIS SEAT BEST. HE SAID HE SAID HE WAS WEARING HIS SEAT BEST. HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SAID HE SHE WAS THE DIVER AND SHE WENT. SHE SAID THAT WAS THE DRIVER AND SHE WAS WEARING HER SETT SEET AND SHE WAS NOT HUAT. SHE COULD NOT GIVE ANY FURTHER FACTUAL INFORMATION.  DRIVER # 2! STATED SHE WAS NIB.  © 10-15 MPH NEGOTIATING A  LURUE IN THE PRIVATE ROADWAY, SHE SAID SHE WAS IN THE ROADWAY, SHE CURVE SHE SAW U-1 ON HER SIDE OF THE ROAD SIB ON THE PRIVATE POAD SHE APPLIED  HER BLAKES, BUT COULD NOT RUSIN BEING  HER BLAKES, BUT COULD NOT RUSIN BEING  HIT HERDON BY U-1. SHE SAID THAT SHE WAS  WERNING HER SEAT BETT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME  E MAN MENDID HUMBER  DATE				*:	,		
DRIVER # 1: STATED HE WAS SIA ON THE PRIVATE PROPERTY ROAD & 30-35MPH TRADELSING A CURVE.  PROPERTY ROAD & 30-35MPH TRADELSING A CURVE.  WHEN HE SAW U. N. B. TRAVERSING THE SAME.  CURVE. HE APPLIED HIS BRAKES. BUT COULD.  NOT AVOID A HEAD-ON COULSIEN WITH U.2.  HE SAID HE WAS WERRING HIS SEAT BEZT. HE:  SAID HE HAD NO INSURMICE, HE SAID HIS  PASSENGER LEFT THE TITLE SCENE TO BET HERE.  PASSENGER LEFT THE TITLE OF THE TITL SHE SAID.  FALL HAR AFTER THE TITLE OF THE TITL SHE SAID.  SHE WAS INTERPRISE HERE SETTIFET AND SHE.  WAS NOT HURT. SHE COULD NOT GIVE ANY  FURTHER FAITUAL INFORMATION.  DRIVER # 2! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  LURUE IN THE PAINTE ROADWAY, SHE  SAID SHE WAS IN THE ROADWAY, SHE  CURVE SHE SAW U-1 ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD SHE APPLIED  HER BLAKES, BUT COULD NOT RUSIN BEING  WERNELD HER SEAT AFT AND HER DAUGHTER  WAS IN A CHILD RESTRAIN SEAR AT THE TIME  DET THE TIL.	STATI	· · · · · · · · · · · · · · · · · · ·				T tes	UNo
PROFERY ROAD & 30-35MPH TRAVELSING A CURVE WHEN HE SAW UP NO TRAVERSING THE SAME CURVE. HE APPLIED HIS BRAKES BUT COULD HE SAME CURVE. HE APPLIED HIS BRAKES BUT COULD HE SAID HE WAS WERKING HIS SEAT BETT. HE SAID HE HAD NO INSURMICE, HE SAID HIS PASSENGED LEFT THE TIC SCENE TO BE HERE SAID HIS PASSENGED LEFT THE TIC SCENE TO BE HERE SAID HE THAT SHE WAS FIRE THE TIME OF THE TYC. SHE SAID THAT HAD WAS THE DUVER AND SHE WENT THAT HAD WAS THE DUVER AND SHE WENT SHE WAS INTERPORTS HE COULD NOT GIVE ANY FURTHER FACTUAL INFORMATION.  DRIVER IN THE PRIVATE ROAD WAY, SHE SAID SHE WAS IN THE PRIVATE ROAD WAY, SHE CURVE IN THE PRIVATE ROAD WAY, SHE CURVE SHE SAW U-I ON HER SIDE OF THE ROAD SHE SHE WAS SHE WAS COMING THROUGHTHE CURVE SHE SAW U-I ON HER SIDE OF THE ROAD SHE APPLIED HER BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HER BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT AFT THE TIME WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT AT THE TIME.	٠. ١١١١٤	291501	<u> </u>				
PROFERY ROAD & 30-35MPH TRAVELSING A CURVE WHEN HE SAW UP NO TRAVERSING THE SAME CURVE. HE APPLIED HIS BRAKES BUT COULD HE SAME CURVE. HE APPLIED HIS BRAKES BUT COULD HE SAID HE WAS WERKING HIS SEAT BETT. HE SAID HE HAD NO INSURMICE, HE SAID HIS PASSENGED LEFT THE TIC SCENE TO BE HERE SAID HIS PASSENGED LEFT THE TIC SCENE TO BE HERE SAID HE THAT SHE WAS FIRE THE TIME OF THE TYC. SHE SAID THAT HAD WAS THE DUVER AND SHE WENT THAT HAD WAS THE DUVER AND SHE WENT SHE WAS INTERPORTS HE COULD NOT GIVE ANY FURTHER FACTUAL INFORMATION.  DRIVER IN THE PRIVATE ROAD WAY, SHE SAID SHE WAS IN THE PRIVATE ROAD WAY, SHE CURVE IN THE PRIVATE ROAD WAY, SHE CURVE SHE SAW U-I ON HER SIDE OF THE ROAD SHE SHE WAS SHE WAS COMING THROUGHTHE CURVE SHE SAW U-I ON HER SIDE OF THE ROAD SHE APPLIED HER BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HER BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT AFT THE TIME WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT AT THE TIME.							
PROFERY ROAD & 30-35MPH TRAVELSING A CURVE WHEN HE SAW UP NO TRAVERSING THE SAME CURVE. HE APPLIED HIS BRAKES BUT COULD HE SAME CURVE. HE APPLIED HIS BRAKES BUT COULD HE SAID HE WAS WERKING HIS SEAT BETT. HE SAID HE HAD NO INSURMICE, HE SAID HIS PASSENGED LEFT THE TIC SCENE TO BE HERE SAID HIS PASSENGED LEFT THE TIC SCENE TO BE HERE SAID HE THAT SHE WAS FIRE THE TIME OF THE TYC. SHE SAID THAT HAD WAS THE DUVER AND SHE WENT THAT HAD WAS THE DUVER AND SHE WENT SHE WAS INTERPORTS HE COULD NOT GIVE ANY FURTHER FACTUAL INFORMATION.  DRIVER IN THE PRIVATE ROAD WAY, SHE SAID SHE WAS IN THE PRIVATE ROAD WAY, SHE CURVE IN THE PRIVATE ROAD WAY, SHE CURVE SHE SAW U-I ON HER SIDE OF THE ROAD SHE SHE WAS SHE WAS COMING THROUGHTHE CURVE SHE SAW U-I ON HER SIDE OF THE ROAD SHE APPLIED HER BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HER BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT COULD NOT AVOID BEING HIS BLAKES BUT AFT THE TIME WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT BETT AND HER DAUGHTER WERRING HER SEAT AT THE TIME.	). ZXIVE	se # 1	SIA	IED HE	E WAS 5/3	ONTHE	PRIVATE
CURVE HE SAW UP BY TRAVERSING THE SAME  CURVE HE APPLIED HIS BRAKES BUT COULD  NOT AVOID A HEAD-ON COLLISION WITH UP?  HE SAID HE WAS WERRING HIS SEAT BEET. HE  SAID HE HAD NO INSURANCE, HE SAID HIS  PASSENGER LETT THE TIC SCENE TO BE HERE  PASSENGER ( STATED THAT SHE WAS  SUPPING AT THE TIME OF THE TIC SHE SAID  THAT WAS THE DIVER AND SHE WENT  FILL HELP AFTER THE TIC, OU FOST, SHE SAID  SHE WAS INTERNAL HERE SETTIFET AND SHE  WAS NOT HURT, SHE COULD NOT GIVE ANY  FURTHER FACTUAL INFORMATION,  DRIVER IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  EP THE ROAD, AS SHE WAS COMING THROUGH THE  CURVE SHE SAW U-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD SHE APPLIED  HER BLAKES, BUT COULD NOT FUDIN BEING  NIT HEAD-ON BY U-I. SHE SAID THAT SHE WAS  WERRING HER SEAT DEET AND HER DAUGHTER  WERRING HER SEAT OFT AND HER DAUGHTER  WERRING HER SEAT OFT AND HER DAUGHTER  WERRING HER SEAT OFT AND HER DAUGHTER  WERRING HER SEAT OFT AND HER DAUGHTER  WERRING HER SEAT OFT AND HER DAUGHTER	. PROPE	erry ko	0AD C ?	30-35M	OH TRAJERS	NOA C	URUF.
CORNE. HE APPLIED HIS BRAKES BUT CONID- NOT ANDID A HEAD-ON COULISION WITH U-2.  HE SAID HE WAS WEDDENDED HIS SEAT BEET. HE  SAID HE HAD NO INSURMUE, HE SAID HIS  PASSENGER LEFT THE TIC SCENE TO BE HEAD.  PASSENGER LEFT THE TIME OF THE TIC SHE SAID  THAT WAS THE DIVER AND SHE WENT  SHE WAS WITHERING HER SEMTSELT AND SHE  WAS NOT HURT, SHE COULD NOT GIVE ANY  FURTHER FACTUAL INFORMATION,  DRIVER IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT PORTION  ET THE POAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW U-1 ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD SHE APLIED  HEA BLAKES, BUT COULD NOT AUGIN BEING  WEDRING HER SEAT BELT AND HER DAUGHTER  WEDRING HER SEAT BELT AND HER PAUGHTER	WHEN	HE S	AU U-2	NB	TRAVERSIN	S THE	SAME :
NOT AVOID A HEAD-ON COLLISION WITH U-2.  HE SAID HE WAS WERRING HIS SEAT BET. HE SAID HE HAD NO INSURTINCE, HE SAID HIS  PASSENBED LEFT THE TIC SCENE TO BE HAD.  PASSENBED LEFT THE TIME OF THE TIC SHE SAID.  SLIEDING AT THE TIME OF THE TIC SHE SAID.  SLIEDING AT THE TIME OF THE TIC SHE SAID.  SHE WAS INTERPRISE HER SETT SELT AND SHE.  SHE WAS INTERPRISE HER COULD NOT GIVE ANY  FULTHER FACTUAL INFORMATION.  DRINDLED! STATED SHE WAS NIB.  CURVE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  ET THE POAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW U-1 ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD SHE APPLIED  HER BLAYES, BUT COULD NOT FUOID BEING  HIT HEAD-ON BY U-1. SHE SAID THAT SHE WAS  WERRING HER SEAT BETT AND HER DAUGHTER  (UAS IN A CHILD RESTRAINT SEAT AT THE TIME  ET THE TIC.  ET MAKE MOID MAKER	CURL	E. HE	APPLIE	D HIS	BRAKE	BITCH	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \
HE SAID HE WAS WEARING HIS SEAT BEZT. HE SAID HE HAD NO INSURANCE, HE SAID HIS  PASSENGER LEFT THE TIC SCENE TO BE HERE  PASSENGOR ( STATED THAT SHE WAS  SLEENING AT THE TIME OF THE TIC. SHE SAID IN  THAT WAS THE DRIVER AND SHE WENT:  FIRE HER AFTER THE TIC, ON FOOT, SHE SAID IN  SHE WAS INTERPRING HERE SEATSELT AND SHE IN  WAS NOT HURT, SHE COULD NOT GIVE ANY  FURTHER FACTUAL INFORMATION.  DRIVER IN THE PRIVATE ROAD WAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  BE THE ROAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE ROAD SHE APPLIED  HER BLAKES, BUT COULD NOT RUDIN BEING  HIT HERD-ON BY V-I. SHE SAID THAT SHE WAS  WEDRING HER SEAT BETT AND HER DAUGHTER  CURS IN A CHILD RESTRAINT SEAT AT THE TIME  F MANE MOLD MANER	NOT	97/010	A HE	An-191)	CDILLEIR	1.7.7	) 2 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3
PASSENGER LETT THE TIC SCENE TO BE HERE  PASSENGER LETT THE TIC SCENE TO BE HERE  PASSENGER LETT THE TIME OF THE TIC. SHE SAID  THAT WAS THE DENVER AND SHE WENT  FIRE HELP AFTER THE TIC, ON FOOT, SHE SAID  SHE WAS WEARING HER SETT SHET AND SHE  WAS NOT HURT, SHE COULD NOT GIVE ANY  FULTHER FACTUAL INFORMATION,  DRINDS # 1 STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  LURUE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  EF THE ROAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW U-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD. SHE APPLIED  HER BLAKES, BUT COULD NOT AUDID BEING  HIT HERDON BY U-I. SHE SAID THAT SHE WAS  WEARING HER SEAT BETT AND HER PAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME  F MANE MOLD MANGER  OATE	HESA	1 1-tz	-, 24- 1		3/ July 5 - 5	Court AC	J- <u>L</u> , · · · ·
PASSENGER ( STATED THAT SHE WAS  SLEEPING AT THE TIME OF THE TIC SHE SAID.  THAT WAS THE DRIVER AND SHE WENT  FIR HALP AFTER THE TIC, ON FOOT, SHE SAID.  SHE WAS INTERPING HER SEAT BETT AND SHE:  WAS NOT HURT, SHE COULD NOT GIVE ANY  FURTHER FACTUAL INFORMATION.  DRIVER #4! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  CURVE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  EF THE POAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE ROAD SHE APPLIED  HER BLAKES, BUT COULD NOT RUDIN BEING  HIT HEAD-ON BY U-I. SHE SAID THAT SHE WAS  WERRING HAR SEAT BETT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME  PARKENDIO MANKER	S = 10	11-11	20 0		O HIS SE	AT BEZ	T. HE
PASSENGOR ( STATED THAT SHE WAS  SLEEDING AT THE TIME OF THE TIC SHE SAID  THAT WAS THE DRIVER AND SHE WENT  FOR HALP AFTER THE TIL, ON FOOT, SHE SAID  SHE WAS INTERPING HER SETT BETT AND SHE  WAS NOT HURT, SHE COULD NOT GIVE ANY  FURTHER FACTUAL INFORMATION,  DRIVER # ! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  CURVE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  ER THE POAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD SHE APPLIED  HER BLAYES, BUT COULD NOT AUDID BEING  HIT HEAD-ON BY U-I. SHE SAID THAT SHE WAS  WEDRING HER SEAT PETT AND HER DAUGHTER  (UAS IN A CHILD RESTRAINT SEAT AT THE TIME  EF HAME NO 10, MINIEER DATE	O CO	THE M	AD 700	77050	-	SAID F	415
SLEEPING AT THE TIME OF THE TIC. SHE SAID.  THAT WARS THE DRIVER AND SHE WENT.  FER HERP AFTER THE TIC., OTV FOOT. SHE SAID.  SHE WAS INTERPING HERP SENT BELT AND SHE:  WAS NOT HURT. SHE COULD NOT GIVE ANY  FURTHER FACTUAL INFORMATION.  DRIVENTA! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  CURVE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  EF THE POAD. AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD. SHE APPLIED  HER BLAKES, BUT COULD NOT AUDIN BEING  MIT HERDON BY U-I. SHE SAID THAT SHE WAS  LUCARING HER SEATT BELT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME.  DET THE TIC.	PASSE	ENDER	LEXT	THE 1	IC SCENE	70 600	HER
SLEEPING AT THE TIME OF THE TIC. SHE SAID.  THAT WARS THE DRIVER AND SHE WENT.  FER HERP AFTER THE TIC., OTV FOOT. SHE SAID.  SHE WAS INTERPING HERP SENT BELT AND SHE:  WAS NOT HURT. SHE COULD NOT GIVE ANY  FURTHER FACTUAL INFORMATION.  DRIVENTA! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  CURVE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  EF THE POAD. AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD. SHE APPLIED  HER BLAKES, BUT COULD NOT AUDIN BEING  MIT HERDON BY U-I. SHE SAID THAT SHE WAS  LUCARING HER SEATT BELT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME.  DET THE TIC.		<del></del>				ž.	Carried San San
SLEEDING AT THE TIME OF THE TIC. SHE SAID IT THAT WAS THE DRIVER AND SHE WENT I FER HELP AFTER THE TIC. ON FOOT. SHE SAID IN SHE WAS INTERRING HER SETT BELT AND SHE I WAS NOT HURT. SHE COULD NOT GIVE ANY FURTHER FACTUAL INFORMATION.  DRIVER#2! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  CURVE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION EF THE POAD. AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD. SHE APPLIED  HER BLAKES, BUT COULD NOT AUDIN BEING  NIT HERDON BY U-I. SHE SAID THAT SHE WAS  LUEDRING HER SEAT BETT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME.  DET THE TIC.				STA	LTED THAT S	HE WAS	
THAT WAS THE DRIVER AND SHE WENT.  FOR HELP GETER THE TIC, ON FOOT, SHE SAID SHE  SHE WAS INTERPRISE HER SENT BELT AND SHE  WAS NOT HURT, SHE COULD NOT GIVE ANY  FURTHER FACTUAL INFORMATION,  DRIVER# ! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  LURUE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  EF THE POAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD, SHE APPLIED  HER BRAYES, BUT COULD NOT AUDIN BEING  NIT HERD-ON BY U-I. SHE SAID THAT SHE WAS  WERRING HER SEAT BELT AND HER DAUGHTER  ULT HE TIC.  EF NAME AND ID, NAMEER DATE  DETTHE TIC.  FRUEWERS NAME  DATE  REVIEWERS NAME	SLEE	PING.	AT THE	TIME	E OF THE	7/C. SHE	SAID
FILL HELP GETER THE TIC, ON FOOT. SHE SAID SI SHE WAS WEARING HER SETT SELT AND SHE;  WAS NOT HURT. SHE COULD NOT GIVE ANY FURTHER FACTUAL INFORMATION,  DRIVER # 1! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  LURUE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  EF THE POAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD. SHE APPLIED  HER BLAKES, BUT COULD NOT AUDIN BEING  HIT HERD-ON BY U-I. SHE SAID THAT SHE WAS  WERRING HER SEAT BEIT AND HER DAUGHTER  WERRING HER SEAT BEIT AND HER DAUGHTER  WERRING HER SEAT BEIT AND HER DAUGHTER  WERRING HAR CHILD RESTRAINT SEAT AT THE TIME  DETTHE TIC.	THAT		4295	THE D	RIVER AN	2 5/1/2 /	JENT.
SHE WAS INTERRING HER SERT SETT AND SHE WAS NOT HURT. SHE COULD NOT GIVE ANY FURTHER FACTUAL INFORMATION.  DRIVER#2! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  CURUE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION EF THE ROAD. AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW U-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE ROAD. SHE APPLIED  HER BLAKES, BUT COULD NOT RUDIN BEING  MIT HERDON BY U-I. SHE SAID THAT SHE WAS  WETRING HER SEAT BETT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME  OF THE TIC.  EF MAME AND ID. MINISER  DATE  DATE  DATE	FOR	HERP	AFTER	THE	TIC ON FO	CE SHE	ERIN :
FURTHER FACTUAL INFORMATION.  DRIVER#2! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  CURUE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  BE THE ROAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-1 ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE ROAD SHE APPLIED  HER BLAKES, BUT COULD NOT RUDSID BEING  NIT HERDON BY U-1. SHE SAID THAT SHE WAS  WERRING HER SEAT BETT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME  DE THE TIC.  EF NAME AND ID. NUMBER  DATE  PRIVEWERS NAME  DATE	SHEW	193 1	IT DRID	K 14-	0 5000	73 240	SHE TO
FURTHER FACTUAL INFORMATION.  DRIVER # 1! STATED SHE WAS NIB.  E 10-15 MPH NEGOTIATING A  LURUE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  BE THE ROAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW U-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE ROAD, SHE APPLIED  HER BLAKES, BUT COULD NOT RUSIN BEING  HIT HERD-ON BY U-I. SHE SAID THAT SHE WAS  WERRING HER SEAT BETT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME  DE THE TIC.  EF NAME AND ID. NUMBER  DATE  PAGE  PRIVEWERS NAME  DATE	11/95	AIRT	1410	SHE	CULO NOT G	Cr AND	OHE :
DRIVER# STATED SHE WAS NIB.  © 10-15 MPH NEGOTIATING A  CURUE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  EF THE POAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-1 ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE POAD, SHE APPLIED  HER BLAKES, BUT COULD NOT RUDIN BEING  MIT HERD-ON BY U-1. SHE SAID THAT SHE WAS  WERRING HER SEAT BET AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME  DE THE TIC.  EF NAME AND ID. MUMBER  DATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  POATE  PO	FISAT	-400	500 = 1	21/2 0	CORD 7007 GI	UE 7404	<u> </u>
CURUE IN THE PRIVATE ROADWAY, SHE SAID SHE WAS IN THE RIGHT MOT PORTION EF THE ROAD, AS SHE WAS COMING THROUGHTHE CURVE SHE SAW V-I ON HER SIDE OF THE ROAD SIB ON THE PRIVATE ROAD SHE APPLIED HER BLAKES, BUT COULD NOT AUDIN BEING HIT HEAD-ON BY V-I. SHE SAID THAT SHEWAS WERRING HER SEAT BELT AND HER DAUGHTER WAS IN A CHILD RESTRAINT SEAT AT THE TIME DE THE TIC.	_ * FURT	REIL	FACIUM	4/ 1/0F	01/1941700	),	· ·
CURUE IN THE PRIVATE ROADWAY, SHE SAID SHE WAS IN THE RIGHT MOT PORTION EF THE ROAD, AS SHE WAS COMING THROUGHTHE CURVE SHE SAW V-I ON HER SIDE OF THE ROAD SIB ON THE PRIVATE ROAD SHE APPLIED HER BLAKES, BUT COULD NOT AUDIN BEING HIT HEAD-ON BY V-I. SHE SAID THAT SHEWAS WERRING HER SEAT BELT AND HER DAUGHTER WAS IN A CHILD RESTRAINT SEAT AT THE TIME DE THE TIC.							
CURUE IN THE PRIVATE ROADWAY, SHE SAID SHE WAS IN THE RIGHT MOT PORTION EF THE ROAD, AS SHE WAS COMING THROUGHTHE CURVE SHE SAW V-I ON HER SIDE OF THE ROAD SIB ON THE PRIVATE ROAD SHE APPLIED HER BLAKES, BUT COULD NOT AUDIN BEING HIT HEAD-ON BY V-I. SHE SAID THAT SHEWAS WERRING HER SEAT BELT AND HER DAUGHTER WAS IN A CHILD RESTRAINT SEAT AT THE TIME DE THE TIC.	DRIVE	35 # P	STA	TED	SHE WAS	NIB	· ·
CURUE IN THE PRIVATE ROADWAY, SHE  SAID SHE WAS IN THE RIGHT MOST PORTION  EF THE ROAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE ROAD SHE APPLIED  HER BLAKES, BUT COULD NOT RUDIN BEING  HIT HERD-ON BY U-I. SHE SAID THAT SHE WAS  WERRING HER SEAT BELT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME  OF THE TIC.  EF NAME AND ID. NUMBER  DATE  DATE  DATE  DATE			@ 10-	15 MP			A
EF THE ROAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW V-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE ROAD, SHE APPLIED  HER BLAKES, BUT COULD NOT AUDIN BEING  HIT HERD-ON BY U-I. SHE SAID THAT SHE, WAS  LUEDRING HER SEAT BELT AND HER DAUGHTER  LUAS IN A CHILD RESTRAINT SEAT AT THE TIME  DE THE TIC.  EF NAME AND I.D. NUMBER  DATE  DATE  DATE  DATE	_ CURU	5 IN	THE	PRIVAT	E ROADU	2011 5/4	<del>/</del>
EF THE ROAD, AS SHE WAS COMING THROUGHTHE  CURVE SHE SAW U-I ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE ROAD, SHE APPLIED  HER BLAKES, BUT COULD NOT RUDIN BEING  HIT HERD-ON BY U-I. SHE SAID THAT SHE WAS  WERRING HER SEAT BELT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME.  DET THE TIC.  EF NAME AND ID. NUMBER  DATE  DATE  REVIEWERS NAME  DATE	SAID	SHE	WAS	(11) 77	FE RIGHT	What Call	2724)
CURVE SHE SAW U-1 ON HER SIDE OF THE  ROAD SIB ON THE PRIVATE ROAD SHE APPLIED  HER BLAKES, BUT COULD NOT RUDSIN BEING  HIT HERD-ON BY U-1. SHE SAID THAT SHE WAS  WERRING HER SEAT BELT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME  DET THE TIC.  EF NAME AND ID. NUMBER  DATE  REVIEWERS NAME  DATE	BE TI	YF PO	AN AS	SHT (0)		Toler 104	1745
ROAD SIB ON THE PRIVATE ROAD SHE APPLIED HER BRAKES, BUT COULD NOT RUDSIN BEING HIT HERD-ON BY U-1. SHE SAID THAT SHE WAS WERRING HER SEAT BELT AND HER DAUGHTER WAS IN A CHILD RESTRAINT SEAT AT THE TIME DET THE TIC.  EF NAME AND I.D. NUMBER  DATE  DATE  DATE  REVIEWERS NAME  DATE	CISEVE	CHT	C 21.1			14X0U61	7116
HER BRAKES, BUT COULD NOT RUDSIN BEING  HIT HERD-ON BY U-1. SHE SAID THAT SHE WAS  WERRING HER SEAT BELT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME  BETHE TIC.  EF NAME AND I.D. NUMBER  DATE  DATE  DATE  DATE  DATE	00000	SILE	SAW	/	1 -> 4	OF ME	
HIT HEAD-ON BY U-1. SHE SAIN THAT SHEWAS WERRING HER SEAT BELT AND HER DAUGHTER WAS IN A CHILD RESTRAINT SEAT AT THE TIME.  DE THE TIC.  EF NAME AND I.D. NUMBER  DATE  DATE  DATE		3/3	000 7 17	E PRIV	141E 120AO	SHE AF	PLIED
WEARING HER SEAT BELT AND HER DAUGHTER  WAS IN A CHILD RESTRAINT SEAT AT THE TIME  BF THE TIC.  EF NAME AND I.D. NUMBER  DATE  REVIEWERS NAME  DATE	HC12	BRAKE	S, 1307		1 NOT AUDI	D BEIN	76
DFTHETIC.  EF NAME AND I.D. NUMBER  DATE  REVIEWER'S NAME  DATE	1405	HERD	-ON E	By U-1.	SHE SAIN	THAT S.	HE WAS
DFTHETIC.  EF NAME AND I.D. NUMBER  DATE  REVIEWER'S NAME  DATE	WEAR	1NB 17	ER SE	AT BE	I AND HE	R RAUGH	LTER
DATE .	"IVAS	NAC	H140 K	ESTRAIL	UT SEAT AT	- THE TO	W.F.
DATE .	DFTH	ETIC	•				
Use previous editions until deplaced	IEF NAME ANO I.D. NUMB	ER	DATE	REVIE	WER'S NAME	0	ATE ·
		<del>- / ~ ~</del>	<u>ب ل</u> العم	oravious editions us	itil danlatad		

NA RATIVE/SUPPLEMENTAL

726 (HBV 7:90) C					· ·	Page //
DATE OF INCIDENT/OCCUP	RRENCE	TIME (2400)	NCIC NUMBER	OFFICER LD. NUMBER	A. NUMBER	
· · · · · · · · · · · · · · · · · · ·	Temane	l	TYPE SUPPLEMENTAL CX			
Δ N====	X ONE	e ee estadig oo oo oo oo oo oo oo oo oo oo oo oo oo				.=
Narrative Dupplemental	Collision re		BA update		Hit and rur	1 update
CIT OUNTY/JUDICIAL DIS	TRICT	<u> </u>	Hazardous mater	iais L School bus	Other:	150
	The second second	1.(1.1.2	• • • • • • • • • • • • • • • • • • •	•	REPORTING DIST	RICT/BEAT CITATION NUMBER
OCATION/SUBJECT	22 11 22 7AM 101	2022			STATE HIGHWAY	751.4
900 900 900 900	22 227 2047 1029	J. 18	• . • . • . •	•	Yes	
1 0 7		, /				
1. WII	NESS-		<u></u>	SIME	HESA	2W
2		D-I) Z	RIVING	2		MINUTGS:
3 RF	ENGE	THE				
				SAID		7 <i>†E</i>
4.	33670	SER L	JAS ,		AN	10 THE
5. DA	NER	WAS		U)-1	PASCE	O WITHIN
				TE HOU		0 00111711
7. N/c	EDBE	OF 7	THE PR	IVATE	DRIVER	UAU,
				- WAS /		
in this is a second of the end of		******				// C/B/00;
3. O/C		LATIU	<u> </u>		<u> </u>	
0.				• •		<b>T</b>
1. PPINIC	15	INO C	ONCLUS	SIUNG	· • •	
,			The second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of th			
·					* * * * * * * * * * * * * * * * * * *	
<u> 3.                                   </u>	MARY	c: V-1	WAS S	B ON A A	PRIVATE	ROADWAY.
e - 4	3. MP	4 ENT	ERING A	CURVE	1N 7HE	ROAD
				URUE, A		
	****					
. //077	THE	- NB	SIDE	OF THE	ROAD,	AT THE :
SAN	IE TI	ME. V	-2 WA	SNIB	ON THE	PRIVATE.
	2017 9	COIER	7106 17	E SAMO	ECORC	JE. U-Z
WAS		10-15	MAR	WHEN 7	HE DRIV	IERS .
607	TO A	POINT	WHERE	THEY	02/10	==
mal.	14 67	400	Catt 1	200100		Roaks =
2			307H A		1 HEIR	BRAKES,
BUT	COULD			A HEAD		LISION
	THE	NIBI	PORTION	OF THE	ROAD	
	•	1-/		<u> </u>		
Poin						
<u> </u>	TOP	IMFA	ict: u	JAS LOS	ATED ?	トンフラ
$_{\sim}$ $_{\sim}$ $_{\sim}$ $_{\sim}$ $_{\sim}$	ED6E	05		A	NO 13'	EAST OF
40.404E	_		THE 60	IVATE PC		
<u> </u>	Mysi	CALEU	HOENCE	AND S	STATEME	5243.
						7
ADDIT	י אמנהם	Tal = - 0 -	14 T/2 -7 .	O-1'S SPEE	-0 0-	
** .D.I		- WI-OKNI	· · · · · · · · · · · · · · · · · · ·	OPES		
ARE S NAME AND LD. MILE	CAL ES	NOENCE	REFER E REVIEW	TO SPR NAME	02	PAGE 13.
<u></u>	_	~ [YA]	- HEVIEW	CR 3 NAME		DATE
		<del> /-</del>				

BEST AVAILABLE COPY A RATIVE/SUPPLEMENTAL 56 (Rev 7-90) OPI 042 NCIC NUMBER ATE OF INCIDENT/OCCURRENCE TIME (2400) OFFICER LO. NUMBER NUMBER --TYPE SUPPLEMENTAL (X APPLICABLE) X ONE to the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of th Narrative .... Collision report BA update Fatal Hit and run update Dipplemental Other: ☐ Hazardous materials ☐ School bus Other: TY. XUNTYJUDICIAL DISTRICT REPORTING DISTRICT/BEAT CATION/SUBJECT TEST STORAGE SHE TATE STATE HIGHWAY RELATED ☐ Yes 11 OTHER IS CODED DUE TO THIS TIC OCCUPRING SASED ON PHYSICAL EVIDENCE & STATEMENTS. WISION

REVIEWER'S NAME

DATE

REF NAME AND I.D. NUMBER

DATE

S ID-SPEED	INFORM	IATION		ACCIDENT NUMBE	# Ac	PRIVATE		ACCIDENT DAT	•	7457 SKID 0	ATE
		ONS		-1 AC	CIDENT		TA	<u> </u>			
TYPE OF ROAD		s i kit the in	,	IMPENDING		CICIO DA		7	CEN	TRIFUGAL	SKID
_ DIRT			L.P.	24 =		8021	RET.	1-1/2			,
O TION	7 = 1 7 F	بندونة في المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه المناه	F M.F.	24 2			4 25 - 1	77	CHORD		PEE
HARD PAC	KED	and and are a second	L.A.	in in the second				708	,		
R DIRECTION -	7:37:		""R.R. ""			***************************************			MID-ORDINA	· · · · · · · · · · · · · · · · · · ·	PEE
LIVEL!	5/8	an agranda an rada ga an bag an an an an an an an an an an an an an a	ACCIDENT	VEHICLE (Year, ma	ke, model)	13.5	LONGEST				
						(四)	AVERAGE	15 July 19			
		the same against the rate of	North Michiga	TEST SKI	DINFOR	MATION	Train that		Taranta da da da da da da da da da da da da da		<i>*************************************</i>
N MPH	5.F. 3 3 R.	.F. 3	R.R. L	LONGEST	NCE	The state of the state of	(3) ( 30 ·	MAN OTHER D	LTA THE RES		
1.	46	等等			ORIV	***				I.D. NU	MOER
			<del>                                     </del>	**************************************	- L			in the second	70 <b>27</b> 773		
		計畫等						MARE	~ • •	EAR/MODEL	
	127				ACTU	AL SPEED		DATE CALIBRATE		***	
<u> </u>		1 433		F. 63	題	No. 1				ADAR SPEED	
- 4.49	METHO	SKIDMARKS	EASURED '	us andress.		VEATHER (		THE TIME		INIMUM SPEE	
CIDENT	1	TEST	-		ACCIE			CCIDENT T	EST C	MART (OUET)	, PROM 2
	TAPE .			OLATAPE V 🔲 o	THER	EXTERNAL S			7.00		## ## ## ## ## ## ## ## ## ## ## ## ##
TIGATING OFFICE	RTACCIDEN			I.D. NUMB	ER or Chine	rini: Lite	The States of				
			A STATE OF THE SECOND	4	CORF.	OF PRICTIO	7. July 12			F. 7.	
SED SKID OFFICER				I.O. NUMB	Non	THWES	لمعصر	RANGE			МРН
- <u> </u>				5-3-3		7/0 -	85	A TOP THE			• • • • • •
D WEIGHT PULL	WEIGHT	1. PORMULA		DRAG				i alphadoly, i	:4:		·
- 1.57		PUL	L WT	LCULATED COEF.	ABJUS	TMENT TABL			A0	JUSTED COEF	PICIENT
					1010/21 2019			A STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STA	7 10 15 15	.35	
- 1	Tracket with	. 400 - 2 400 - 2 144	43.43 Jenesee	CALCULAT						e de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de la companie de l	TOP OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSON OF THE PERSO
	at a design	report to the second of the second	F and 1 4 5 Aug 6 1	SPEED	FFRO	かきら	KIO	ANALYS			٠. و و و و و و و و و و و و و و و و و و و
N 64.	4,df				2.4	2 2 2 3 5 5			10.00		<b>.</b>
=				41 ( VEN	ILLE	שעם	• )				
= 164.4)		and the state of the state of									
رر بر ع			and a second second second second second second second second second second second second second second second		والمناء والماري						
	graden i s Braden i se									- 1,50	
100000		rang panggan ang panggan ang panggan ang panggan ang panggan ang panggan ang panggan ang panggan ang panggan a Panggan ang panggan	and the second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second s		and the second		(	and the second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second s		* <del>***</del>	
3896.2	2 :3: :3:	fa said		43	n P I	1 3 6					
- 1251-	- 600								•		
62.42	- P-P-3			* **					•		
			· · · · · · ·			-					
42.547	•								· ·		
	• •		14 T	•	•						
= 43 m	P.H.		•.•.				. •	•			
·		•				• .*		.•			
			_					•			
er e e	• • • • • •	with the second	··· .	•				.* '**	•		
- 1 - 3時						٠. ٠			•		
			•	• •				•			
with the second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second			•								
<b>20</b> 00			•								
16.5 16.5 16.5 16.5 16.5 16.5 16.5											
	SYMBO	LS			EODAIII :	10	1 ===	4404 5 55			
1::04FF161844 0-					FORMULA	10	EX.	AMPLE: CEN	TRIFUGA	LSKIDMA	RK_
V IPEED (MPH)	PRICTION		1080 (FT)	. / =	n =sm	· • <u>m</u>	4	* +	MIDDL	<b>E</b>	
	,		B-GROINATE	V-\ /20/d	100	sa/		/	Jabia	~ • •	
I—BKID LENGTH (PT)		R-RA	DIU4 (FT)					1	16' CHOM	•	

35-33 ×

/		DC	PSONIA	L INFORM	ATION							
(LAST)	(FIRST)	M	DOLE	ROOM/ BED	IVI ION	ALCOUNT N	O.		EX	ACE INC.		
The same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the sa	•							1,	- 1	AGE MEDIC		iQ.
TAL SECURITY NO. BIRTHO		MAR. STAT	RACE		ITY	RELIGION	ADMIT	ED BY		92M		
	994		CA	21 2		NON					01	
AANENT ADDRESS						ST	ATE ZIP		Н	ME PHONE		
ING ADDRESS												
V DIR: UNKNOWN			//			STA	TE ZIP		НС	ME PHONE		·
T OF COUNTRY	PATIEN	IT TYPE		ADMIT CATEGO	100							
	, Allen	I		ADMIT CATEGO	01	ADMIT SOUR		,	AC	MIT THROUGH		
a post tem	ACCORDANCE OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE		TT (CIII					7		EMI	ER	
A property of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of the contract of	Adi: ". Session	LOTME	NI/GUA	RELATIONSHIP	INFOR	MATION	14	724		ានម្នាក់ 😭		(
				FATH						PHONE		
ESS						<del></del>			ST	710		-
:									"	ZIP		
OF EMPLOYMENT (PATIENT)				PLACE OF E	MPLOYME	NT (GUARAN	TOR)					
;												
ATION OR	Н	IRE DATE		OCCUPATION						HIRE C	DATE	
7				CARPE	ENTER	:					. <del></del>	
	C:	ITY		STREET	٠	•				CITY		
719												
ZIP PHO	NE NUMBER .	T	EXT	STATE	ZIP		PI	HONE NU	MBER		EXT	
	· · · · · · · · · · · · · · · · · · ·		<del> </del>	<u> </u>			j					
NY NAME	POLICY H	INSUI	RANCE	INFORMA	TION							_
	. Sciel Ac	CLUER	DENTI	FYING NO.		GROUP		T	CO/PLAN	1	VE DATE	T
-			<del></del>		<del></del>							,
			<del> </del>									Γ
			<del> </del>									
		<del></del>	+-		· · · · ·							
			<del> </del>									
	*. 1 1 1 2 8 8 1 3 4 1 1	A DMT	TTING I	NFORMAT	TON							
ING DIAGNOSIS		ADMI	LILING	MINIORNIAL	CONF	ADMIT DAT	TF.	TIME		DISCHARGE	PATE	
TRAUMATIC R/O SZ	S/P CHT	_			R		-	.	•			
OMITTING PHYSICIAN		98. CO	DE	SVC. ATTE	ENDING PI	HYSICIAN		<u>-</u>		! · · ·	, , ,	
		1	(-		-	<b>/</b> /	-	>-/	/,			
•			ND RE	PORTS TO			£	, –	_			<b>—</b>
G PHYSICIAN (PRIMARY)	STREET AND C	TTY		* * * * * * * * * * * * * * * * * * * *			SLATE	ZI	P	HONE	<del></del>	
								1				
NG PHYSICIAN (OTHER)	STREET AND C	ITY			•		STATE	ZIP	PI	HONE		_
C BUVGGL										•		
G PHYSICIAN (OTHER)	STREET AND C	ITY					STATE	ZIP	PI	IONE		_
·									- 1			
CIN										;		$\prec$
••••		RELAT	- 1	HOME PHONE	_		BU	SINESS PI	HONE &			_
NTACT				Uosse		·				<u>,</u>		
		RELAT	1	HOME PHONE			BUS	SINESS PH	ONE &	EXT		
and the first state of the same	Lie N p. 1974 Factor at		' 1				$\perp$					الر
IZED TO RELEASE INFORMATION	V. I hambu	and A	SSIGNI	MENT	e4: = 1	A						1
IZED TO RELEASE INFORMATION  1 which is or may be liable up  charge, including, but not limit  mployer.	nder a contract to t	the distribution	the or to the	/physicians	s to disc	lose all or a	or eme	of the	patient'	s record to a	any person	:
mployer.	ted to	medical serv	vice comp	anies, insuranc	e compai	nies, workmer	n's com	pensation	carrier	s, welfare fund	ds, or the	. [
									.•	i		
ENT OF INCIDANCE CONTRACT						Patient (Pari	ent if Min	or)				
ENT OF INSURANCE BENEFITS: ced the hospital's/physician's regula	I hereby irrevocably a	authorize pa	yment dir	ectly to the a	bove nam	ned hospital/	physician	Benefit	s otherv	vise payable to	o me but	1
eed the hospital's/physician's regula this agreement.				understand I	am fina	ncially respor	isible to	the hos	ipital/pł	sysician for ch	arges not	1
	_19	Signed.				Policyh	older					
	/)/	NOTIFICA	TION OF A	DMISSION				DISC	HARGE		$\overline{}$	`
ADMISSION	Resident /	RY		Time		DATE				ТІМЕ		4
RECORD	V 3					DISCHARGE	ESCORT :	(COI .B IED				-
		COPY WK	STACK P.	ATIENT IDENTIF	ICATION	- TOUR HANDE	45-1/RI	COUNTER	<u></u>			1
19-0100 (11-91)								ncor	A11A71 A	DIF CODY	)	
	<del></del>					·		_ BEST	AVAILA	BLE COPY		

DISCHARGE DIAGNOSES:

- 1. Post traumatic subdural hemorrhagic hygroma.
- 2. Skull fracture.
- 3. Post traumatic seizure.

HISTORY OF PRESENT ILLNESS: This patient is a three-month-old Caucasian female with a history of a motor vehicle accident. The child was in a car seat. The back of her infant seat was against the front seat. There was a head-on collision; the air bag was inflated and the child had been admitted with a skull fracture in the right lambdoid area consistent with diastasis and a small fracture at the occipital bone. The patient was initially admitted to the Pediatric Trauma Service. She was discharged. Her C-spine was cleared prior to that discharge. She has been somewhat somnolent, sleepy. She had an episode of tonic contracture of the right hand that lasted approximately ten minutes and she has been lethargic off and on since this time.

PHYSICAL EXAMINATION: On physical examination, pulse 160, respiration 28, temperature 96.2. The patient is awake, intermittently lethargic, irritable but consolable. HEENT: Essentially normal anterior fontanel that is flat, pulsatile. The pupils are equal, round and reactive to light. Gaze was conjugate. NECK: Supple. LUNGS: Clear. HEART: Regular rhythm. ABDOMEN: Soft and nontender. On initial neurological exam the right side subtly showed less movement than the left, but there was preservation of fine motor movements on both sides. Deep tendon reflexes were physiologic and muscle tone was preserved.

HOSPITAL COURSE: A CT scan of the head showed prominent bilateral subdural hygromatous fluid collection. The patient was started on phenobarbital for seizure and scheduled for surgery. She underwent placement of a right-sided subdural to peritoneal shunt on . Subdural protein was 6,210 mg/l, subdural glucose was 73 mg/dl. Subdural fluid count 755 red cells per cubic ml, 9 nucleated cells per cubic mm, 32% segs, 37% lymphs, 28% monos or macrophages, 1% eosinophils, and 2% variant lymphocytes. The subdural fluid showed no growth in three days. The patient had low-grade fevers postoperatively and she experienced diarrhea. Rotavirus antigen was negative. Stool for lactose and nonlactose had many gram-negative rods on culture. Urinalysis was essentially negative. The patient had suture removal on the date of discharge. Her wound was healing satisfactorily.

DISCHARGE INSTRUCTIONS: MEDICATIONS: Poly-Vi-Sol 1 cc p.o. q.d., Fer-In-sol 0.6 cc p.o. q.d., phenobarbital 12 mg p.o. b.i.d. The patient was to have a CAT scan of the head without contrast scheduled in four to six weeks after discharge and was to return to Pediatric

DISCHARGE SUMMARY

24-0643C (5/93)

Neurosurgery clinic after the above. She was given phenobarbital 12 mg b.i.d.

ATTENDING PHYSICIAN

cc:

DISCHARGE SUMMARY

24-0643C (5/93)

	BEST AVAILABLE COP	·v —	T ====					ROOM	<u>IUMBE</u>		
atient Name:	OTHERDER GUE	t	TIME			Treat		MD		Discharg	C
1				LEVEL		MMEDIA	TE	:: (S) = (N)			-URGEN
			TIME	B. P.	H. R.	R. R.	TEMP.		S	IGNATI	
ate of Visit	D.O.B.	' ५५	L		160	28	963		<del></del>		
Beznat   Sex=	Wt.6 6 L.M.P.	2 la		L				1			• -
	ibtained he		ni. x	All	ergies: 🎾	NKDA				T	
3d ago.										Letanu	s pour
iage Assessment:	yesterday.	m-	حده ۸	Me	dications _	るる					O See Li
States Co	hild has Alas	7 2	00.000	100							,
	c a scepu		Philip								
A rouge	<del>y a 3 cap</del>			Nur	sing Diagno	osis					
· · <del>· · · · · · · · · · · · · · · · · </del>	$\langle \cdot \rangle$	) —	<del></del>	— <del> </del>	·						
	<u> </u>			Nun	sing Goals						
- (1) - (1)			Ų.	SLN		sa chair	OPDI	ERS			O SLN
Past Medical History _	<u> </u>			Tin	ne (Only	one order	per line )	Rea			
<u> </u>	<del> </del>				O CB		per inie.)	Kea	son	Time	Nurse
						ctrolytes			+		
PMD	Triage Nurs						Magnesium				
AIRWAY & C-SPINE	BREATHING	CIRC	ULATIÓ	N	☐ Glu		.,		<del></del>		
::Dxygen:	☐ Med Neb		ous Orders		☐ Urin	alysis 🗇	Cath				
L/Minute	-	E Heple	ck_		O HCC	3					
By:		O (1)			☐ C&						
Suction equipment	☐ ETCO₂	<b>(2)</b>				e and Cros			units		
IG Tube	☐ Pulse Oximeter		c Monitor				C. / Chlam.				
NP Airway		☐ EKG	1!			g Levels:					
Intubation:	Peak Flows:	☐ B. P. M☐ Cardia		<del> </del>	10			·			
	☐ Pre ☐ Post ☐ ABG (Room Air)	Lines:	c racing		<del> </del>						
C-Collar Application		Centra	·	<del>- </del>	<del>  </del>						
Broselow Tape	Rate FiO <sub>2</sub>	☐ Arteria		<del></del>		MEDIC	ATION	PROCEDU	IREC		
	TV Peep	O BLS		-1	O Accu		1		1		
	a	☐ ACLS				Catheter		I/O Cath		<del></del>	
	X-RAY		· ·	•	1 Hemo		. ري	, , , , , , , , , , , , , , , , , , , ,			
-⊗INE:		☐ Pelvis				e Set Tray	01	Pelvic Set-u	<del>,  </del>		
		☐ Hip (	R L	T		us: TT or				<del></del>	
Complete Series	0	☐ Acute A	ABD	-	☐ Urine						
		☐ KUB				<del></del>				<del>-  </del>	
1000 1000		σ			News	at for	- cet	whom	-01-1	ms/1	द्रम
	IMAGING STUDY		. **:	ংহ		0			~ / ^	1	· 1
	tead 3 contr				Seda	le om	E D	rctoco	e/IE	ن سان	+Ms
	ast, With Nurse or Withou	ut Nurse			Do-L	10,	aiHO	استعل	691	~ <del>\</del>	le
িΓ. Sedation, Agent:					1-201	121					
Últrasound:					7	nix	w ms	m 50	2 N.	5 9	he
*	BATCH ORDERS	``	ta sir .	91	1->1	50 N	15. Dr	- (150	1	1	
Crdiac Profile					Chlo	so my	het	480	1/0	Olar	
	CK (CKMB), PT, PTT, EKO	, portable (	CXR)			J			ONV	70	
Trauma Profile				Impress	sions:	,				7 %	
	UA, *HCG, T&S, Serum Osi				5/2	6.	1 1	÷1~			l
	ATION-NOTIFICAT		<b>一身和人物有效</b>	ž.	J.p	···		$J \sim J$			I
Service, Specialty, Gate	<del> </del>	sponse	Arrived	_		VON	ふわらり	AMS			1
Meurosungen	1390		<u> </u>	4		~ (	القدعة	RJE			ı
الكرسود و وساد	Madde DARC/HE	1439	. •	4 .							
	-1	اليب.		4 5	TATUS	POST	HEAD	INJURY			1
position Condition:	Prescribed	1 Medicat	ions	4		1	<b>γ</b> :		••	. ·	i
icial Clearance for Adn				L (	· ·	24	• •		•		
Trunsfer/Discharge Loc	ation:			ATTEM	DINC					:	$\neg$
KAI NE					DING	MAIY	11114	• • - = -	_	rution	<u>a</u>
				RESIDE	NT	·			_ & Dic	tation	<u>0</u>
					7						
1 8						1					

ATTENTION!!

MISSING INFORMATION

[X]ATTENDING PHYSICIAN
[]
[]
[]
[]

OTHER:[

BLANK: PAGE [ ] PARAGRAPH [ ] BLANK: PAGE [ ] PARAGRAPH [ ]

LINE [

SOUNDS LIKE:

EMERGENCY DEPARTMENT PHYSICIAN'S RECORD

24-0643C (5/93)

# DATE OF VISIT:

The patient is a three month-old who is brought in for vomiting and altered mental status. The patient's mother says that the child was a belted passenger in a motor vehicle accident on this past the three days ago, was discharged last night from the

Pediatric Trauma Surgery and followed by Neurosurgery there.
Apparently had a skull fracture and some type of intracranial injury.
Since discharge, mother says, has had some decreased p.o. intake and vomited twice, has been more sleepy than usual and mother was concerned about some rhythmic movement of the right upper extremity, clenching the right hand with a tight fist.

IMMUNIZATIONS: Are up to date. ALLERGIES: NONE. Was a term baby with normal spontaneous vaginal delivery. MEDICATIONS: None.

PHYSICAL EXAMINATION: VITAL SIGNS: Temperature 96.2, heart rate 160, respiratory rate 28. GENERAL: The child was crying when I entered the room, had decreased movement in the right upper extremity but there was no seizure activity. She was consolable with a bottle of Pedialyte and was not irritable nor lethargic. Tympanic membranes are clear. Pupils were equal, round and reactive to light, about 4 mm to 3 mm bilaterally. Pharynx is benign. NECK: Supple. CHEST: CARDIAC: Regular rhythm. ABDOMEN: Soft, nontender. **NEUROLOGIC:** Moved all four extremities, except seemed to move the right upper extremity less than the others. Other than that the child was looking about the room and extraocular movements were full and pupils were equal and reactive at 4-3 bilaterally.

### CLINICAL IMPRESSION:

1. Status post head injury with vomiting and sleepiness.

PLAN: The patient is to get a head CT at this time; we are giving rectal Brevital by diluting 500 cc in 5 cc normal saline and giving 150 mg per rectum five minutes before the procedure.

I talked to \_\_\_\_ of Neurosurgery about this patient, he is going to come down and examine the patient as he was involved in the care of the child on the ward.

The final disposition will be by the Neurosurgery team.

ATTENDING PHYSICIAN

cc:

EMERGENCY DEPARTMENT PHYSICIAN'S RECORD

24-0643C (5/93)

L !Name		Attending MD
ITIAL ASSESSMENT		Date Time in Trt. Area Sex Age LMP Room No
sixtained head ini.	x 30 000.	Allergies PMD
-	lesterday.	Parient Medications
1)	1	A She
r-otter states Child		
TIME SITE POS. DB/P PULSE	RESP TEMP OZ/SAT	INIT PUPILS INITIAL GLASGOW COMA/SCALE
135 - 1604	28 96 2	INIT PUPILS INITIAL GLASGOW COMA/SCALE  REQUEL  OF THE PUPILS  INITIAL GLASGOW COMA/SCALE  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF THE PUPILS  OF TH
45 - 12800		Unequal I. EYE OPENING 2 VERBAL RESPONSE 3 MOTOR RESPON
530	24 PA 100%	Responsive Spontaneous Oriented = 5 Obedient
00 136	29 RF 101/2	☐ Sluggish To Voice = 3 Confused = 4 Purposeful ☐ Fixed To Pain = 2 Inappropriate = 3 Withdrawal
150	V	Dilated None = 1 Incomprehensible = 2 Flexion
	SITE INIT RESPONSE	☐ Pinpoint None = 1 Extension
130 Chloral hydrate 480 m	PO	Normal for PL None
,		MEDICAL HISTORY  No Chronic Disease
		Unknown Cardiac
	·	☐ Diabetes ☐ Pulmonary
TIME [V SOLUTIONS GAUGE S	SITE INIT TIME AMT. ABSOR	HTN Other
CO Flectock Ha (L)	F AMI. ABSUR	Skill Take.
		☐ Cyanotic ☐ Moist ☐ Cool ☐ Moderate
KE TYPE AMT TIME OUT	TPUT TYPE AMT TIME	☐ Flushed ☐ Profuse ☐ Cold ☐ Severe
AMI TIME OUT	PUT TYPE AMT TIME	E RESPIRATORY STATUS NA ABG
***		☐ Wheezes ☐ Nasal Flaring ☐ Smoking Hx
	L OUTPUT	☐ Diminished BrS ☐ Cough ☐ Productive ☐ Non-Productive
NG TUBE Size	ME PROCEDURE IN CRUTCHES & TEACHING	IIT CARDIAC STATUS À NA ☐ EKG Done Pain ☐ No ☐ Yes Time
EYE IRRIGATION	ICE / ELEVATE .	Pain   No   Yes Time  Severity   Mild   Moderate   Severe
COOLING MEASURES	SPLINT /ACE	Type Constant Intermittent Other
SEIZURE PRECAUTIONS	STRAIGHT CATH	Location Radiates
NURSING NOTES Of TURNING	Comfort V /+	Duration Pedal Edema No Yes  Cardiac Monitor Time Rhythm
head invine @ alte	ration Ruid elec	ABDOMINAL STATUS X NA
trolytesil RH romitin	is OPH's comfort	Pain No Yes Nausea No Yes
hard I man to desit	excess Pf's	Location Vomiting No Yes
Mail Mit July	16/1/ 10 · /	Duration
Juna vieno gres	Will pur D	GYN NA GU NA SIDE RAILS
aucharge -		Discharge ☐ Yes ☐ No ☐ Incontinent☐ Yes ☐ No ☐ One
10 MD e bedside to	cont of	Color Frequency Yes No Two
Pt. to CT man &	- KN and	Bleeding Yes No Burning Yes No Call light in place  Cramping Yes No Hematuria Yes No Pins in place
and the Robert	111 /2 on RA-	Onset Foley Size
See Additional Notes Ann TN	11 to COVING	Pad Count Time Initial Output
pention:   OR   Morgue   Admit   Standard	alle 70 3 100	WOUNDINJURY BLEEDING LABS X-RAY
ischarged Transfer		N/A Type   None
Time Time	· · · · · · · · · · · · · · · · · · ·	Site Controlled
union Teaching	· - / Ilaa	☐ Uncontrolled 5
	//	PATIENT IDENTIFICATION
- <del> </del>	NCY DEPARTMENT	
	IC A SEESEMENTS	P
White - Ch		Part 1

tient (value:	D <sub>1</sub>	te:		PHYSICAL	EXAMIN	ATION	
Private Physician:		ne Seen:	VITAL SIGNS:	BNORMAL FINDINGS	AND PERTIN	NT NEGATI	
	<b>MEDICAL HISTORY</b>		GENERAL:	темр 96	ВР	HR 16	ORR
CHIEF COMPLAINT	Y			G 1 10			
HISTORY OF PROBE	FM:		HEENT:	3	200 +		
VOCATIVE PALLIATIVE FA	ATION, FREQUENCY, EPISODES, LOCATION, RA LTORS, SIGN/SYMPTOMS, MEDICATIONS, TREAT	DIATION, QUALITY, SEVEI MENTS)	пу.	- chors /c			·
Spmv	A moning to	ised	CHEST:				
	1 C 0100 F	^ 1	\				
atriche	a 40 ricer (,	/ -	HEART:				
E her	white						
1-00 P			LUNGS:				
Stall fr	acre.						
	1. 1.		ABDOMEN:	Siege			
2 Dison	led hoc.			<u> </u>			
C. of	10. 100	-1 x2	NEUROLOGIC:				
Sme 4	ar Tho, No	swi- >	EXTREMITIES:	- 4	· · · · · · · · · · · · · · · · · · ·		
Sloen	•		EXTREMITIES:	moves xi	<u> </u>		
	@ ha 11 13/1	6-7	OTHER:			<del></del>	•
cleuls	en I po, vo (en I po, vo	Jes .				<del></del> -	
			(DEDCAT SYALKING	EPARTMENT COURS			
S.EMS REVIEW:			STATUS, MIN INTENSITY,	TIME, SERIAL VITAL SIGNS, TREATMENTS AND PATIENT RE	EDICTUATIONS CON ESPONSE) LABOR	IDITION VITAL S ATORY, EKG	KINS, MENTAL X-RAYS.
SIEMS REVIEW:	☐ Negative ROS LN	MP:	i			٠	
	T	mu ID					
•	مل						
LETGIES: None							
SimeDical-surgion							
	TO PA		RADIOLOGIST REP	OPTS.			
	NEV	10			<del></del>		
	11	٠	Reevaluation Times:		<del></del>		<del></del> ,
NT:	11		PROCEDURE NOT INDICATION, PREOPERATIVE CONDITION AT CONCUSION	E PREPARATIONS OPERATIVE	E PROCEDURE, OL	TCOME/FINDING	IS. PATIENT
AI / HISTORY: AGES	(Health, Age at Death & Cause)			•			
Mar.							
		•	CLINICAL IMPRES	SIONS: (Diagnosis or	Symptom)	<del></del>	
IAL HISTORY: Occup	pation (R)					<b>y</b>	
rital status: m s	D W Psychosexual						
or Alcohol Use moking: (Years	) X (PPD),	•	PLANS:			-	<del></del>
4	· · · · · · · · · · · · · · · · · · ·						٠
IC.TIONS: None		•••			•	•	
Tolle	1					<u> </u>	
	q		Physician Signature:		.98	<u> </u>	
			Time Discharged:		Dictated	Not E	dictated
		l	PATIENT IDENTIFICATION				
# /	EMERGENCY DEPART	MENT					
	PATIENT CARE REC	ORD					•
1 54	";;						·• ;
AL PROPERTY.	MEDICAL RECORDS	<b>26-0</b> 451 (5-93)		BES	ST AVAILABLE	COPY	i

# ATTENTION!!

**₩** 

# MISSING INFORMATION

	SICIAN SPELLING OF PATIENT'S ORY, you state patient		IMPRESSION,	you	
OTHER:[					
BLANK: PAGE [ ] BLANK: PAGE [ ]	PARAGRAPH [ ] PARAGRAPH [ ]		LINE LINE	_	]
SOUNDS LIKE:	<del>-</del> .	•••			

HISTORY AND PHYSICAL

24-0643C (5/93)

**CHART COPY** 

-2

### DATE OF ADMISSION:

BRIEF HISTORY: The patient is a three-month-old white male with history of motor vehicle accident. He was hit by an airbag three days ago. He was admitted to the Pediatric Intensive Care Unit Trauma Service for a skull fracture. The patient had been doing well and was sent home the day before this admission. Since then, the patient has not been feeding well and vomited twice. He has had a moderate amount of sleepiness and had an episode of tonic contracture of the right hand that lasted approximate ten minutes. He has since been lethargic on and off and not using his right side as much as his left.

PAST MEDICAL HISTORY: As above, otherwise unremarkable. MEDICATIONS: None. ALLERGIES: UNKNOWN.

# PHYSICAL EXAMINATION:

**VITAL SIGNS:** 

Pulse 160, respiratory rate 28, temperature 96.2.

In general, the patient was wakeful,

intermittently lethargic and irritable when

aroused but seemingly consolable.

**HEENT:** 

GENERAL:

Head examination showed no obvious contusions. The anterior fontanelle was flat, soft, and pulsatile. Eyes - The pupils were equal, round, and reactive to light and accommodation. The patient did open his eyes. The pupils were 3 to 2

and conjugate.

NECK:

Neck appeared supple.

LUNGS: HEART:

The lungs were clear to auscultation. The heart had a regular rate and rhythm.

ABDOMEN: The abdomen was soft and benign.

NEUROLOGIC:

Motor examination - He moved the right side less than the left but did have fine hand movements on

the right side. There was no muscle tone throughout. Reflexes appeared physiologic.

DIAGNOSTIC DATA: A computed tomography scan of the head is pending.

### IMPRESSION:

1. A three-month-old female with possible posttraumatic seizure activity affecting the right side and postconcussion-like syndrome.

# PLAN:

- 1. A computed tomography scan of the head to reevaluate possibility of expansion of a hematoma.
- Admission to the Pediatric Intensive Care Unit for close observation.

HISTORY AND PHYSICAL

24-0643C (5/93)

3. The patient will be placed on phenobarbital for prophylactic antiseizure control.

ATTENDING PHYSICIAN

cc:

33

HISTORY AND PHYSICAL

24-0643C (5/93)

ATTENTION!!

MISSING INFORMATION

	LEASE	VER	(IFY	SPELLING	OF	PATIENT'S	FIRST	NAME.	:	
OTHE	₹:[									1
BLANI BLANI	C: PAG	•		PARAGRAPH PARAGRAPH	[	]			LINE [	]

SOUNDS LIKE:

OPERATIVE RECORD

24-0643C (5/93)

# DATE OF SURGERY:

OPERATING SURGEON: FIRST ASSISTANT:

PREOPERATIVE DIAGNOSES:

1. Bilateral subdural hygromas,

posttraumatic.

POSTOPERATIVE DIAGNOSES:

1. Bilateral subdural hygromas,

posttraumatic.

OPERATION PROPOSED:

1. Placement of right subdural to peritoneal

shunt.

OPERATION PERFORMED:

1. Placement of right subdural to peritoneal

shunt.

ANESTHESIA: INCISION:

General endotracheal anesthesia.

Right frontoparietal and midline epigastric.

FINDINGS: Blood-tinged, proteinaceous subdural fluid under elevated

pressure.

SKIN CLOSURE: 4-0 nylon.

SPECIMENS REMOVED: Subdural fluid. POSTOPERATIVE CONDITION: Satisfactory.

PROGNOSIS: Guarded.

DRAINS AND PACKS: None.

ESTIMATED BLOOD LOSS: 5 cc

BLOOD ADMINISTERED: None.

INDICATIONS FOR SURGERY: The patient is a three-month-old female status post motor vehicle accident four days previously. She had a minor head injury. She was discharged to home and readmitted one day prior to surgery for exacerbation of seizures and intermittent lethargy. Repeat computed tomography scan showed increased size of bifrontal subdural hygromas.

PROCEDURE: The patient was brought to the operating room and general endotracheal anesthesia was induced. The right side of the head was shaved and prepped in a sterile fashion. Sterile towels were placed under the head, and the head was turned toward the left side. Sterile draping was performed, and infiltration of the skin was performed with 0.5% Lidocaine with 1:200,000 epinephrine. A curvilinear incision was made anterior to the coronal suture and lateral to the fontanelle, and a mastoid retractor was placed. A midline epigastric incision was also infiltrated and incised, and a self-retaining retractor was placed. A shunt passer was then placed from the abdominal wound to the scalp wound. Intermittent stab wound in the parietal region was necessary. The shunt tube was then passed subcutaneously, tunneled from the scalp wound to the abdominal wound. The coronal suture was then opened, and the Love-Adson was used to dissect the dura free from the overlying

OPERATIVE RECORD

24-0643C (5/93)

The rongeur was used to remove the overlying frontal bone. underlying dura was then coagulated using Bovie cautery. was used to incise the dura, and a blood-tinged fluid under increased pressure was found to come forth. Specimen was taken for culture and studies. An in-line straight connector was used, and a ventricular catheter was cut down to 6 cm. Holes were enlarged in the proximal end. The tube was secured to the straight connector using 000 silk suture. The end was then placed into the subdural fluid collection, and a 4-0 silk suture was used to tie down the catheter at the straight connector site. The abdominal wound was extended down to the peritoneum, and the peritoneum was opened and sounded with a No. 4 The peritoneal tube was then placed into the peritoneum Penfield. without difficulty. The peritoneum was closed using interrupted 000 Vicryl suture. The subdermal layer was also closed and the fascial layer was closed with interrupted 000 Vicryl suture. The skin was closed using running locked silk. The scalp incision was closed in a similar fashion with interrupted 000 Vicryl suture and running locked 4-0 nylon for the skin. Sterile bandages were applied, and the stab wound was closed using a single interrupted 4-0 stitch. Sterile bandages were applied. The patient was then extubated and taken to the recovery room in stable condition.

COMPLICATIONS: There were no complications noted from the procedure. CLASSIFICATION OF PRIMARY WOUND: Clean - refined.

(H)/r720

OPERATING SURGEON

cc:

OPERATIVE RECORD

24-0643C (5/93)

	ATO WANTENDEE COLA
REQUESTED BY ATTENDING PHYSICIAN	CONSULTING SERVICE:
KLASON FOR REQUEST:	
Fluids + electrolytes + sz	management
DATE 1 1 20 : 45	
I.D: 3mlo & SIP MVA ~	
P9: 3mlo & SIP HVA on 11, w	whit he are loss which anded the
back of the can seat (7-1.1	should Fx of P)+ Docciput,
small anturin in at posetal let	on ishowed Fx of P+ Docciput,
mass effect. Pt. was DC'd home ;	from hosp, yesterday. Today noted to have
tonic Clouic mor. of nt. hand lasting in	10 min , no less of Conscioueness or
generalised so activity noted, had born	ting x 2 today + has been the stuff
: Phenobachtol 12 mg BID ( 4 mg/kg)	from hosp. yesterday. To day noted to have to some no less of conscioueness on thing x 2 today + has been me sleepy.
VS: T98 P131 R31	
Jen: alut, active, PERRL Heat: RRR&D	
lungs CTAB.	
lungs CTAB.  alof: seft, ND, NT, + Bd, HSM  estrom: warm, moves all 4 extrem  1 CT: 9 mm thick bl hat 1 + 5 mm thick	
e ICT: 9mm thick bl frontal + 5mm thick	the temporal subdural hamatone, hil possitel 3-8mm foci of low attenuation pub. related to continue
skull Fx, 4 left + one st. parietal	3-8mm foci of low attenuation put related to continue
1. 3 m/o 4 with has post troumatic	s poet concussion Syndrome with
bil. subdual hematomas.	
: 1) Place NPO on IV D50.3 c' 10 mg	IL KCl of 80cc/hg/D.
2) Cart. Phinobat. + By pucolitions.	<b>₹</b>
3) CBC, lyto + RBS. 4) EEG, reg. sq activity	
5) Subdural to peritoned shunt in a	m_
M.D.	M.D.
PLEASE PRINT NAME (RESIDENT)  A A A	PI FASE PRINT NAME (CONSULTING PHYSICIAN)
RESIDENT'S SIGNATURE	CONSULTING PHYSICIAN'S GIGNATURE
	PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PATTER TO THE PA
CONSULTATION REPO	ORT ,

23-0048 (11/93)

ិ**ខ:** 🖖 DB:

AGE: 5 m/MMedication:

Referred by: Handedness: Location: out patient x Gestation:

LIFERRAL: , Seizures.

This is an 18 channel EEG done by the Standard International 10-20 I ectrode Placement System. The patient is asleep and the background demonstrates a nice moderate to high amplitude delta activity with a good gradient for age. The spindle activity appears to be normal. There is no fical or hemispheric abnormalities noted. Later stage III and IV are observed with higher amplitude delta activity.

I PRESSION: / Normal EEG for age.

Pediatric Neurology

NEURODIAGNOSTIC REPORT

REPORT OF ELECTROENCEP



AGE DATE OF BIRTH SEX EXAMINATION(S) REQUESTED

3M F CT HEAD NO CONTRAST

PROVISIONAL DIAGNOSIS, PERTINENT HISTORY, OR CLINICAL DATA ATTENDING PHYSICIAN

CEDERING PHYSICIAN

CT SCAN OF THE HEAD WITHOUT CONTRAST: @1559 HOURS

CLINICAL SUMMARY: This 2-month-old infant girl reportedly was in a motor vehicle accident two days ago. The patient had an episode of seizures the day of this examination. Noncontrast head CT is requested to evaluate for evidence of depressed skull fracture or intracranial injury.

PROCEDURE: Utilizing the GE Hi Speed CT scanner, 3 mm slices at 5 mm intervals were obtained through the posterior fossa followed by serial 5 mm slices at 8 mm intervals through the remainder of the cranium to the vertex in an EMI plane without the injection of contrast material. Soft tissue and bone windows were obtained utilizing specialized software. Frontal and lateral digital scout images of the skull were first obtained.

FINDINGS: There are 9 mm. thick bifrontal and 5 mm thick bilateral temporal subdural fluid collections slightly greater in density than CSF. There is no evidence of acute hemorrhage or cdema. 3-5 mm low attenuation sites are seen in the subcortical white matter or the left frontal, left parietal and right frontal lobes. There are bilateral parietal skull fractures of varying ages. The ventricles are midline and noncilated. The visualized paranasal sinuses, mastoid air cells and tympanic cavities are normally aerated.

IMPRESSION: Traumatic lesions including 9 mm bifrontal and 5 mm bitemporal chronic subdural hematomas, bitateral parietal skull tractures of varying ages, and scattered chronic subcortical white matter injuries.

SB/ANH/pt

(continued)
Page 01 of 02

PATIENT IDENTIFICATION

RADIOLOGY CONSULTATION

AGB DATE OF SIRTH EXAMINATION(S) REQUESTED SKX DATE OF REQUEST 3M CT HEAD NO CONTRAST PROVISIONAL DIAGNOSIS, PERTINENT HISTORY, OR CLINICAL DATA ATTENDING PHYSICIAN HEAD TRAUMA ORDERING PHYSICIAN

cc:

END OF REPORT Page 02 of 02


RADIOLOGY CONSULTATION

335 335 335

SURGERY

RADIOLOGY

PATIENT IDENTIFICATION.

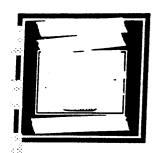

ANGIOGRAPHY / INTERVENTIONAL	
COMPUTED TOMOGRAPHY	
DIAGNOSTIC RADIOLOGY	
✓ MAGNETIC RESONANCE IMAGING	
□ NUCLEAR RADIOLOGY	
☐ ULTRASOUND	
Woncontrast Head CT	
4'.38/m /VONCONTICE OF	

9mm throk bilateral frontal and 5mm throk bilateral temperal subdural hematomas (slightly greater density than CSF).

bilateral parietal skull Fractures.

4 left and one right sided parietal 3-8 mm foci of low attonuation, possibly related to contasions or shear injuries.

Proserved lateral, 3rd & 44h ventricles et suprasellar et basilar ciationa,

Full Report To Follow

PRELIMINARY REPORT

# REPORT OF ELECTROPHCEPHALOGRAP

Re:

Referred by: Handedness:

DOB: Age:

Location:

Gestation:

Medication: none

motor vehicle accident - rule out epilepsy.

A 10 channel EEG was performed utilizing the Standard 10-20 System REPORT: International Electrode Placement. Both an awake and sleep tracing were The basic background activity during this tracing consists of a recorded. somewhat low voltage and poorly developed background for age of 2 to 3 cps delta activity at 25 to 40 uv that sometimes reaches up into the theta range. An ECG monitor demonstrates a regular rhythm. There is no evidence of focal slowing, persistent asymmetry, or paroxysmal activity.

Normal awake and sleep EEG.

Pediatric Neurology

LT/st

NEURODIAGNOSTIC REPORT

REPORT OF ELECTROPHICEPHAGOGRAM

Name:

DATE OF ADMISSION: DATE OF DISCHARGE:

BEST AVAILABLE COPY

### ADMITTING PHYSICIAN:

REASON FOR ADMISSION: Status post motor vehicle accident with multiple trauma.

PATIENT PROFILE: The patient is a three-month-old infant involved in a motor vehicle accident where he was hit in the head and the face with the air bag.

### PRINCIPAL DIAGNOSES:

- 1. Closed head trauma with small contusion of the right parietal lobe.
- 2. Small contusion on the right temporal lobe.
- 3. Old subdural hematoma.
- 4. Concussion.
- 5. Occipital fracture.

OTHER PROBLEMS:

None.

### PROCEDURES:

Observation.

MANAGEMENT OF PROBLEMS: The patient was admitted to the Emergency Room after being transferred from . Hospital. A CAT scan of the head had been obtained there which showed the findings listed above. A Neurosurgery consultation was obtained to follow up on the CAT scan findings. They felt comfortable just observing the patient since there was no mass lesion in within the brain. The C-spine had been cleared Hospital. Our x-rays and, due to staff at the low of the company we felt that the C-spine wers also clear from our point of view. Chest and pelvic x-rays were brought from the other hospital which also showed no fractures. The patient was admitted to the Intensive Care Unit for observation. He remained stable and his neurological function improved slowly but continuously. After 24 hours of observation the patient was fed and he tolerated his feedings without any difficulty. He was transferred to the Basic Care Unit. After 48 hours of observation the patient was afebrile. Vital signs were stable. He was tolerating his regular diet without any difficulty. He had no obvious neurological deficit. The neurosurgeons were again consulted and they felt comfortable sending the patient home. It was decided to send the patient home.

DISCHARGE INSTRUCTIONS: DISPOSITION: The patient was discharged to home. DIET: Diet for age. ACTIVITIES: As tolerated. MEDICATIONS: None. FOLLOW-UP: Pediatric Neurosurgery in three to four weeks with

DISCHARGE SUMMARY

24-0643C (5/93)

Page 2

şæ

ずってな

BEST AVAILABLE COPY

The parents were also instructed to bring the patient to the Emergency Room if any problems surfaced after discharge and to follow up in Clinic.

(H,

ATTENDING PHYSICIAN

DISCHARGE SUMMARY

24-0643C (5/93)

# ATTENTION!!

MISSING INFORMATION

[X] ADMITTING PHYSICIAN: [X]ATTENDING PHYSICIAN

OTHER:[

•

BLANK: PAGE [1] PARAGRAPH [ ] Under MGMT OF PROBLEMS BLANK: PAGE [1] PARAGRAPH [ ] LAST dr.'s name

LINE [8]

LAST LINE

SOUNDS LIKE:

DISCHARGE SUMMARY

24-0643C (5/93)

	DATE	,	TIME		TRAUMA TEAM ACTIVATED	TRANSFERRING FACILITYPHT DICING
	HICTORY	/Industrial [	1		☐ Yes ☐ No	
- 120. 210.	1					Time of accident
25		JM/o	restruid	ے مشہر	in seed or box	Speed
	of can rest stand & air lon Helmer 1 Yes 1 No					
5-65	( ) ( ) ( ) ( ) ( ) ( ) ( ) ( ) ( ) ( )					
		7 Man	seguine :	eyez	- , ming tet	Ejected from vehicle Yes feet
	1	31 then	- ml 4.	en int	attentine).	Extent of compartment damage
					-	
		2 Centers	4 Plan	150	is " De Quant)	Vely
					•	0
	Hesuscitation	& Procedures in El	D or Other Facility			
	IVs V				DPL	
	Cutdown				Chest Tube(s)	
	CVP	_			•	
- 1.		•			0,	•
	ntubation				EKG	
F	oley				Other	
N	IGT					
14.54			cify (Allergies, medica	itions, Previous	Surgeries, Transfusion, Medical Pro	oblems)
Ť	are	: Ø				
	mul	, p				
Î		1.	_			
*	JIVVI	118H 0	he spul	word	ajent Close	
<b>.</b>			/		(/	
						( William)
er	пр	B/P	HR	RR	Trauma Score GCS	Eye Opening Verbal Response Moter-Response
			1		17/	4 (1)
	SICAL EXAL		<u> </u>			
[	ISICAL EXA	M L Times sur	elly anj	X		Ande Trong with
:::ea		14. 16	0		Le Spine Men	lander with
	$\cup_{\mathcal{O}}$		certain / s	of a factor		. / 1
Eyes	· me	hems		-	Chest CPA	with in no estymme
	Cla	m Tre le	100			
- Ta					Heart M	*
Orop	harynx C	len			Lungs CF	ب
	ُ سے	6.700	Ca.			
ia	9	factal.	यह 🐣			1
	_					
F. CK	Tuo	ONT		· • .		
Back	of Head	1	1 1-	,		
	c	a obane.	ref 6 mm	•	⊀	
独		N	welly on	s o segu	<b>1</b> 0	, ,
		***************************************		•		:
<u> </u>		=1			4	PATIENT IDENTIFICATION
i .		11			-	

TRAUMA SERVICE HISTORY & PHYSICAL

a/a 26.0479 (8.0M

41 ....

Other -

ASSESSMENT / DIAGNOSIS	BEST AVAILABLE COPY
External	Head (including face)
$\mathcal{P}$	149
lad.	
leck	Thorax
Cleared by The	_ Clean
fallman	
ADV is the Determine	
Cleared by the ficility  Low inder suspection  - Noworns follow	
- Nowosmi Lollon	
, 7,000	
V	••
domen / Pelvic Contents	Spine
	Spine Whe
Clear	
- 000	
	_
remities / Bony Pelvis	
	Non-Trauma / Complications
Mon	None
-	
1/2 2	
Newsony court	
Admit	
	:
Flu CBC	<b>₹</b>
Abtenda religion Com	4 Alux Nelson
RP(COUT) - Species - Spring	J. J. J. J.
Often repeat cspr	
VV. XX   0.	
	Li Giran Maria
	M.D.
	Resident Atte
	PATIENT IDENTIFICATION
TRAUMA SERVICE HISTORY & PH	VSICAL L
Continued	
Continued	Page +
	™ 28-0439 (8-g <sup>-</sup>

1

-

DATE OF CONSULTATION:

REFERRING PHYSICIAN:

CONSULTING PHYSICIAN:

REASON FOR CONSULTATION: Reported subdural hematomas with skull fractures in a two-month-old.

PATIENT IDENTIFICATION: This is a nearly three-month-old white female with no significant past medical or past surgical history who was restrained in a car seat which was struck from behind by the air bag after the car collided head on with another care. She suffered a loss of consciousness and was reported to have a head computed tomography scan with subdural hematomas, contusions and skull fractures. The patient was transferred to \_\_\_\_\_\_\_ from Hospital.

HISTORY OF PRESENT ILLNESS: The patient was in the car at around 1:00 p.m. She was secured in a car seat facing away from the windshield in front of a dash which had an air bag. The car was going at 15 miles per hour on a dirt road when it was struck head-on by another car going 35 miles per hour. The air bag opened and apparently crushed the back of the car seat. The mother received minor injuries with a broken arm. She noticed the child to be "not responsive" for about 15 minutes. Specifically, her eyes were open. She was moving all four extremities. She then seemed fine but not as fully attentive per the mother. She was taken to the Hospital. They did a computed tomography scan which was read to the service as "having four fractures" and "subdural hematomas". She was taken by Pediatrics . The patient arrived alert and oriented, fully responsive and was taken to the Pediatric Intensive Care Unit.

PHYSICAL EXAMINATION: NEUROLOGICAL EXAMINATION: MENTAL STATUS: a Pediatric Glasgow Coma Scale, the eyes were 4, the verbal was 4, and the child cries but is consolable. The motor is 4, and the child moves all extremities. So while this total is a 12, it should be reminded that is a test on an infant. The infant otherwise behaves as a normal three-month-old. She moves all four extremities. Tense to the examiner. Cries when the painful area of her occiput is palpated but is consolable readily by her mother. CRANIAL NERVES: Cranial nerves II through XII are serially observed and were found to be grossly intact. MOTOR EXAMINATION: There is good strength in all extremities. Reflexes are physiologic with Babinski absent on the right, equivocal on the left. SENSORY EXAMINATION: Sensory appears to be grossly intact. GENERAL EXAMINATION/HEAD: There is soft tissue swelling all across the occiput which is tender to the child. There do not seem to be any other contusions in the head area. The tympanic membranes are The fontanelle is soft. NECK/SPINE: The neck appears to be nontender along with the spine. LUNGS: Clear to auscultation bilaterally. ABDOMEN: Soft and appears to be nontender. Positive

CONSULTATION REPORT

24-0643B (5/93)

bowel sounds. EXTREMITIES: There appears to be no obvious trauma to the extremities.

# COMPUTED TOMOGRAPHY:

- 1. There is a fracture in the bone windows of both the right and the left occiput with overlying soft tissue swelling.
- 2. There is a very small, less than 5 cm in width and maybe 1 cm in length and lasts for only one slice increased density in a gyri high in the right parietal lobe but has no surrounding decreased density. This is suggestive of a small contusion but without any surrounding edema.
- 3. There is a very questionable rim of increased density on the right temporal lobe. This could be consistent with a cortical contusion.
- 4. There is, however, no shift. The cisterns are open. The gyri are open, and the gray-white junction is preserved.
- 5. There are subdural fluid collections with no mass effect. On this computed tomography scan, isodensity of cerebrospinal fluid, gyri. At present it appears that this might be just either a minor or a small leak or some cerebrospinal fluid which has maybe been colored with some blood. It is hard to tell. It certainly does not appear to an acute subdural hematoma, and it certainly does not appear to correlate with the physical examination to offer any clinical significance at this time.
- 6. Finally, there is a cavum septum pellucidum which has no significance at this point.

### IMPRESSION:

This is a child who has suffered a concussion with contusions who now appears to be neurologically intact. We feel that the computed tomography scan does not demonstrate a mass lesions requiring neurosurgical attention.

# **RECOMMENDATIONS:**

- 1. Complete cervical spine films. There is a low index of suspicion for cervical spine injury.
- 2. Skull films. We would like to have completion of skull films to delineate the extent of fractures in the occiput.
- 3. We would agree with conservative care at this time, and we thank the Trauma Service for admitting the patient, for their work, and to the Pediatric Intensive Care Unit Team for their immediate work in the Emergency Room and in subsequent admission.

CONSULTING PHYSICIAN

cc:

cc:

CC:

CONSULTATION REPORT

24-0643B (5/93)

CONSULT

O your distriction	
EQUESTED BY ATTENDING PHYSICIAN	CONSULTING SERVICE:
A COM POR REQUIPER	Al . a Il .3 - Ali A A
ASON FOR REQUEST:	
SON/ read SD	
TE / , TIME 10 None	10 WW Lat - 101/4 B) 110=
17 8:00pm LO 13m,	
anting.	10 WY windert in MVA & ALOE mill P puits contino ? A tangent type
we distate	
/-	***
'E grong rel me ditte	and 1400)  (Sifut reale) - Certo commelle  (infut reale)
	4
EN 1- THU 605/	Carro constitue
	(infut reale)
My	( infant reale
	/ 32 02 0/1
1 () FR of ( D) scripith come and overlying seft to the med	
orelin reto the	Greight ame
(a)	7
LO-Sund I can amone	Lin de CAO LES
sunded	the Aling D hip puited & belong
(3) 294 50 TV	De Nifo Existen / Spri / Swips Ommelfort CSF
I talk the tongent (	Wife Dusten/Spi / Sun
. O Sdund bland collection	Gumeffet
Mem	~ CSF
1 16 ef comme an interne.	
	Lete is never served
, oc your biles	
Bc- mie bilas De skull film	pt. seen + uf
3) Comenter come	
M.D.	M.D.
(	(G-PHYSICIAN)
DESIDENT'S SIGNATURE	670 CONSULTING PHYSICIAN'S SIGNATURE
	F 70 CONSOLUTING PHISICIANS SIGNATURE
CONSULTATION REPO	ORT .

23-0048 (11/93)